

#### 5000 SERIES STALK DEVASTATOR CORN STALK ROLLER \*PATENTED\*

5000-025D, 5000-026D, 5000-027D, 5000-028D, 5000-034C

John Deere Model Corn Heads (606C, 643, 693, 706C, C6R, 608C, 843, 893, 708C, C8R, 612C, 612FC Folding, 712C, 1243, 1293, C12F, C12R, 616C, 716C, & C16R)

> OWNER'S MANUAL PART IDENTIFICATION 2565-785\_Rev\_H - 03/2024





YETTER MANUFACTURING CO. Founded 1930 Colchester, IL 62326 Toll free: (800)447-5777. Fax: (309)776-3222 Website: yetterco.com E-mail: info@yetterco.com



#### **DEVASTATOR OPERATION CHECKLIST**

#### Please fill this out after the Yetter Stalk Devastator has been installed.

| DATE//             | YETTER KIT # - 5000 |               | CORN HEAD MAKE/MODEL          |                  |
|--------------------|---------------------|---------------|-------------------------------|------------------|
| COMBINE MAKE/MODEL | FRON                | T TIRE SIZE   | REAR TIRE SIZE                |                  |
| REAR AXLE POSITION | SNAPPING R          | ROLLS USING   | CHOPPING BLAD                 | ES YES / NO      |
| DECK PLATE ANGLE°  | (USE ANGLE FINDER)  | SNAPPING ROLL | HEIGHT (OPERATING POSITION)   | )INCHES          |
| HARVEST SPEEDMPH   | HEAD SPEAD          | ANGLE TORSION | I ARM (OPERATING POSITION - U | SE ANGLE FINDER) |
| HEAD CART INFO:    |                     |               |                               |                  |
| MAKE/MODEL         | LENGTH              | TIRI          | = SIZE                        |                  |

#### **Table of Contents**

| Foreword                          | 3                  |
|-----------------------------------|--------------------|
| Warranty                          | 3                  |
| Safety Information                | 4 - 6              |
| Bolt Torque & Tools Required      | 8                  |
| Assembly Instructions             |                    |
| 5000-025D                         | 9-13               |
| 5000-026D                         | 14-18              |
| 5000-027D                         | <mark>19-23</mark> |
| 5000-028D                         |                    |
| <mark>5000-034C</mark>            | <mark></mark>      |
| Operation / Maintenance / Lock Up |                    |
| Part Identification               |                    |
| Troubleshooting                   |                    |



FOREWORD

You've just joined an exclusive but rapidly growing club.

For our part, we want to welcome you to the group and thank you for buying a Yetter product.

We hope your new Yetter products will help you achieve both goals-increase your productivity and increase your efficiency so that you may generate more profit.

This operator's manual has been designed into four major sections: Foreword, Safety Precautions, Installation Instructions and Parts Breakdown.

This **SAFETY ALERT SYMBOL** indicates important safety messages in the manual. When

you see this symbol, be alert to the possibility of **PERSONAL INJURY** and carefully read the message that follows.

The word **NOTE** is used to convey information that is out of context with the manual text. It contains special information such as specifications, techniques and reference information of a supplementary nature.

The word **IMPORTANT** is used in the text when immediate damage will occur to the machine due to improper technique or operation. Important will apply to the same information as specified by note only of an immediate and urgent nature.

It is the responsibility of the user to read the operator's manual and comply with the safe and correct operating procedure and to lubricate and maintain the product according to the maintenance schedule in the operator's manual.

The user is responsible for inspecting his machine and for having parts repaired or replaced when continued use of the product would cause damage or excessive wear to the other parts.

It is the user's responsibility to deliver his machine to the Yetter dealer who sold him the product for service or replacement of defective parts, which are covered by the warranty policy.

If you are unable to understand or follow the instructions provided in this publication, consult your local Yetter dealer or contact:

#### YETTER MANUFACTURING CO.

309/776-4111 800/447-5777 309/776-3222 (FAX) Website: www.yetterco.com E-mail: info@yetterco.com

#### WARRANTY

Yetter Manufacturing warrants all products manufactured and sold by it against defects in material. This warranty being expressly limited to replacement at the factory of such parts or products as shall appear to be defective after inspection. This warranty does not obligate the Company to bear cost of labor in replacement of parts. It is the policy of the Company to make improvements without incurring obligations to add them to any unit already sold. No warranty is made or authorized to be made, other than herein set forth. This warranty is in effect for one year after purchase.

DEALER: \_\_\_\_\_

Yetter Manufacturing warrants its own products only and cannot be responsible for damages to equipment on which mounted.

### BE ALERT! YOUR SAFETY IS INVOLVED



#### WATCH FOR THIS SYMBOL. IT POINTS OUT IMPORTANT SAFETY PRECAUTIONS. IT MEANS "ATTENTION – BE ALERT!"

It is your responsibility as an owner, operator, or supervision to know and instruct everyone using this machine at the time of initial assignment and at least annually thereafter, of the proper operation, precautions, and work hazards which exist in the operation of the machine in accordance with OSHA regulations.


#### Safety Is No Accident

The following safety instructions, combined with common sense, will save your equipment from needless damage and the operator from unnecessary exposure to personal hazard. Pay special attention to the caution notes in the text. Review this manual at least once a year with all operators.



- 1. Read and understand the operator's manual before operating this machine. Failure to do so is considered a misuse of the equipment.
- 2. Make sure equipment is secure before operating.
- 3. Always keep children away from equipment when operating.
- 4. Make sure everyone that is not directly involved with the operation is out of the work area before beginning operation.
- 5. Make sure all safety devices, shields, and guards are in place and functional before beginning operation
- 6. Shut off all power to adjust, service, or clean.
- 7. Keep hands, feet, and clothing away from moving parts. It is a good idea to remove all jewelry before operating.
- 8. Inspect the machine periodically during operation for signs of excessive wear, loose fasteners, and unusual noises.

# PLEASE READ, VERY IMPORTANT

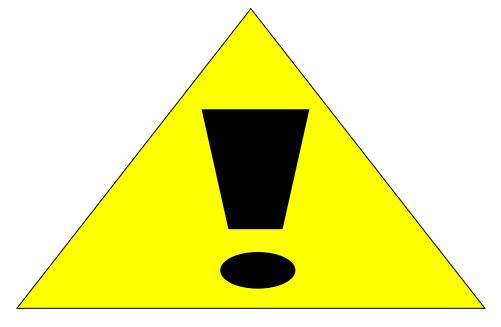

#### SECURE CORN HEADER AGAINST UNWANTED LOWERING BY APPLYING THE LOCKING MECHANISM ON THE HYDRAULIC CYLINDERS!



- 1. Attach head to combine, lock head to combine
- 2. Raise the head off the ground and engage safety stop on the feeder house cylinder.
- 3. Apply combine parking brake, turn off combine engine, and remove the key
- 4. Wear personal protective equipment during installation: steel toe footwear, safety glasses, & gloves

#### FOLLOW ALL INSTRUCTIONS GIVEN BY THE COMBINE MANUFACTURER

# PLEASE READ, VERY IMPORTANT



Subject to the size and weight of the corn header, one or two additional hydraulic cylinders may be required.

The combine manufacturer generally keeps corresponding kits readily available for dealers.

Subject to the design of the corn header and the carrying capacity of different combines, the steering axle may require the fitting of additional weights and the rear tires be filled with ballast.

#### FOLLOW ALL INSTRUCTIONS GIVEN BY THE COMBINE MANUFACTURER

#### BEFORE INSTALLATION BEGINS, PLEASE CHECK THAT ALL PARTS WERE RECEIVED BY GOING THROUGH THE CRATE AND SORTING THE PARTS!!!

**5000-025D – JD 606C, 643, 693, 706C, C6R & Wheel tracks only for 612C, 712, 1243, 1293, C12F/R, 616C, 716 & C16F/R Part List**: 1) 5000-165, 4) 5000-190, 4) 5000-191, 2) 5000-2010, 2) 5000-2011, 4) 5000-202, 2) 5000-272, 2) 5000-275A, 4) 5000-355

**5000-026D – JD 608C, 708C, 843, 893, & C8R Part List:** 1) 5000-165, 6) 5000-190, 6) 5000-191, 2) 5000-192, 3) 5000-2010, 3) 5000-2011, 6) 5000-202, 1) 5000-203B, 1) 5000-255, 2) 5000-272, 2) 5000-275A, 6) 5000-355

**5000-027D – JD 612C, 712C, 1243, 1293, C12F & C12R Part List:** 1) 5000-165, 8) 5000-190, 8) 5000-191, 2) 5000-192, 4) 5000-2010, 4) 5000-2011, 8) 5000-202, 4) 5000-272, 4) 5000-275A, 8) 5000-355

**5000-028D – JD 616C, 716C, & C16R Part List:** 1) 5000-165, 12) 5000-190, 12) 5000-191, 6) 5000-2010, 6) 5000-2011, 12) 5000-202, 2) 5000-203B, 2) 5000-255, 4) 5000-272, 4) 5000-275A, 12) 5000-355

**5000-034C – JD 612FC, 712FC Folding Part List:** 1) 5000-165, 8) 5000-190, 4) 5000-191, 4) 5000-193, 2) 5000-2010, 6) 5000-2011, 4) 5000-202, 4) 5000-263, 4) 5000-272, 4) 5000-275A, 8) 5000-355

# **BOLT TORQUE**

**Important:** Over-tightening hardware can cause just as much damage as under-tightening. Tightening hardware beyond the recommended range can reduce its shock load capacity.

All hardware on the 5000 Devastator is either Grade 5 or Grade 8, unless otherwise noted. Grade 5 cap screws are marked with three radial lines on the head. Grade 8 cap screws are marked with six radial lines on the head. If hardware must be replaced, be sure to replace it with hardware of equal size, strength and thread type. Refer to the torque values chart when tightening hardware.

The chart below is a guide for proper torque. Use it unless a specified torque is called out elsewhere in the manual.

Torque is the force applied to the end of the handle or cheater bar, times the length of the handle or bar.

#### Use a torque wrench wherever possible

The following table shows torque in ft.-lbs. for coarse thread hardware.

| Bolt Diameter<br>and Threads per<br>Inch | Grade 2 | Grade 5 A-325 | Grade 8 |
|--|---------|---------------|---------|
| 1/4                                      | 6       | 10            | 14      |
| 5/16                                     | 12      | 20            | 30      |
| 3/8 –16                                  | 25      | 35            | 50      |
| 7/16 – 14                                | 35      | 55            | 80      |
| 1/2 – 13                                 | 55      | 85            | 125     |
| 9/16 – 12                                | 75      | 125           | 175     |
| 5/8 – 11                                 | 105     | 170           | 235     |
| 3/4-10                                   | 185     | 305           | 425     |
| 7/8 – 9                                  | 170     | 445           | 690     |
| 1-8                                      | 260     | 670           | 1030    |
| 1 1/8 – 7                                | 365     | 900           | 1460    |
| 1 1/4 - 7                                | 515     | 1275          | 2060    |
| 1 3/8 –6                                 | 675     | 1675          | 2700    |
| 1 1/2 - 6                                | 900     | 2150          | 3500    |
| 1 3/4 – 5                                | 1410    | 3500          | 5600    |

#### **INSTALLATION TOOLS REQUIRED:**

- Pneumatic or electric impact driver
- 3/4 & 15/16 size sockets
- 10" impact driver extension
- Ratchet
- 3/4, 15/16, & 1 1/8 size wrenches
- 5/16 Allen Wrench
- Torque Wrench




(606C, 643, 693, 706C, C6R or Wheel Track only on 12 & 16 row JD corn heads)




**Step 1:** Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, and 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 4 & 5, and 5 & 6. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed.


Note: Do not fully tighten hardware until Step 6 after all of the pivot arms & springs are installed.

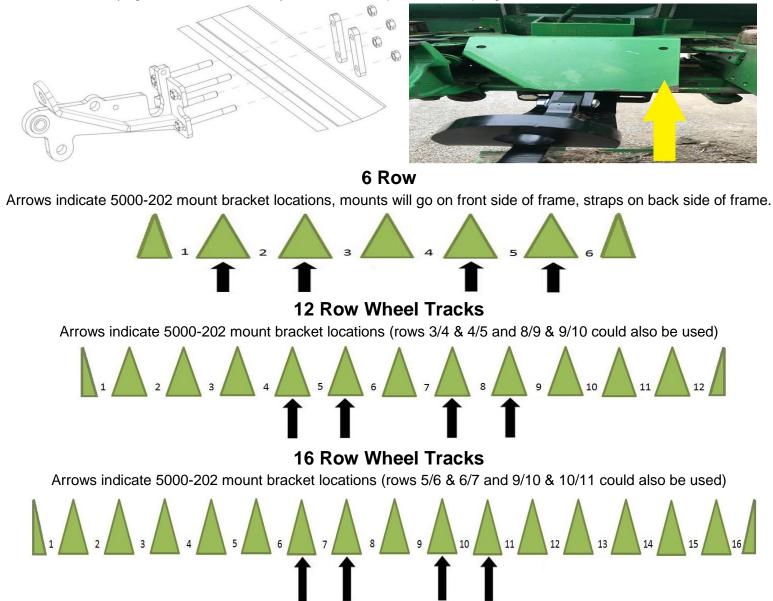


**Step 2:** Attach the 5000-309 support straps using ½" x 2 carriage bolts & ½" flange lock nuts, tighten.

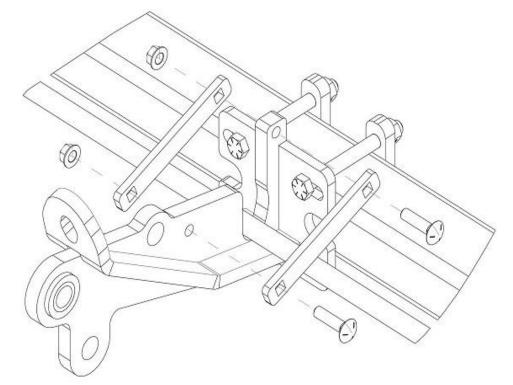

Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

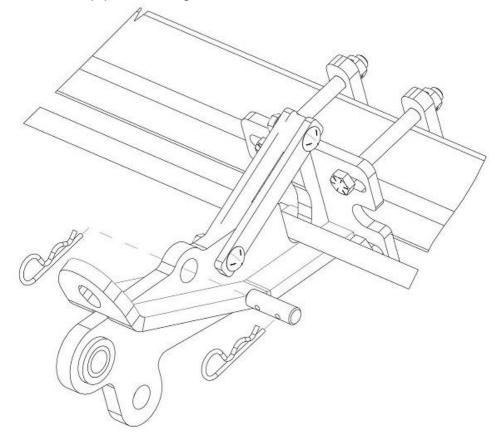


**Step 4:** Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

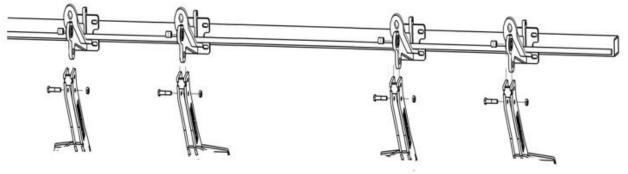

**Step 5:** Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and  $\frac{1}{2}$ " jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and  $\frac{3}{4}$ " lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

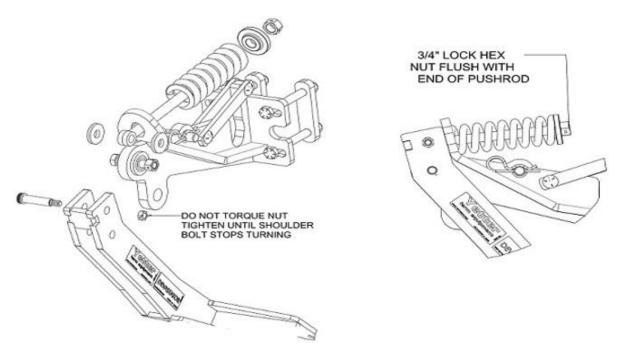

**NOTE:** Tightening the nut on the spring bushing more will result in added down pressure.


**Step 6:** Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp (5000-2010 & 5000-2011) should be under the center of the snout, not directly under the row.




- **Note:** On 12 row heads installing on wheel tracks only, the top pictures on this page will illustrate rows 4 & 5 and 5 & 6. The bottom pictures on this page will illustrate rows 7 & 8 and 8 & 9.
- **Note:** On 16 row heads installing on wheel tracks only, the top pictures on this page will illustrate rows 6 & 7 and 7 & 8. The bottom pictures on this page will illustrate rows 9 & 10 and 10 & 11.

**Step 7:** Install the Roller Arm Mount Tube to the pivot arms. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

**NOTE:** Install the Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.

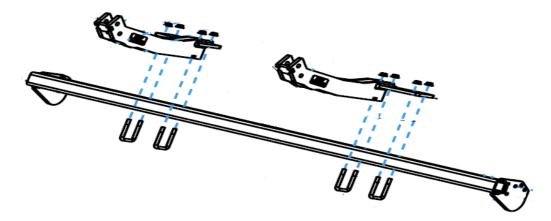

**Step 8:** Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the  $\frac{1}{2}$ " X 2  $\frac{1}{2}$ " bolts & tighten the  $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly centered under each row.

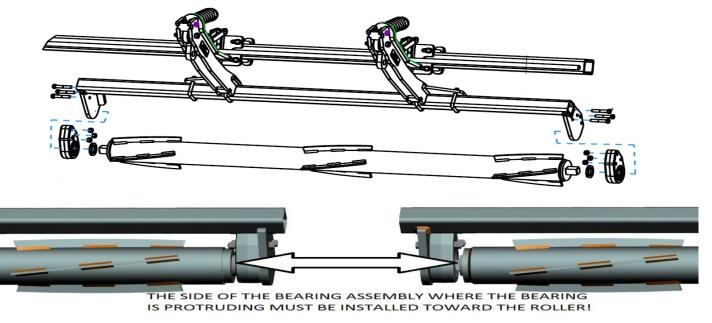

NOTE: BEARING HOUSING SHOULD BE LUBRICATED WITH POLYUREA GREASE BEFORE USE AND THEN EVERY 100 HOURS OF OPERATION





(JD 608C, 708C, 843, 893, & C8R)




**Step 1:** Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 3 & 4, 5 & 6, 6 & 7, and 7 & 8. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. On JD 893 corn heads, use the 5000-301 L Clamp Plate with the mounting brackets between rows 1 & 2 and 7 & 8 If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed.

Note: Do not fully tighten hardware until Step 6 after all of the pivot arms & springs are installed.

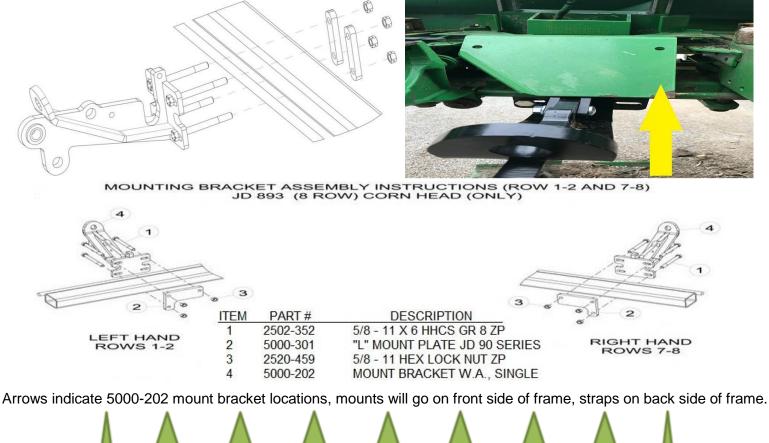


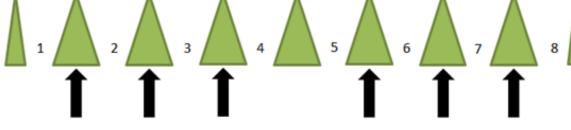


**Step 2:** Attach the 5000-309 support straps using ½" x 2" carriage bolts & ½" flange lock nuts, tighten.

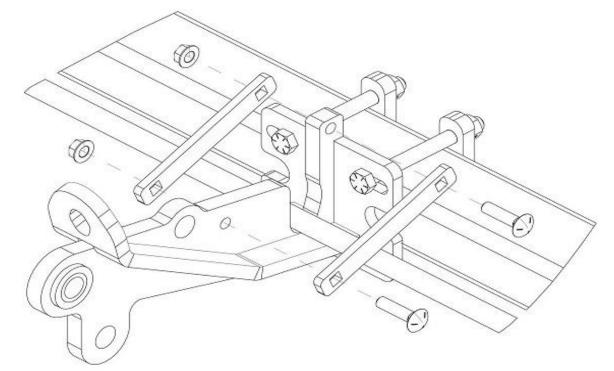

Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

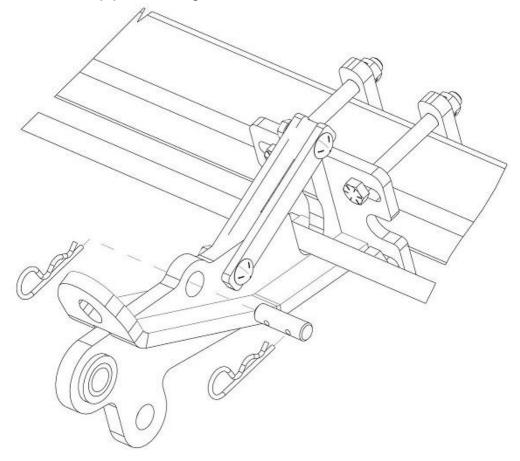


**Step 4:** Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.



**Step 5:** Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and  $\frac{1}{2}$ " jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and  $\frac{3}{4}$ " lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

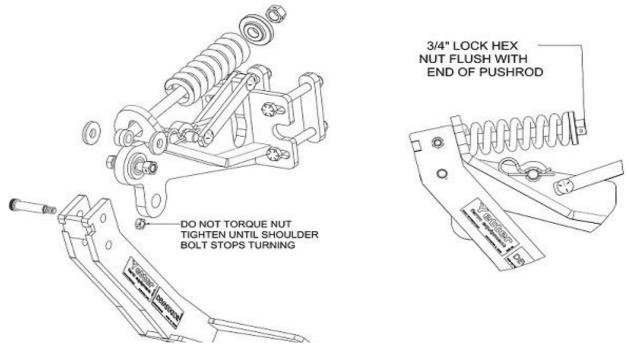


**NOTE:** Tightening the nut on the spring bushing more will result in added down pressure.

**Step 6:** Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8" lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.


Row 1 & 2



Row 3 & 4

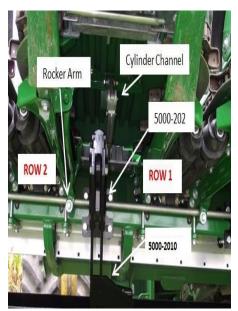




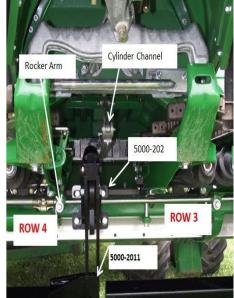

Row 7 & 8


Row 5 & 6

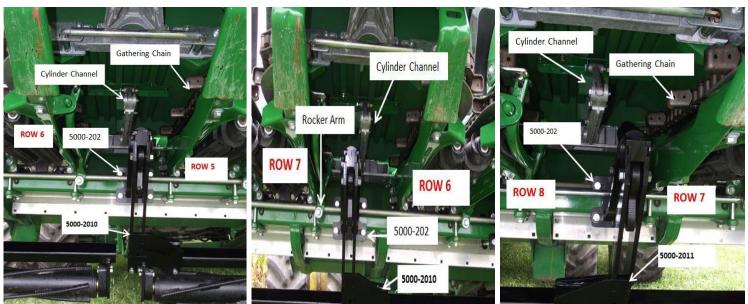


Row 6 & 7

**Step 7:** Install the Roller Arm Mount Tube to the pivot arms. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

**NOTE:** Install the 2 & 3 row Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.

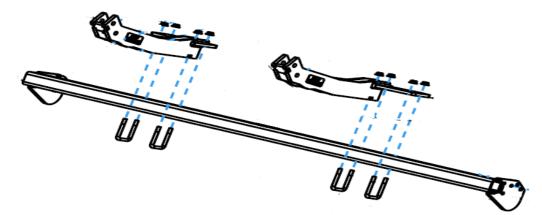

**Step 8:** Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the  $\frac{1}{2}$ " X 2  $\frac{1}{2}$ " bolts and tighten the  $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly centered under each row.

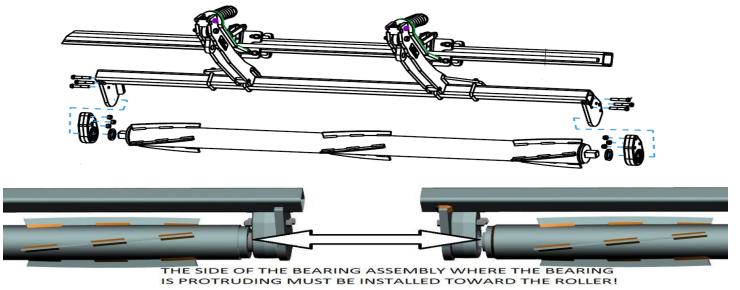


NOTE: BEARING HOUSING SHOULD BE LUBRICATED WITH POLYUREA GREASE BEFORE USE AND THEN EVERY 100 HOURS OF OPERATION




(JD 612C, 712C, 1243, 1293, C12F & C12R)




**Step 1:** Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 4 & 5, 5 & 6, 7 & 8, 8 & 9, 10 & 11, and 11 & 12. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. On JD 1293 corn heads, use the 5000-301 L Clamp Plate with the mounting brackets between rows 2 & 3 and 10 & 11. If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed. **Note:** Do not fully tighten hardware until **Step** 6 after all of the pivot arms & springs are installed.

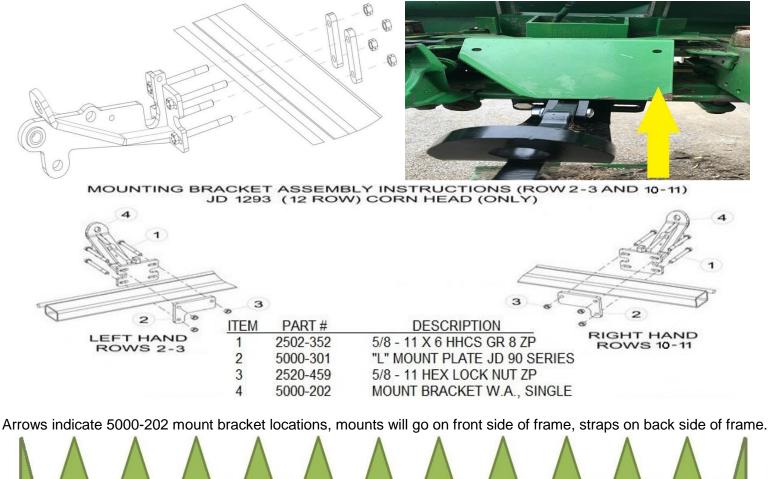


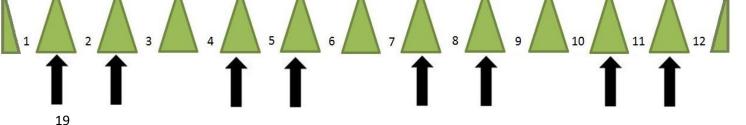


**Step 2:** Attach the 5000-309 support straps using ½" x 2" carriage bolts & ½" flange lock nuts, tighten.

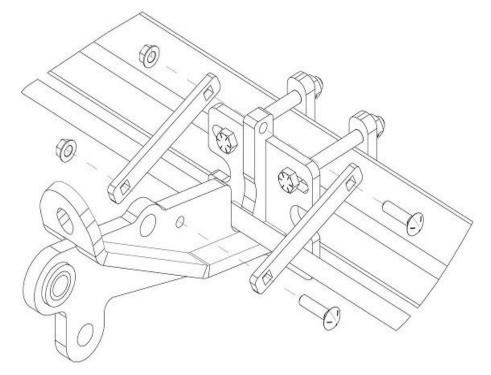

Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

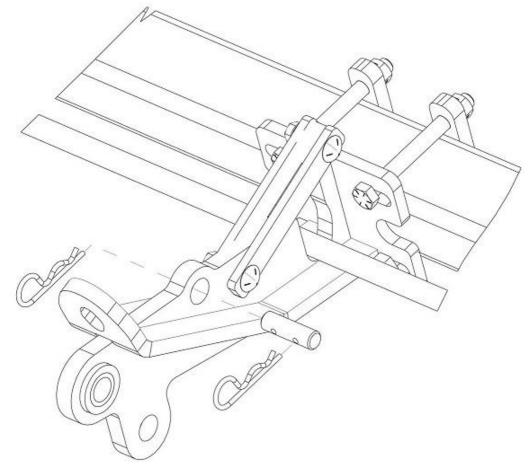


**Step 4:** Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

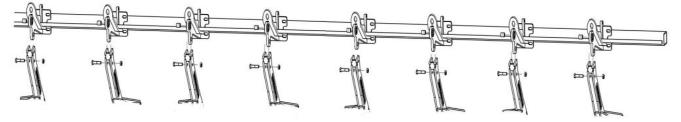

**Step 5:** Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and  $\frac{1}{2}$ " jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.


Now install the compression spring, spring bushing, and  $\frac{3}{4}$ " lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

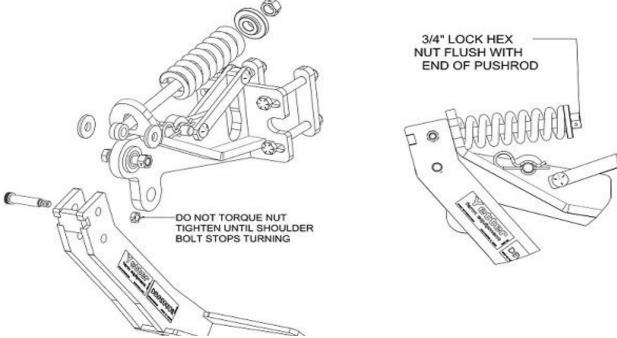


**NOTE:** Tightening the nut on the spring bushing more will result in added down pressure.

**Step 6:** Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.




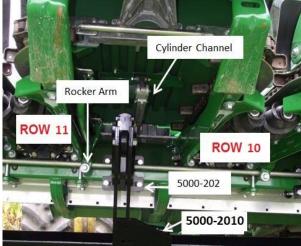

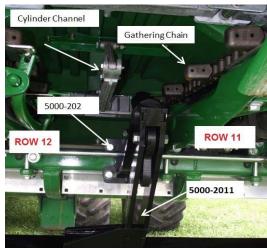


**Step 7:** Install the Roller Arm Mount Tube to the pivot arms. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

**NOTE:** Install the Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.

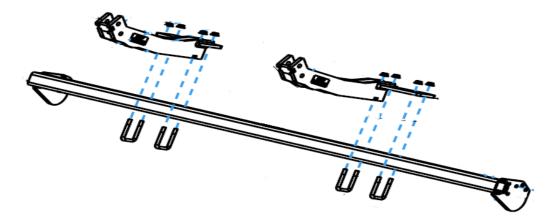


**Step 8:** Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the  $\frac{1}{2}$ " X 2  $\frac{1}{2}$ " bolts and tighten the  $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly under the row.

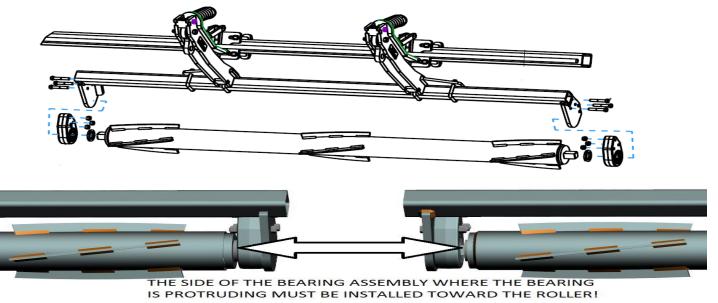

NOTE: BEARING HOUSING SHOULD BE LUBRICATED WITH POLYUREA GREASE BEFORE USE AND THEN EVERY 100 HOURS OF OPERATION




(JD 616C, 716C, & C16R)

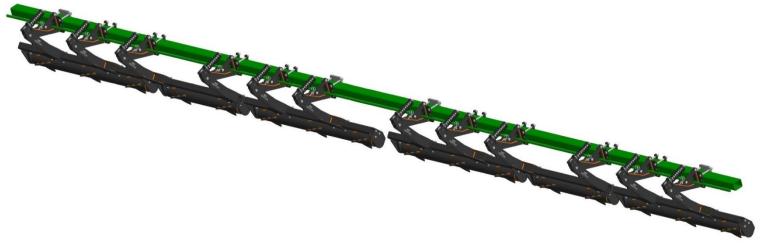


**Step 1:** Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 4 & 5, 5 & 6, 7 & 8, 8 & 9, 10 & 11, and 11 & 12. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed.


Note: Do not fully tighten hardware until Step 6 after all of the pivot arms & springs are installed.

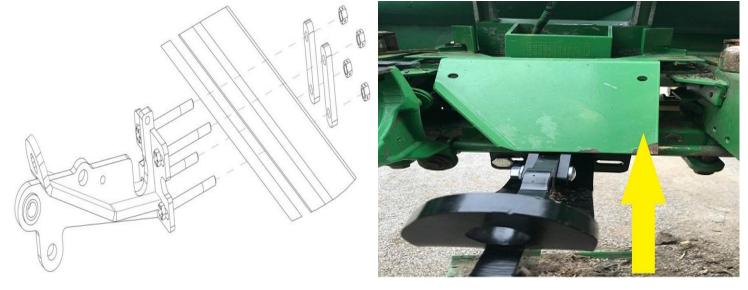


Arrows indicate 5000-202 mount bracket locations, mounts will go on front side of frame, straps on back side of frame.

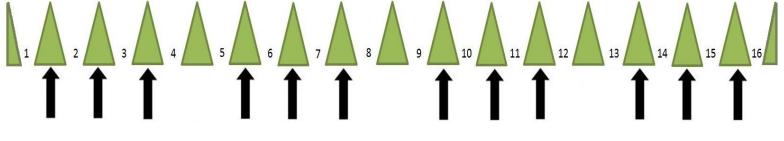


**Step 2:** Attach the 5000-309 support straps using ½" x 2" carriage bolts & ½" flange lock nuts, tighten.

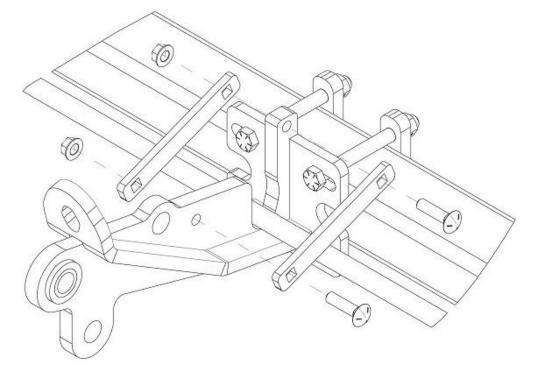

Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

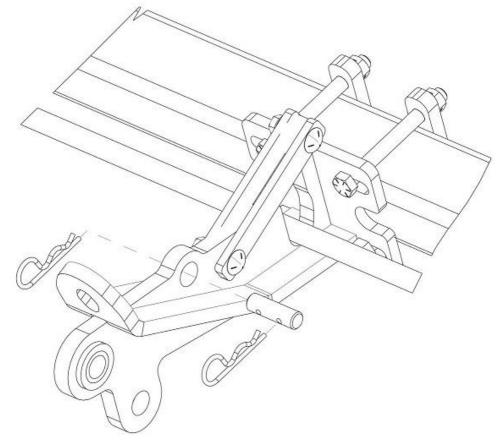


**Step 4:** Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

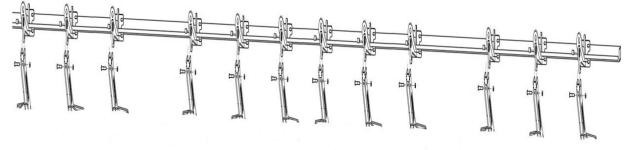

**Step 5:** Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and  $\frac{1}{2}$ " jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and  $\frac{3}{4}$ " lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

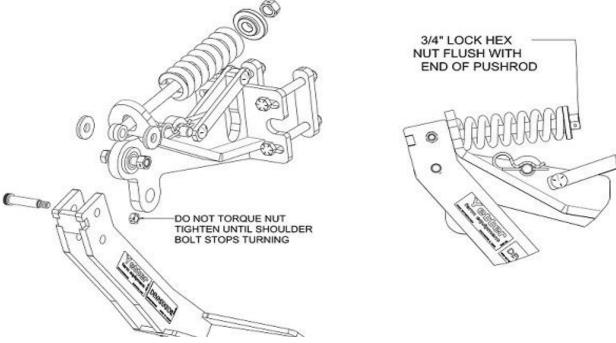

**NOTE:** Tightening the nut on the spring bushing more will result in added down pressure.


**Step 6:** Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.

Row 1 & 2

Row 2 & 3

Row 3 & 4

Row 7 & 8

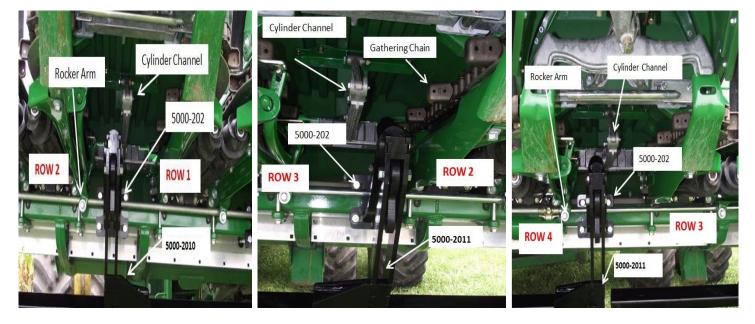

Row 5 & 6

Row 6 & 7



**Step 6:** Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.

Row 9 & 10


Row 10 & 11

Row 11 & 12




**Step 7:** Install the Roller Arm Mount Tube to the pivot arms. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

**NOTE:** Install the 2 & 3 row Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.

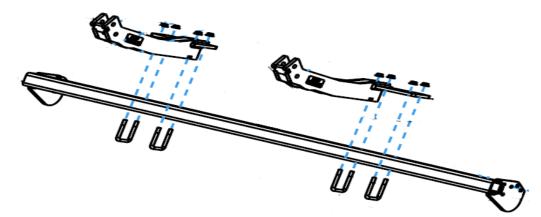

**Step 8:** Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the  $\frac{1}{2}$ " X 2  $\frac{1}{2}$ " bolts and tighten the  $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly under the row.

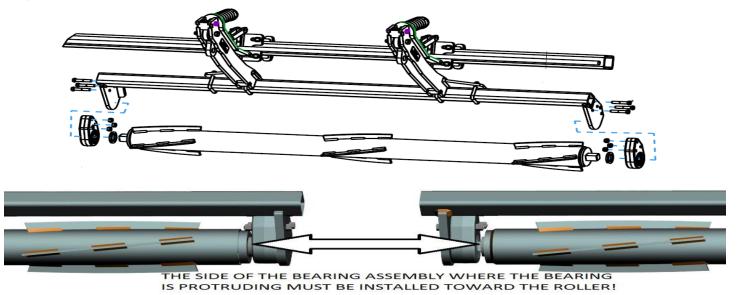


NOTE: BEARING HOUSING SHOULD BE LUBRICATED WITH POLYUREA GREASE BEFORE USE AND THEN EVERY 100 HOURS OF OPERATION






**Step 1:** Attach the 5000-202 mount brackets to the frame between rows 4 & 5, 5 & 6, 7 & 8, and 8 & 9 using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Attach the 5000-263 mount brackets to the frame between rows 1 & 2, 2 & 3, 10 & 11, and 11 & 12. The 5000-263 mounts between rows 1 & 2 and 2 & 3 will use 5/8 X 6 bolts, mounting straps, & 5/8" lock nuts. The 5000-263 mounts between rows 10 & 11 and 11 & 12 will each use 3) 5/8 X 6 bolts & 1) 5/8 X 6 Carriage bolts (1 used on the top left of each mount on these rows), mounting straps, and 5/8" lock nuts. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket.


Note: Do not fully tighten hardware until Step 6 after all of the pivot arms & springs are installed.

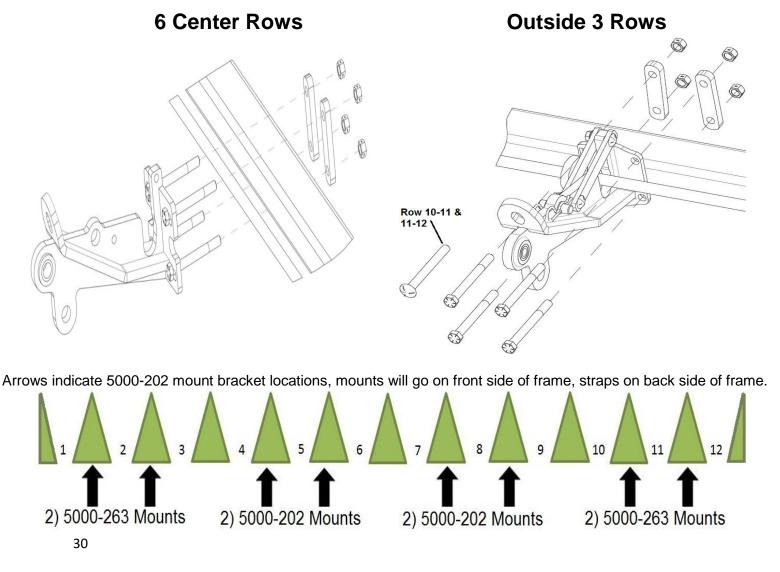


**Step 2:** Attach the 5000-309 support straps using ½" x 2" carriage bolts & ½" flange lock nuts, tighten.

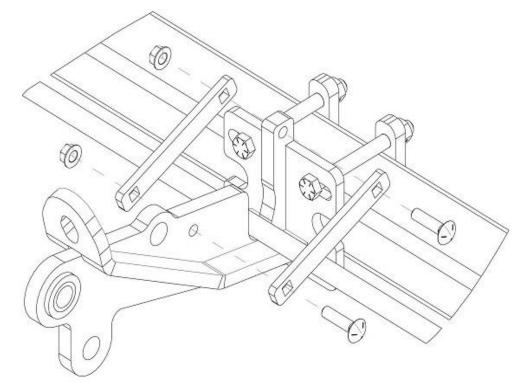

Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

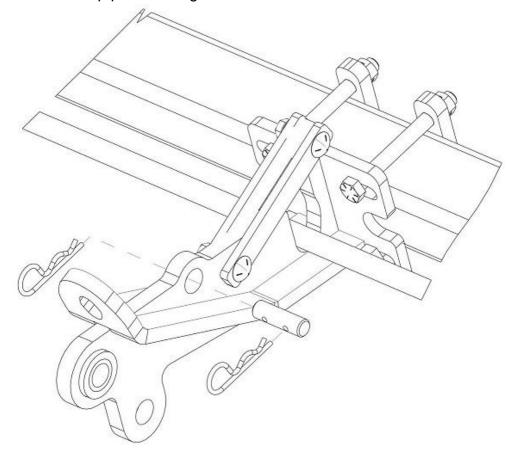


**Step 4:** Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

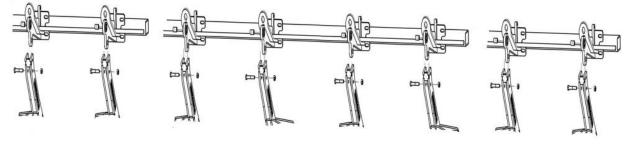

**Step 5:** Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and  $\frac{1}{2}$ " jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and  $\frac{3}{4}$ " lock hex nuts. The 5000-402 wedge will need installed between the compression spring and the mount bracket between rows 1 & 2 and 2 & 3 to keep the spring from contacting the gathering chains. Tighten the hardware from **Step 5** to the specification in the diagram below.

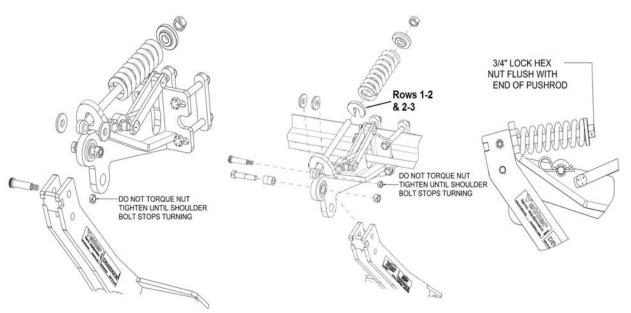

**NOTE:** Tightening the nut on the spring bushing more will result in added down pressure.

 Row 1 & 2 and 2 & 3

 Gathering chain

 5000

 263


 8

 50002011


 Row 2


 Rocker Arm



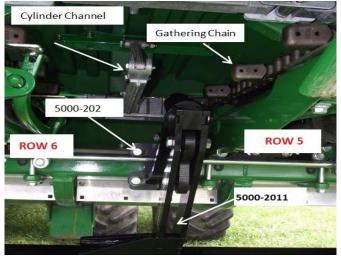


#### Row 8 & 9

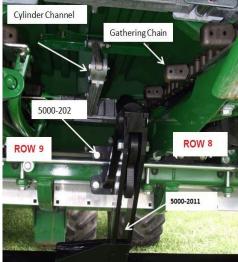

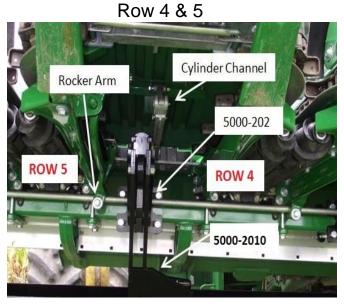


Row 7 & 8

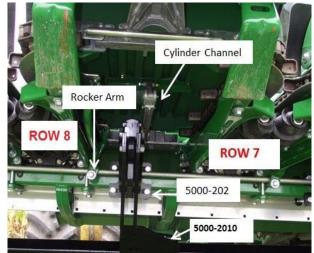


Row 10 & 11 and 11 & 12



**Step 7:** Install the Roller Arm Mount Tube to the pivot arms. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

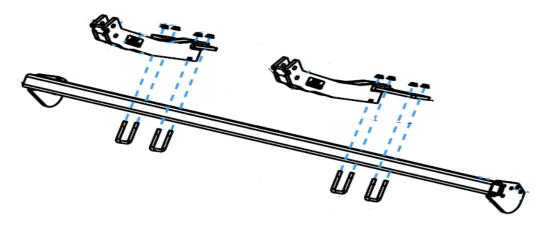

**Step 8:** Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the  $\frac{1}{2}$ " X 2  $\frac{1}{2}$ " bolts and tighten the  $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly under the row.

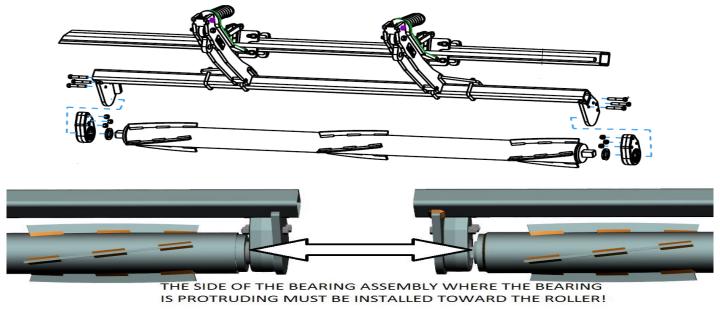

NOTE: BEARING HOUSING SHOULD BE LUBRICATED WITH POLYUREA GREASE BEFORE USE AND THEN EVERY 100 HOURS OF OPERATION



## **OPERATION**

**CORN HEAD ANGLE** SHOULD BE BETWEEN 23 – 25° FOR OPTIMUM DEVASTATATOR PERFORMANCE. USE THE 5000-455 TO CHECK CORN HEAD ANGLE:

- Put the combine on a level surface. Lower the Corn head to your normal working head height.
- Place the magnetic protractor on the stripper plate to get the angle. Adjust the feeder house as needed, fore or aft, to achieve 23 – 25 degrees.



## **BEARING REPLACEMENT/MAINTENANCE**

Put the bearing housing in a vice, use a pry bar to turn the bearing in the housing parallel with the slots, remove the old bearing, apply anti-seize lubricant to the interior of the bearing housing, insert the new bearing in the slots, & use a pry bar to move back to position. Wobble the bearing around to help work the lubricant into the outer race of the bearing.

NOTE: BEARING HOUSING SHOULD BE LUBRICATED WITH POLYUREA GREASE BEFORE USE AND THEN EVERY 100 HOURS OF OPERATION




## STORAGE

When storing the corn head for the offseason, it is OK for the 5000 Stalk Devastators to hold some weight of the corn head whether stored on the ground or on a trailer. Removing compression springs may help extend the service life.

#### LOCKING UP THE 5000 SERIES STALK DEVASTATOR




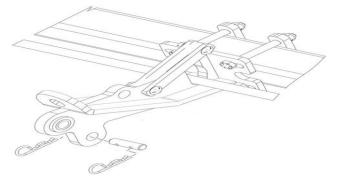

## PART IDENTIFICATION 5000-025C 6 ROW




| ITEM | PART #    | DESCRIPTION   | QTY |
|------|-----------|---|-----|
| 1    | 2502-352  | 5/8 – 11 X 6 HHCS GR 8                                  | 16  |
| 2    | 2502-353  | 1⁄2 – 13 X 2.5 HHCS GR 8                                | 12  |
| 3    | 2502-385  | 5/8-11 X 3.25 HHCS GR 5                                 | 4   |
| 4    | 2502-819  | ½ – 13 X 2.25 CARRIAGE BOLT GR 5                        | 8   |
| 5    | 2510-121  | 5/8 SHOULDER BOLT, 2 ¼ SHOULDER, ½ – 13 THREAD          | 4   |
| 6    | 2520-358  | 1/2 - 13 LOCK HEX NUT, GR 8                             | 12  |
| 7    | 2520-368  | 1/2 - 13 FLANGE WHIZ LOCK HEX NUT, GR 8                 | 28  |
| 8    | 2520-476  | 5/8-11 HEX FLANGE NUT GR 8                              | 20  |
| 9    | 2520-604  | 34-10 HEX TOP LOCK GR 8                                 | 4   |
| 10   | 2526-449  | 5/8 FLAT WASHER, ¼ THICK                                | 8   |
| 11   | 2550-709  | 1/2 WIRE 2 1/2 OD X 1 1/2 ID X 7 1/4 COMPRESSION SPRING | 4   |
| 12   | 2570-126  | 34 X 10 EYEBOLT   | 4   |
| 13   | 2570-465  | HAIRPIN COTTER  | 8   |
| 14   | 2570-690  | U-BOLT ½-13 X 2.5 X 3.75                                | 8   |
| 15   | 2975-302  | SPRING BUSHING  | 4   |
| 16   | 5000-2010 | PIVOT ARM LEFT HAND U-BOLT MOUNT                        | 2   |
| 17   | 5000-2011 | PIVOT ARM RIGHT HAND U-BOLT MOUNT                       | 2   |
| 18   | 5000-202  | MOUNT BRACKET   | 4   |
|      | 2528-369  | 1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE              | 4   |
| 19   | 5000-272  | 3R30 ROLLER   | 2   |
| 20   | 5000-275A | 3R30 ROLLER MOUNT                                       | 2   |
| 21   | 5000-309  | SUPPORT STRAP   | 8   |
| 22   | 5000-318  | PIVOT BUSHING   | 4   |
| 23   | 5000-319  | MOUNT STRAP 3"  | 8   |
| 24   | 5000-322  | SHIM WASHER   | 4   |
| 25   | 5000-323  | LOCK UP PIN   | 4   |
| 26   | 5000-355  | 1 ¼ DISC HARROW BEARING, W209PPB5, HD ASSEMBLY          | 4   |
|      | 2550-059  | DEVASTATOR BEARING ONLY (NO CAST HOUSING)               | 4   |

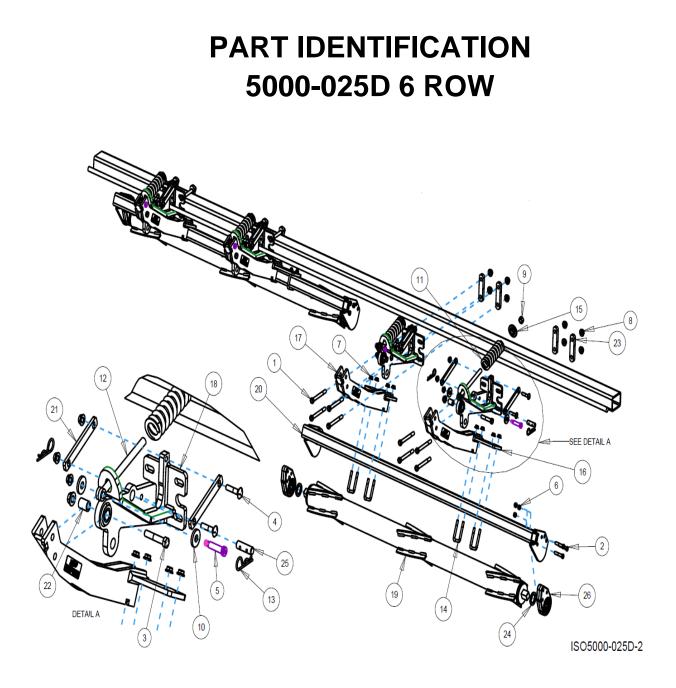

## PART IDENTIFICATION 5000-026D 8 ROW




| ITEM | PART #    | DESCRIPTION   |    |
|------|-----------|---|----|
| 1    | 2502-352  | 5/8 – 11 X 6 HHCS GR 8                                  |    |
| 2    | 2502-353  | ½ – 13 X 2.5 HHCS GR 8                                  |    |
| 3    | 2502-385  | 5/8-11 X 3.25 HHCS GR 5                                 |    |
| 4    | 2502-819  | ½ – 13 X 2.25 CARRIAGE BOLT GR 5                        |    |
| 5    | 2510-121  | 5/8 SHOULDER BOLT, 2 ¼ SHOULDER, ½ – 13 THREAD          | 6  |
| 6    | 2520-358  | 1/2 - 13 LOCK HEX NUT, GR 8                             | 18 |
| 7    | 2520-368  | 1/2 - 13 FLANGE WHIZ LOCK HEX NUT, GR 8                 | 42 |
| 8    | 2520-476  | 5/8-11 HEX FLANGE NUT GR 8                              | 28 |
| 9    | 2520-604  | 34-10 HEX TOP LOCK GR 8                                 | 6  |
| 10   | 2526-449  | 5/8 FLAT WASHER, 1/4 THICK                              |    |
| 11   | 2550-709  | 1/2 WIRE 2 1/2 OD X 1 1/2 ID X 7 1/4 COMPRESSION SPRING | 6  |
| 12   | 2570-126  | 34 X 10 EYEBOLT   |    |
| 13   | 2570-465  | HAIRPIN COTTER  |    |
| 14   | 2570-690  | U-BOLT ½-13 X 2.5 X 3.75                                |    |
| 15   | 2975-302  | SPRING BUSHING  |    |
| 16   | 5000-2010 | PIVOT ARM LEFT HAND U-BOLT MOUNT                        |    |
| 17   | 5000-2011 | PIVOT ARM RIGHT HAND U-BOLT MOUNT                       | 3  |
| 18   | 5000-202  | MOUNT BRACKET   | 6  |
|      | 2528-369  | 1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE              |    |
| 19   | 5000-203B | ROLLER 48"  | 1  |
| 20   | 5000-255  | ROLLER MOUNT 2 ROW                                      | 1  |
| 21   | 5000-272  | 3R30 ROLLER   | 2  |
| 22   | 5000-275A | 3R30 ROLLER MOUNT                                       | 2  |
| 23   | 5000-301  | MOUNT PLATE 90 SERIES                                   | 2  |
| 24   | 5000-309  | SUPPORT STRAP   | 12 |
| 25   | 5000-318  | PIVOT BUSHING   | 6  |
| 26   | 5000-319  | MOUNT STRAP 3"  | 12 |
| 27   | 5000-322  | SHIM WASHER   |    |
| 28   | 5000-323  | LOCK UP PIN   | 6  |
| 29   | 5000-355  | 1 ¼ DISC HARROW BEARING, W209PPB5, HD ASSEMBLY          | 6  |
|      | 2550-059  | DEVASTATOR BEARING ONLY (NO CAST HOUSING)               | 6  |

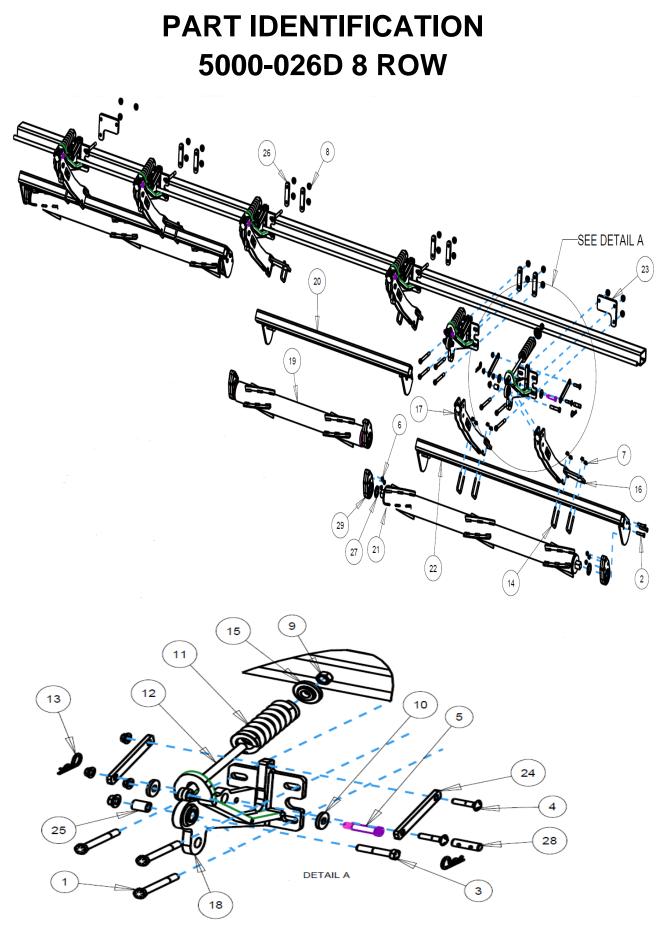

### PART IDENTIFICATION 5000-027D 12 ROW




| ITEM | PART #    | DESCRIPTION   |    |
|------|-----------|---|----|
| 1    | 2502-352  | 5/8 – 11 X 6 HHCS GR 8                                  | 30 |
| 2    | 2502-353  | ½ – 13 X 2.5 HHCS GR 8                                  |    |
| 3    | 2502-385  | 5/8-11 X 3.25 HHCS GR 5                                 |    |
| 4    | 2502-819  | 1⁄2 – 13 X 2.25 CARRIAGE BOLT GR 5                      |    |
| 5    | 2510-121  | 5/8 SHOULDER BOLT, 2 1/4 SHOULDER, 1/2 – 13 THREAD      |    |
| 6    | 2520-358  | 1⁄2 - 13 LOCK HEX NUT, GR 8                             | 24 |
| 7    | 2520-368  | 1/2 - 13 FLANGE WHIZ LOCK HEX NUT, GR 8                 | 56 |
| 8    | 2520-476  | 5/8-11 HEX FLANGE NUT GR 8                              | 38 |
| 9    | 2520-604  | 34-10 HEX TOP LOCK GR 8                                 | 8  |
| 10   | 2526-449  | 5/8 FLAT WASHER, ¼ THICK                                |    |
| 11   | 2550-709  | 1/2 WIRE 2 1/2 OD X 1 1/2 ID X 7 1/2 COMPRESSION SPRING |    |
| 12   | 2570-126  | 34 X 10 EYEBOLT   |    |
| 13   | 2570-465  | HAIRPIN COTTER  |    |
| 14   | 2570-690  | U-BOLT 1/2-13 X 2.5 X 3.75                              |    |
| 15   | 2975-302  | SPRING BUSHING  | 8  |
| 16   | 5000-2010 | PIVOT ARM LEFT HAND U-BOLT MOUNT                        |    |
| 17   | 5000-2011 | PIVOT ARM RIGHT HAND U-BOLT MOUNT                       | 4  |
| 18   | 5000-202  | MOUNT BRACKET   | 8  |
|      | 2528-369  | 1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE 8            |    |
| 19   | 5000-272  | 3R30 ROLLER   | 4  |
| 20   | 5000-275A | 3R30 ROLLER MOUNT                                       | 4  |
| 21   | 5000-301  | MOUNT PLATE 90 SERIES                                   | 2  |
| 22   | 5000-309  | SUPPORT STRAP   | 16 |
| 23   | 5000-318  | PIVOT BUSHING 8   |    |
| 24   | 5000-319  | MOUNT STRAP 3"  | 12 |
| 25   | 5000-322  | SHIM WASHER   |    |
| 26   | 5000-323  | LOCK UP PIN   | 8  |
| 27   | 5000-355  | 1 ¼ DISC HARROW BEARING, W209PPB5, HD ASSEMBLY          | 8  |
|      | 2550-059  | DEVASTATOR BEARING ONLY (NO CAST HOUSING)               | 8  |

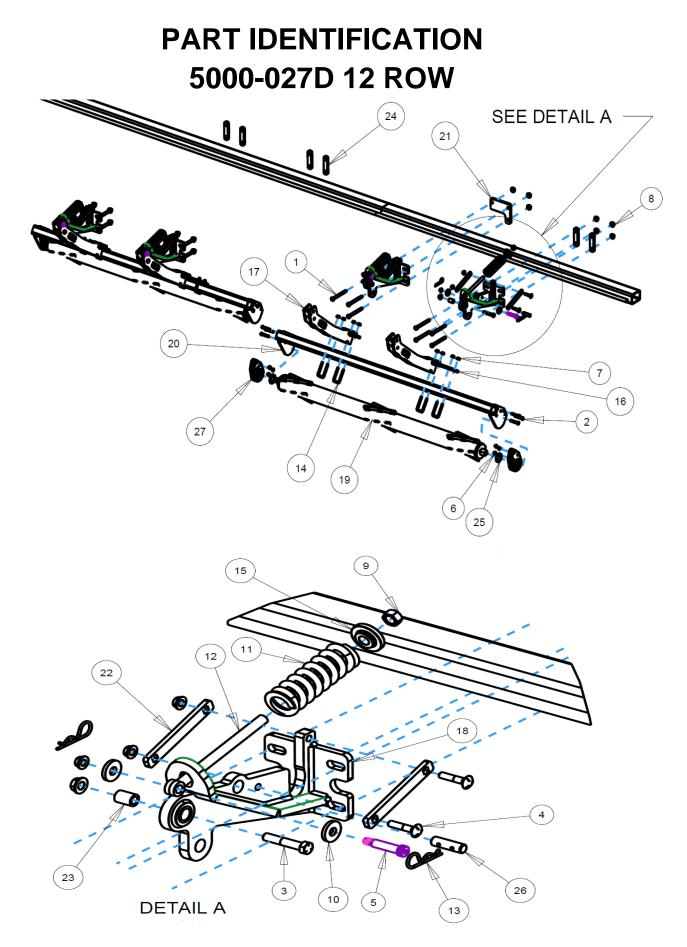

## PART IDENTIFICATION 5000-028D 16 ROW

| ITEM PART # |           | DESCRIPTION   |                |  |
|-------------|-----------|---|----------------|--|
| 1           | 2502-352  | 5/8 – 11 X 6 HHCS GR 8                                  |                |  |
| 2           | 2502-353  | ½ – 13 X 2.5 HHCS GR 8                                  |                |  |
| 3           | 2502-385  | 5/8-11 X 3.25 HHCS GR 5                                 | 12             |  |
| 4           | 2502-819  | ½ – 13 X 2.25 CARRIAGE BOLT GR 5                        | 24             |  |
| 5           | 2510-121  | 5/8 SHOULDER BOLT, 2 ¼ SHOULDER, ½ – 13 THREAD          |                |  |
| 6           | 2520-358  | 1/2 - 13 LOCK HEX NUT, GR 8                             | 36             |  |
| 7           | 2520-368  | 1/2 - 13 FLANGE WHIZ LOCK HEX NUT, GR 8                 | 84             |  |
| 8           | 2520-476  | 5/8-11 HEX FLANGE NUT GR 8                              | 30             |  |
| 9           | 2520-604  | 34-10 HEX TOP LOCK GR 8                                 | 12             |  |
| 10          | 2526-449  | 5/8 FLAT WASHER, ¼ THICK                                | 24             |  |
| 11          | 2550-709  | 1/2 WIRE 2 1/2 OD X 1 1/2 ID X 7 1/4 COMPRESSION SPRING |                |  |
| 12          | 2570-126  | 34 X 10 EYEBOLT   |                |  |
| 13          | 2570-465  | HAIRPIN COTTER  |                |  |
| 14          | 2570-690  | U-BOLT ½-13 X 2.5 X 3.75                                |                |  |
| 15          | 2975-302  | SPRING BUSHING  | 12             |  |
| 16          | 5000-2010 | PIVOT ARM LEFT HAND U-BOLT MOUNT                        | 6              |  |
| 17          | 5000-2011 | PIVOT ARM RIGHT HAND U-BOLT MOUNT                       |                |  |
| 18          | 5000-202  | MOUNT BRACKET   |                |  |
|             | 2528-369  |   |                |  |
| 19          | 5000-203B | ROLLER 48"  | 2              |  |
| 20          | 5000-255  | ROLLER MOUNT 2 ROW                                      | 2              |  |
| 21          | 5000-272  | 3R30 ROLLER   | 4              |  |
| 22          | 5000-275A | 3R30 ROLLER MOUNT                                       |                |  |
| 23          | 5000-309  | SUPPORT STRAP   |                |  |
| 24          | 5000-318  | PIVOT BUSHING   |                |  |
| 25          | 5000-319  | MOUNT STRAP 3"  |                |  |
| 26          | 5000-322  | SHIM WASHER   |                |  |
| 27          | 5000-323  | LOCK UP PIN   | LOCK UP PIN 12 |  |
| 28          |           |   | 12             |  |
|             | 2550-059  | DEVASTATOR BEARING ONLY (NO CAST HOUSING)               | 12             |  |

1

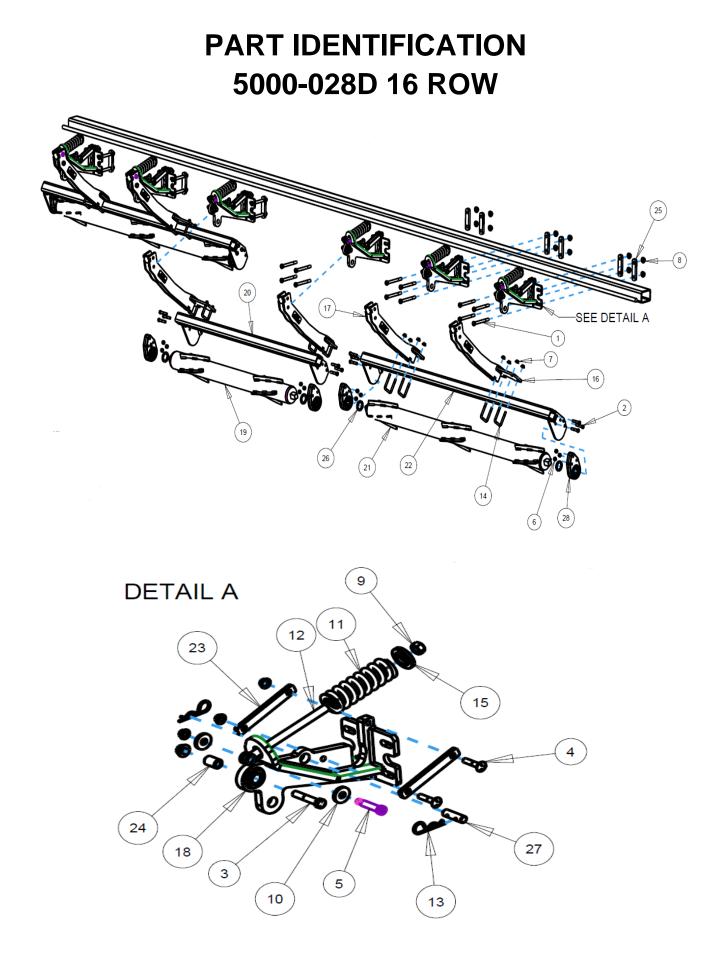



# PART IDENTIFICATION 5000-034C 12 ROW FOLDING




| ITEM | PART #    | DESCRIPTION   | QTY |
|------|-----------|---|-----|
| 1    | 2502-352  | 5/8 – 11 X 6 HHCS GR 8                                  |     |
| 2    | 2502-353  | 1/2 – 13 X 2.5 HHCS GR 8                                |     |
| 3    | 2502-385  | 5/8-11 X 3.25 HHCS GR 5                                 |     |
| 4    | 2502-819  | 1/2 – 13 X 2.25 CARRIAGE BOLT GR 5                      |     |
| 5    | 2505-414  | 5/8-11 X 6 CARRIAGE BOLT GR 5                           |     |
| 6    | 2510-121  | 5/8 SHOULDER BOLT, 2 ¼ SHOULDER, ½ – 13 THREAD          | 4 8 |
| 7    | 2520-358  | 1/2 - 13 LOCK HEX NUT, GR 8                             | 24  |
| 8    | 2520-368  | 1/2 - 13 FLANGE WHIZ LOCK HEX NUT, GR 8                 | 56  |
| 9    | 2520-476  | 5/8-11 HEX FLANGE NUT GR 8                              | 40  |
| 10   | 2520-604  | 34-10 HEX TOP LOCK GR 8                                 | 8   |
| 11   | 2526-449  | 5/8 FLAT WASHER, ½ THICK                                | 16  |
| 12   | 2550-709  | 1/2 WIRE 2 1/2 OD X 1 1/2 ID X 7 1/4 COMPRESSION SPRING | 8   |
| 13   | 2570-126  | ¾ X 10 EYEBOLT  |     |
| 14   | 2570-465  | HAIRPIN COTTER  |     |
| 15   | 2570-690  | U-BOLT 1/2-13 X 2.5 X 3.75                              |     |
| 16   | 2975-302  | SPRING BUSHING  | 8   |
| 17   | 5000-2010 | PIVOT ARM LEFT HAND U-BOLT MOUNT                        |     |
| 18   | 5000-2011 | PIVOT ARM RIGHT HAND U-BOLT MOUNT                       |     |
| 19   | 5000-202  | MOUNT BRACKET   | 4   |
|      | 2528-369  | 1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE              | 8   |
| 20   | 5000-263  | MOUNT BRACKET FOLDING                                   | 4   |
|      | 2528-369  | 1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE              | 4   |
| 21   | 5000-272  | 3R30 ROLLER   | 4   |
| 22   | 5000-275A | 3R30 ROLLER MOUNT                                       | 4   |
| 23   | 5000-309  | SUPPORT STRAP   | 16  |
| 24   | 5000-318  | PIVOT BUSHING 8   |     |
| 25   | 5000-319  | MOUNT STRAP 3" 16                                       |     |
| 26   | 5000-322  | SHIM WASHER 8   |     |
| 27   | 5000-323  | LOCK UP PIN   |     |
| 28   | 5000-355  | 1 ¼ DISC HARROW BEARING, W209PPB5, HD ASSEMBLY          | 8   |
|      | 2550-059  |   |     |
| 29   | 5000-402  | WEDGE   | 4   |

# PART IDENTIFICATION 5000-034C 12 ROW FOLDING

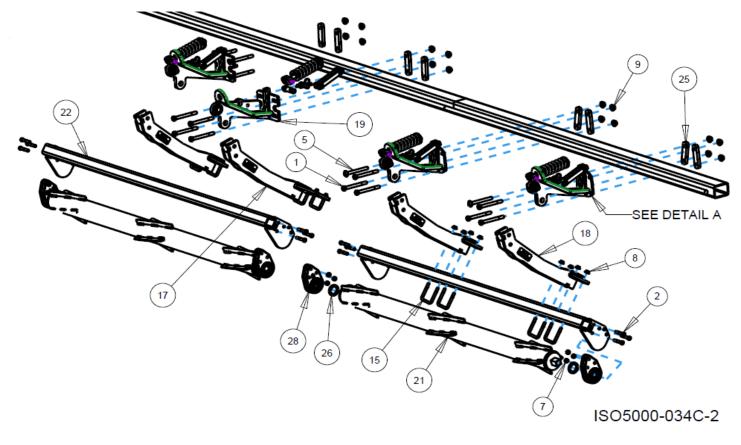

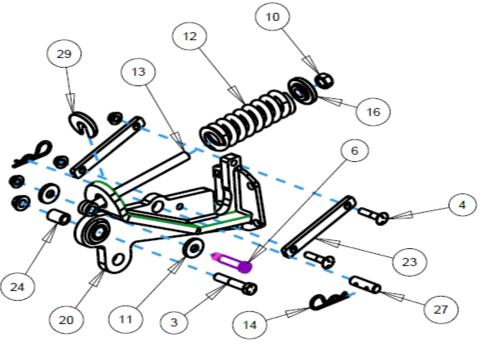

DETAIL A

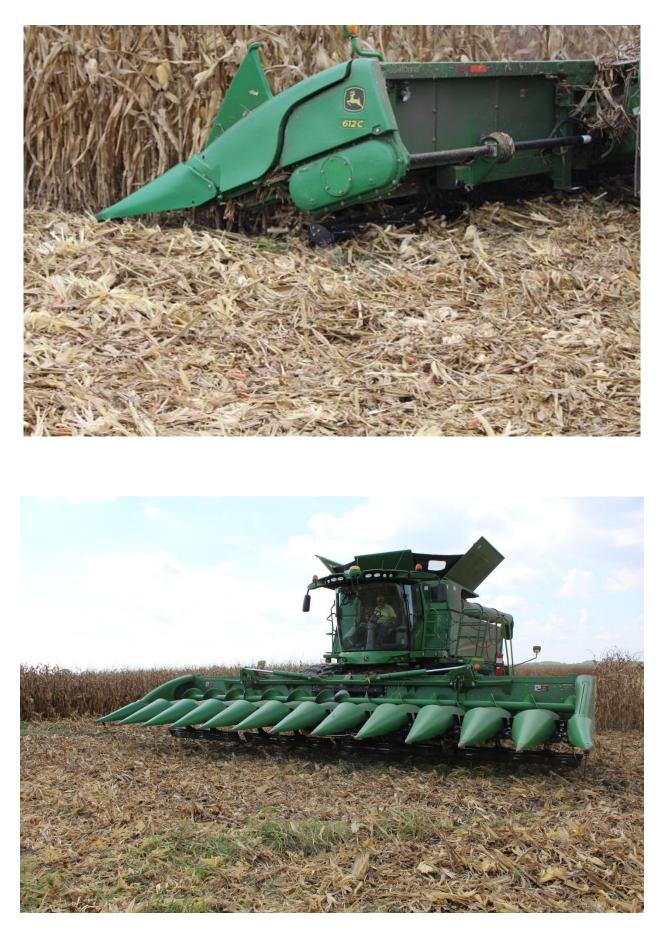

# **TROUBLESHOOTING**

| ISSUE            | CAUSE                           | CORRECTIVE ACTION  |
|------------------|---------------------------------|--|
| Residue Plugging | 1. Incorrect Head Angle         | <ol> <li>Adjust head angle to 23 – 25 degrees (see page 37)</li> </ol> |
|                  | 2. Roller Mount Tube            | 2. Make sure the Bearing Support Tab is on the backside                |
|                  | incorrectly installed           | of the Roller Arm Mount Tube   |
|                  | 3. Pivot arm orientation        | 3. Reposition the pivot arm so that it offsets under the               |
|                  | incorrect                       | snout & not under the row  |
|                  | 4. Bearing installed            | 4. Make sure the side of the bearing that protrudes                    |
|                  | incorrectly                     | outside of the cast housing is facing toward the roller                |
|                  | ,                               | (each roller should spin freely by hand)                               |
|                  | 5. Intermeshing snapping        | 5. Order the 5000-080 Set Back Kit (order 2 per roller)                |
|                  | rolls                           |  |
|                  | 6. Too much Spring Tension      | 6. Back the nut off of the push rod until the nut is flush             |
| Stalk aren't     | 1. Insufficient spring down     | 1. Tighten push rod nut on spring bushing more                         |
| "devastated"     | pressure                        |  |
|                  | 2. Operating corn head too      | 2. Lower corn head until the rollers engage                            |
|                  | high                            |  |
| Corn Head won't  | 1. Devastators bottom out       | 1. Adjust top rail & saddles higher on cart                            |
| fit on head cart | 2. Roller won't clear cart tire | 2. Order 5000-082 Lift Kit (raises roller 2")                          |
|                  | 3. Storage stands don't rest    | 3. Order 5000-081 Head Extensions (JD 600 & 700 series                 |
|                  | in the saddles on the cart      | only)  |



#### A Tradition of Solutions since 1930

Yetter Farm Equipment Co

PO BOX 358 109 S. McDonough

Colchester, IL 62326-0358

Phone: 309-776-4111

Toll Free: 800-447-5777

Email: info@yetterco.com

For updated models and manuals visit the Yetter website:

#### www.yetterco.com

© Yetter Farm Equipment Co. All Rights Reserved

2565-785\_Rev\_H - 3/2023