



5000 SERIES STALK DEVASTATOR CORN STALK ROLLER

PATENTED

**5000-025C, 5000-026C, 5000-027C, 5000-028C, 5000-034B
John Deere Model Corn Heads (606C, 643, 693, 706C, C6R, 608C,
843, 893, 708C, C8R, 612C, 612FC Folding, 712C, 1243, 1293,
C12F, C12R, 616C, 716C, C16F, & C16R)**

**OWNER'S MANUAL
PART IDENTIFICATION
2565-785_Rev_F – 6/2021**



YETTER MANUFACTURING CO.

Founded 1930

Colchester, IL 62326

Toll free: (800)447-5777.

Fax: (309)776-3222

Website: yetterco.com

E-mail: info@yetterco.com

YETTER

Table of Contents

Foreword	3
Warranty	3
Safety Information	4 - 6
Pictorial Part List	7 - 9
Bolt Torque & Tools Required	10
Assembly Instructions	11 - 36
5000-025C	11 - 15
5000-026C	16 - 20
5000-027C	21 - 25
5000-028C	26 - 31
5000-034B	32 - 36
Operation / Maintenance / Lock Up	37
Part Identification	38 - 47
Troubleshooting	50



FOREWORD

You've just joined an exclusive but rapidly growing club.

For our part, we want to welcome you to the group and thank you for buying a Yetter product.

We hope your new Yetter products will help you achieve both goals-increase your productivity and increase your efficiency so that you may generate more profit.

This operator's manual has been designed into four major sections: Foreword, Safety Precautions, Installation Instructions and Parts Breakdown.



This **SAFETY ALERT SYMBOL** indicates important safety messages in the manual. When you see this symbol, be alert to the possibility of **PERSONAL INJURY** and carefully read the message that follows.

The word **NOTE** is used to convey information that is out of context with the manual text. It contains special information such as specifications, techniques and reference information of a supplementary nature.

The word **IMPORTANT** is used in the text when immediate damage will occur to the machine due to improper technique or operation.

Important will apply to the same information as specified by note only of an immediate and urgent nature.

It is the responsibility of the user to read the operator's manual and comply with the safe and correct operating procedure and to lubricate and maintain the product according to the maintenance schedule in the operator's manual.

The user is responsible for inspecting his machine and for having parts repaired or replaced when continued use of the product would cause damage or excessive wear to the other parts.

It is the user's responsibility to deliver his machine to the Yetter dealer who sold him the product for service or replacement of defective parts, which are covered by the warranty policy.

If you are unable to understand or follow the instructions provided in this publication, consult your local Yetter dealer or contact:

YETTER MANUFACTURING CO.

309/776-4111

800/447-5777

309/776-3222 (FAX)

Website: www.yetterco.com

E-mail: info@yetterco.com

WARRANTY

Yetter Manufacturing warrants all products manufactured and sold by it against defects in material. This warranty being expressly limited to replacement at the factory of such parts or products as shall appear to be defective after inspection. This warranty does not obligate the Company to bear cost of labor in replacement of parts. It is the policy of the Company to make improvements without incurring obligations to add them to any unit already sold. No warranty is made or authorized to be made, other than herein set forth. This warranty is in effect for one year after purchase.

DEALER: _____

Yetter Manufacturing warrants its own products only and cannot be responsible for damages to equipment on which mounted.

BE ALERT!

YOUR SAFETY IS INVOLVED



WATCH FOR THIS SYMBOL. IT POINTS OUT IMPORTANT SAFETY PRECAUTIONS. IT MEANS “ATTENTION – BE ALERT!”

It is your responsibility as an owner, operator, or supervision to know and instruct everyone using this machine at the time of initial assignment and at least annually thereafter, of the proper operation, precautions, and work hazards which exist in the operation of the machine in accordance with OSHA regulations.

Safety Is No Accident

The following safety instructions, combined with common sense, will save your equipment from needless damage and the operator from unnecessary exposure to personal hazard. Pay special attention to the caution notes in the text. Review this manual at least once a year with all operators.



1. Read and understand the operator's manual before operating this machine. Failure to do so is considered a misuse of the equipment.
2. Make sure equipment is secure before operating.
3. Always keep children away from equipment when operating.
4. Make sure everyone that is not directly involved with the operation is out of the work area before beginning operation.
5. Make sure all safety devices, shields, and guards are in place and functional before beginning operation
6. Shut off all power to adjust, service, or clean.
7. Keep hands, feet, and clothing away from moving parts. It is a good idea to remove all jewelry before operating.
8. Inspect the machine periodically during operation for signs of excessive wear, loose fasteners, and unusual noises.

PLEASE READ, VERY IMPORTANT



SECURE CORN HEADER AGAINST UNWANTED LOWERING BY APPLYING THE LOCKING MECHANISM ON THE HYDRAULIC CYLINDERS!



1. Attach head to combine, lock head to combine
2. Raise the head off the ground and engage safety stop on the feeder house cylinder.
3. Apply combine parking brake, turn off combine engine, and remove the key
4. Wear personal protective equipment during installation: steel toe footwear, safety glasses, & gloves

FOLLOW ALL INSTRUCTIONS GIVEN BY THE COMBINE MANUFACTURER

PLEASE READ, VERY IMPORTANT



Subject to the size and weight of the corn header, one or two additional hydraulic cylinders may be required.

The combine manufacturer generally keeps corresponding kits readily available for dealers.

Subject to the design of the corn header and the carrying capacity of different combines, the steering axle may require the fitting of additional weights and the rear tires be filled with ballast.

**FOLLOW ALL INSTRUCTIONS GIVEN BY THE COMBINE
MANUFACTURER**

PICTORIAL PART LIST



BEFORE INSTALLATION BEGINS, PLEASE CHECK THAT ALL PARTS WERE RECEIVED BY GOING THROUGH THE CRATE AND SORTING THE PARTS!!!

5000-025C – JD 606C, 643, 693, 706C, C6R & Wheel tracks only for 612C, 712, 1243, 1293, C12F/R, 616C, 716 & C16F/R Part List 4) 5000-136, 4) 5000-138, 4) 5000-139, 1) 5000-165, 4) 5000-202, 2) 5000-256, 2) 5000-259, 2) 5000-272, 2) 5000-275A, 4) 5000-355

5000-026C – JD 608C, 708C, 843, 893, & C8R Part List – 6) 5000-136, 6) 5000-138, 6) 5000-139, 1) 5000-165, 6) 5000-202, 1) 5000-203B, 1) 5000-255, 3) 5000-256, 3) 5000-259, 2) 5000-272, 2) 5000-275A, 2) 5000-301, 6) 5000-355

5000-027C – JD 612C, 712C, 1243, 1293, & C12R Part List – 8) 5000-136, 8) 5000-138, 8) 5000-139, 1) 5000-165, 8) 5000-202, 4) 5000-256, 4) 5000-259, 4) 5000-272, 4) 5000-275A, 2) 5000-301, 8) 5000-355

5000-028C – JD 616C, 716C, C16R, & C16F Part List – 12) 5000-136, 12) 5000-138, 12) 5000-139, 1) 5000-165, 12) 5000-202, 2) 5000-203B, 2) 5000-255, 6) 5000-256, 6) 5000-259, 4) 5000-272, 4) 5000-275A, 12) 5000-355

5000-034B – JD 612FC, 712FC, & C12F Folding Part List – 8) 5000-136, 8) 5000-138, 8) 5000-139, 1) 5000-141, 1) 5000-165, 4) 5000-202, 6) 5000-256, 2) 5000-259, 4) 5000-263, 4) 5000-272, 4) 5000-275A, 8) 5000-355

5000-080 – 5" Extension Kit Parts List (Optional) – 2) 2502-363 – ½" X 4 ½" GR 5 Bolts, 2) 2502-365 – ½"-13 X 3 ¾" GR 5 Bolts, 6) 2520-357 – ½" Lock Nuts, 2) 5000-378 Spacer Bushings, 2) 5000-393 5" Extension Plates, & 2) 5000-394 Short Spacers

5000-082 – 2" Lift Kit Parts List (Optional) – 2) 5000-408 Extender Plate, 1) 5000-409 Connector Pin

5000-083 – 6 Row Devastator Lock Up Kit (Optional) – 1) 5000-161 Hardware Bag, 1) 5000-430 Lock Pin

5000-084 – 8/12 Row Devastator Lock Up Kit (Optional) – 1) 5000-162 Hardware Bag, 2) 5000-430 Lock Pin


PICTORIAL PART LIST

5000-136 Hardware Bag



← 2502-325 - 5/8-11 X 3 HHCS GR 5 ZP – QTY 1

2502-353 – ½-13 x 2 ½, HHCS, GR8, ZP – QTY 3 →




← 2510-121 - 5/8 DIA. SHLDR, 2-1/4 L SHLDR, ½-13 QTY 1

2520-357 - 1/2-13 LOCK HEX NUT, GR A, ZP – QTY 3 →



← 2520-364 - 1/2-13 HEX LOCKNUT, JAM, GR 2 – QTY 1

2520-459 - 5/8-11 LOCK HEX NUT, GR 5, ZP – QTY 1 →

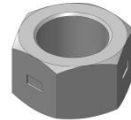

← 2520-515 - 3/4-10 LOCK HEX NUT, GR A, ZP – QTY 1

2526-449 - 5/8FLATWASHER1/4+- .010 THK, ZP – QTY 2 →




← 2550-709 - 1/2 WIRE 2-1/2 OD X 1-1/2 ID X 7-1/4 COMP SPRING – QTY 1

2570-126 - 3/4 X 10 EYEBOLT, ZP – QTY 1 →



← 2975-302 - 2975 SPRING BUSHING, PAINTED – QTY 1


5000-318 - PIVOT BUSHING – QTY 1 →



← 5000-322 - SHIM WASHER ZP – QTY 1

PICTORIAL PART LIST

5000-138 Hardware Bag



← 2502-365 - 1/2-13 X 3-3/4 HHCS GR5 YD – QTY 2

2520-357 - 1/2-13 LOCK HEX NUT, GR A, ZP – QTY 2 →




← 5000-378 - SPACER BUSHING – QTY 2

5000-139 Hardware Bag



← 2502-352 - 5/8-11 X 6 HHCS GRADE 8 ZP – QTY 4

2505-345 - 1/2-13 X 2 CAR BLT GR5 ZP – QTY 2 →



← 2520-361 - 1/2-13 FLANGE WHZLCK HXNT, GR 5, ZP - QTY 2

2520-459 - 5/8-11 LOCK HEX NUT, GR A, ZP – QTY 4 →




← 2570-465 - 7 GA. HAIRPIN COTTER ZP – QTY 2

5000-309 - SUPPORT STRAP – QTY 2 →



← 5000-319 - MOUNT STRAP 3" – QTY 2

5000-323 - LOCK UP PIN ZP – QTY 1 →

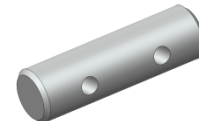

5000-141 Hardware Bag



← 2505-414 – 5/8 – 11 X 6 CARRIAGE BOLT, GR 5 ZP – QTY 2

5000-402 – WEDGE – QTY 2 →



BOLT TORQUE



Important: Over-tightening hardware can cause just as much damage as under-tightening. Tightening hardware beyond the recommended range can reduce its shock load capacity.





All hardware on the 5000 Devastator is either Grade 5 or Grade 8, unless otherwise noted. Grade 5 cap screws are marked with three radial lines on the head. Grade 8 cap screws are marked with six radial lines on the head. If hardware must be replaced, be sure to replace it with hardware of equal size, strength and thread type. Refer to the torque values chart when tightening hardware.

The chart below is a guide for proper torque. Use it unless a specified torque is called out elsewhere in the manual.

Torque is the force applied to the end of the handle or cheater bar, times the length of the handle or bar.

Use a torque wrench wherever possible

The following table shows torque in ft.-lbs. for coarse thread hardware.

Bolt Diameter and Threads per Inch	 Grade 2	 Grade 5	 A-325	 Grade 8
1/4	6	10		14
5/16	12	20		30
3/8 – 16	25	35		50
7/16 – 14	35	55		80
1/2 – 13	55	85		125
9/16 – 12	75	125		175
5/8 – 11	105	170		235
3/4-10	185	305		425
7/8 – 9	170	445		690
1-8	260	670		1030
1 1/8 – 7	365	900		1460
1 1/4 - 7	515	1275		2060
1 3/8 – 6	675	1675		2700
1 1/2 - 6	900	2150		3500
1 3/4 – 5	1410	3500		5600

INSTALLATION TOOLS REQUIRED:

- Pneumatic or electric impact driver
- 3/4 & 15/16 size sockets
- 10" impact driver extension
- Ratchet
- 3/4, 15/16, & 1 1/8 size wrenches
- 5/16 Allen Wrench
- Torque Wrench




5000-025C ASSEMBLY INSTRUCTIONS

(606C, 643, 693, 706C, C6R or Wheel Track only on 12 & 16 row JD corn heads)




Step 1: Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, and 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 4 & 5, and 5 & 6. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. . If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed.

Note: Do not fully tighten hardware until **Step 6** after all of the pivot arms & springs are installed.

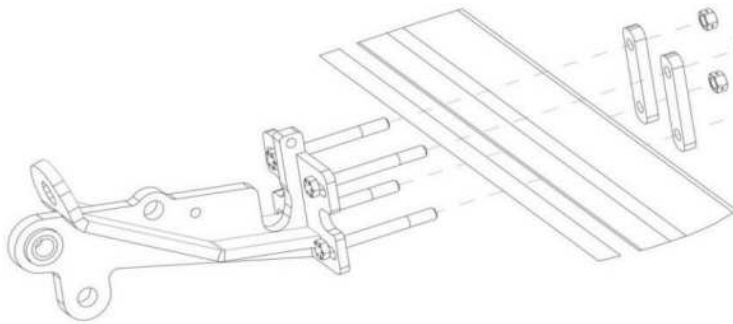


6 Row

Arrows indicate 5000-202 mount bracket locations, mounts will go on front side of frame, straps on back side of frame.

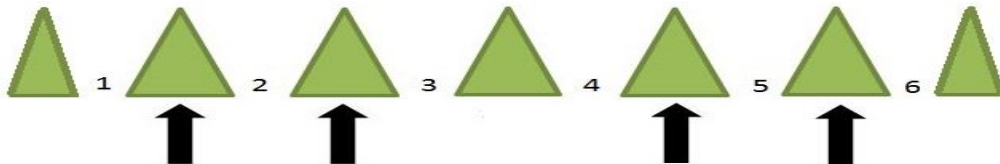


12 Row Wheel Tracks

Arrows indicate 5000-202 mount bracket locations (rows 3/4 & 4/5 and 8/9 & 9/10 could also be used)

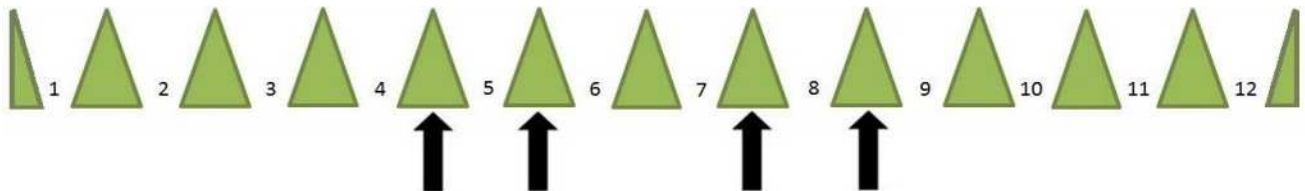


16 Row Wheel Tracks

Arrows indicate 5000-202 mount bracket locations (rows 5/6 & 6/7 and 9/10 & 10/11 could also be used)

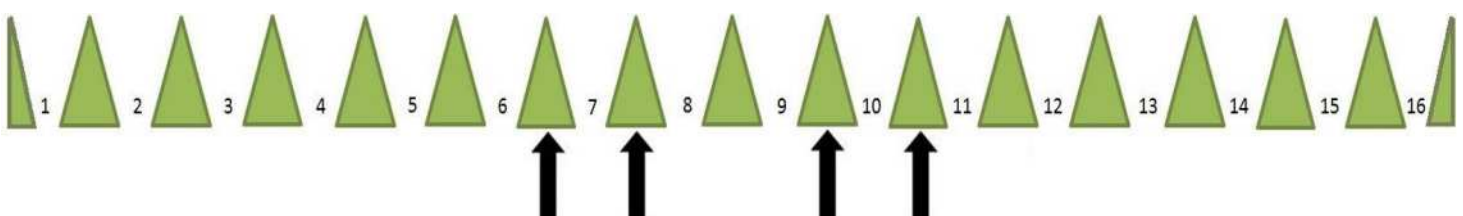


5000-025C ASSEMBLY INSTRUCTIONS

Step 2: Attach the 5000-309 support straps using 1/2" x 2 carriage bolts & 1/2" flange lock nuts, tighten.

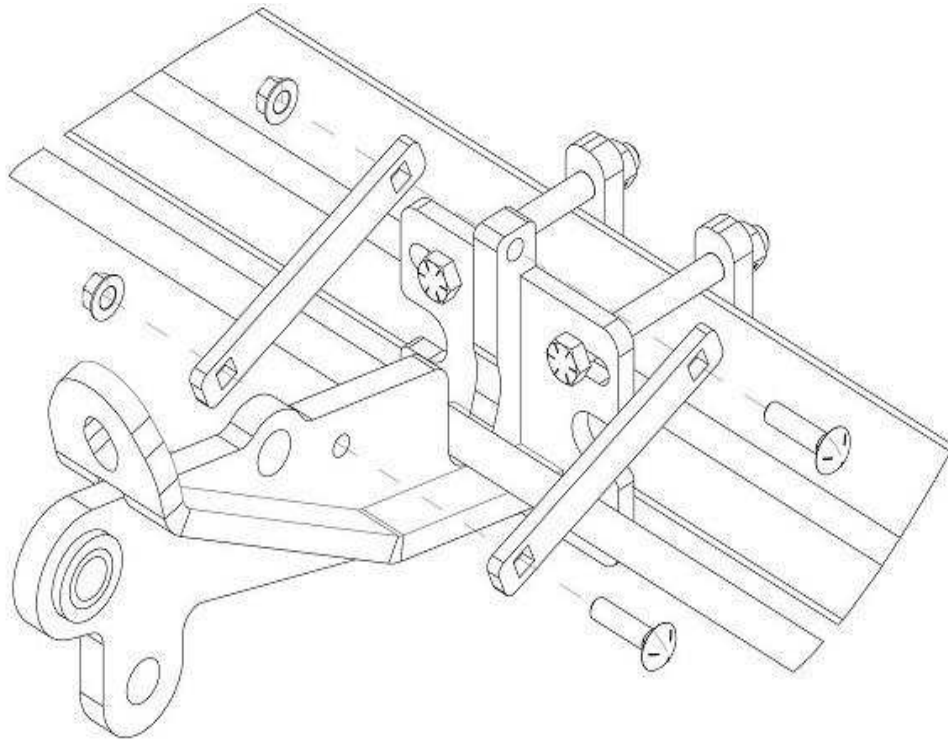


Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

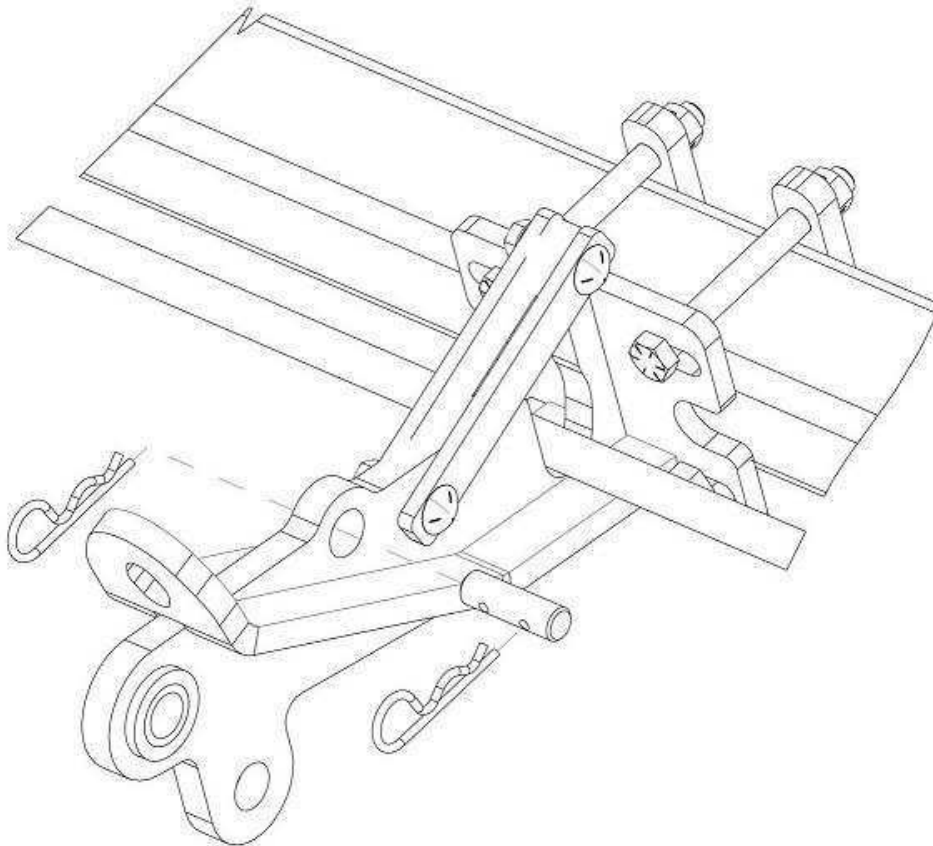

5000-025C ASSEMBLY INSTRUCTIONS


Step 4: Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

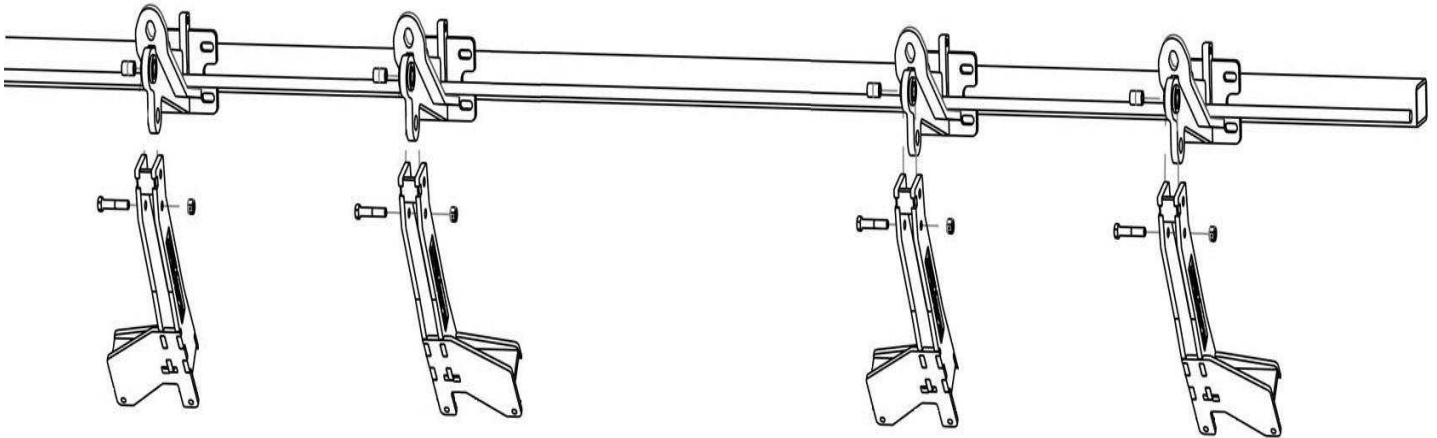

Step 5: Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and 1/2" jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and 3/4" lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

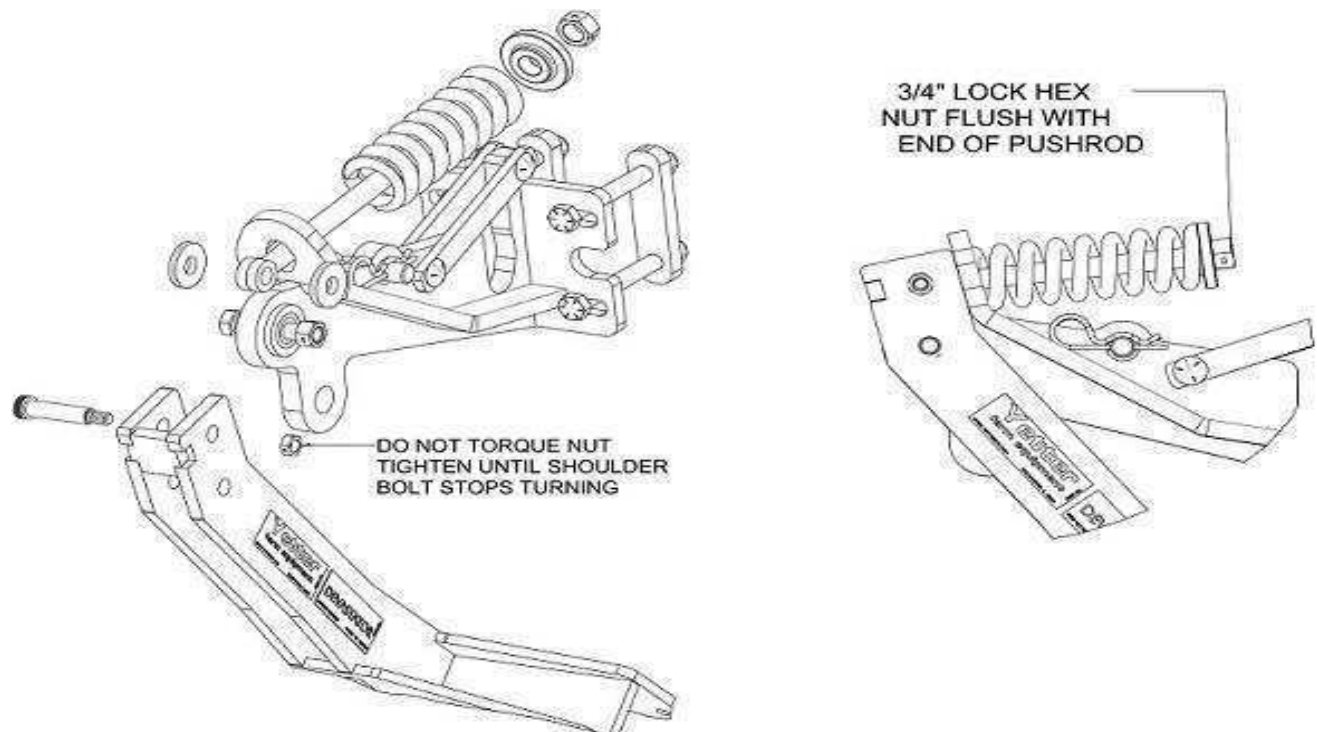


NOTE: Tightening the nut on the spring bushing more will result in added down pressure. However, DO NOT tighten the nut on the spring bushing down so far that spring compression limits pivot arm travel. This will cause the spring to break, especially if spring is compressed all off-season.


5000-025C ASSEMBLY INSTRUCTIONS

Step 6: Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp (5000-256 & 5000-259) should be under the center of the snout, not directly under the row.


Row 1 & 2

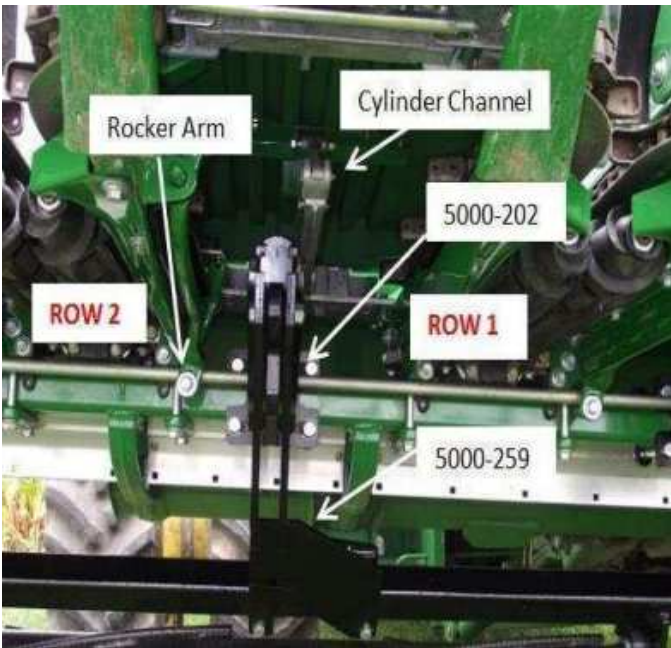


Row 2 & 3

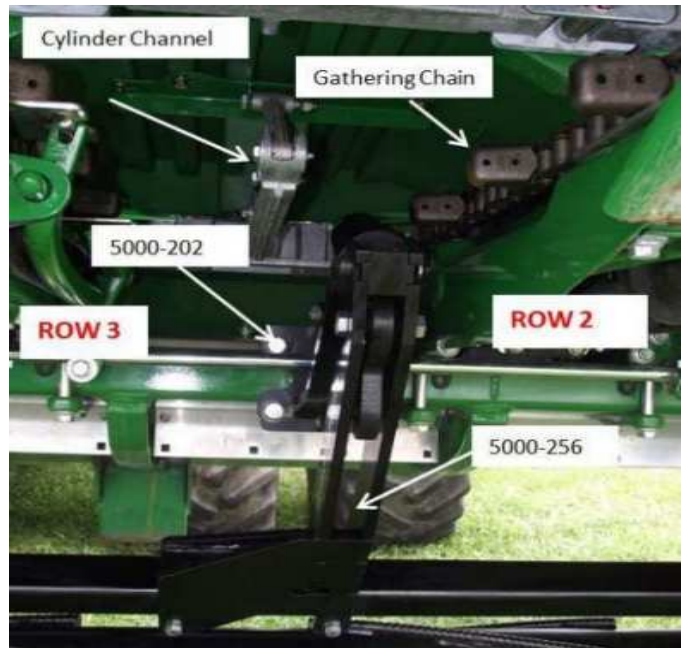

Row 4 & 5

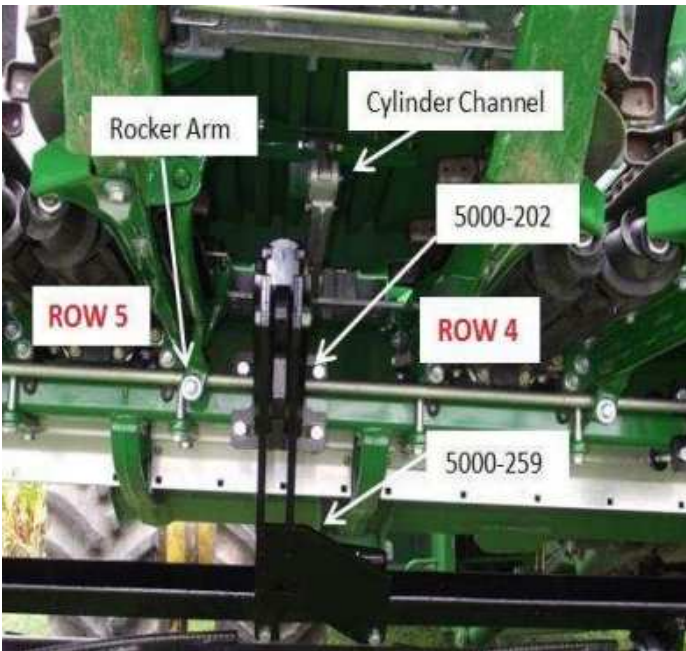

Row 5 & 6

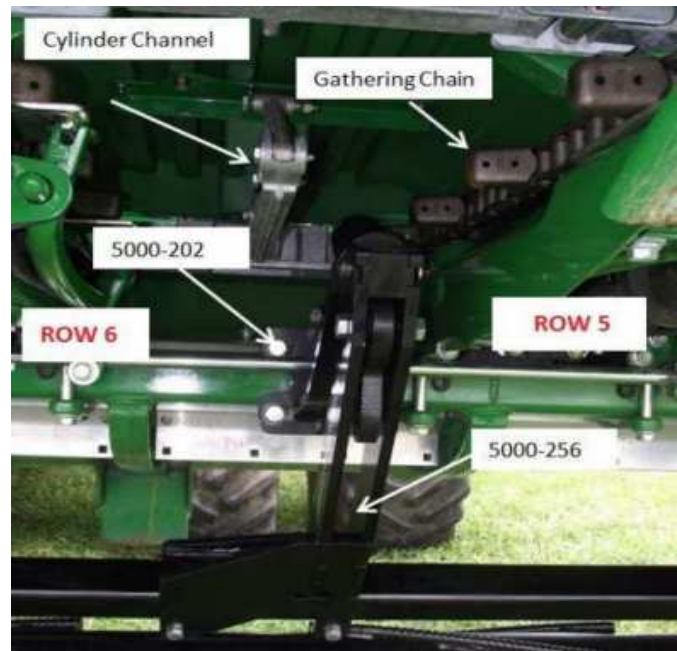


Note: On 12 row heads installing on wheel tracks only, the top pictures on this page will illustrate rows 4 & 5 and 5 & 6. The bottom pictures on this page will illustrate rows 7 & 8 and 8 & 9.

Note: On 16 row heads installing on wheel tracks only, the top pictures on this page will illustrate rows 6 & 7 and 7 & 8. The bottom pictures on this page will illustrate rows 9 & 10 and 10 & 11.



5000-025C ASSEMBLY INSTRUCTIONS

Step 7: Install the Roller Arm Mount Tube inside the clamp channel of the pivot arms using the 5000-138 bolt bag. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

NOTE: Install the Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.

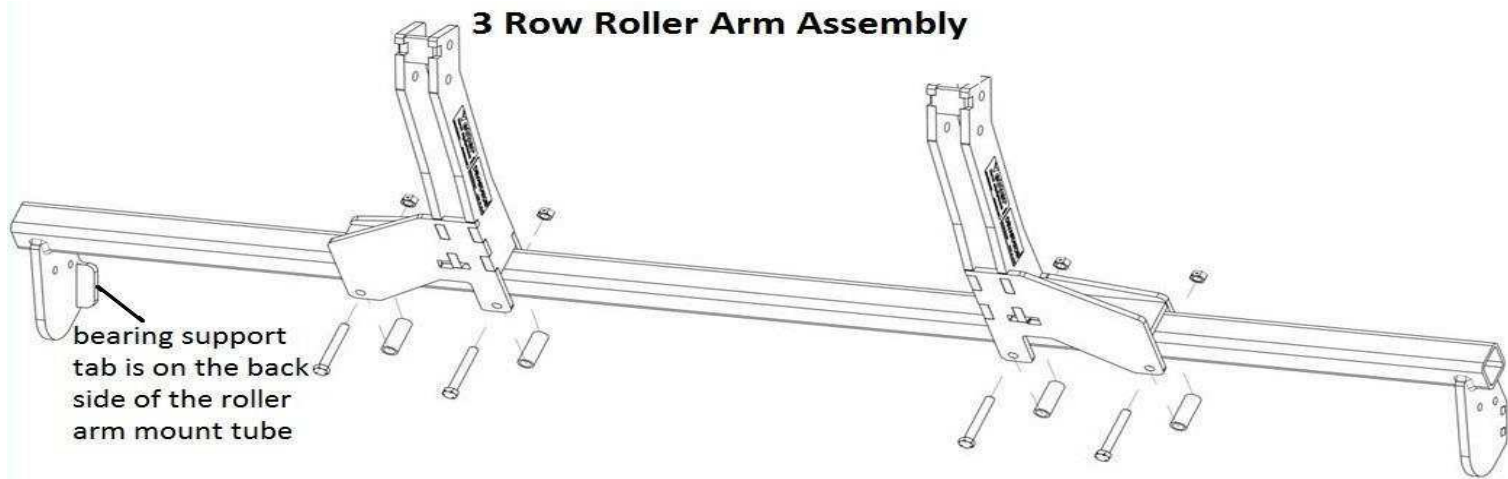

Step 8: Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the $\frac{1}{2}$ " X $2\frac{1}{2}$ " bolts & tighten the $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly centered under each row.

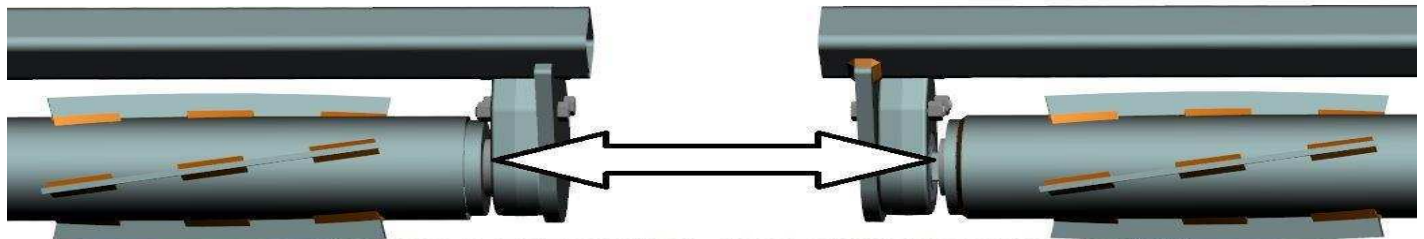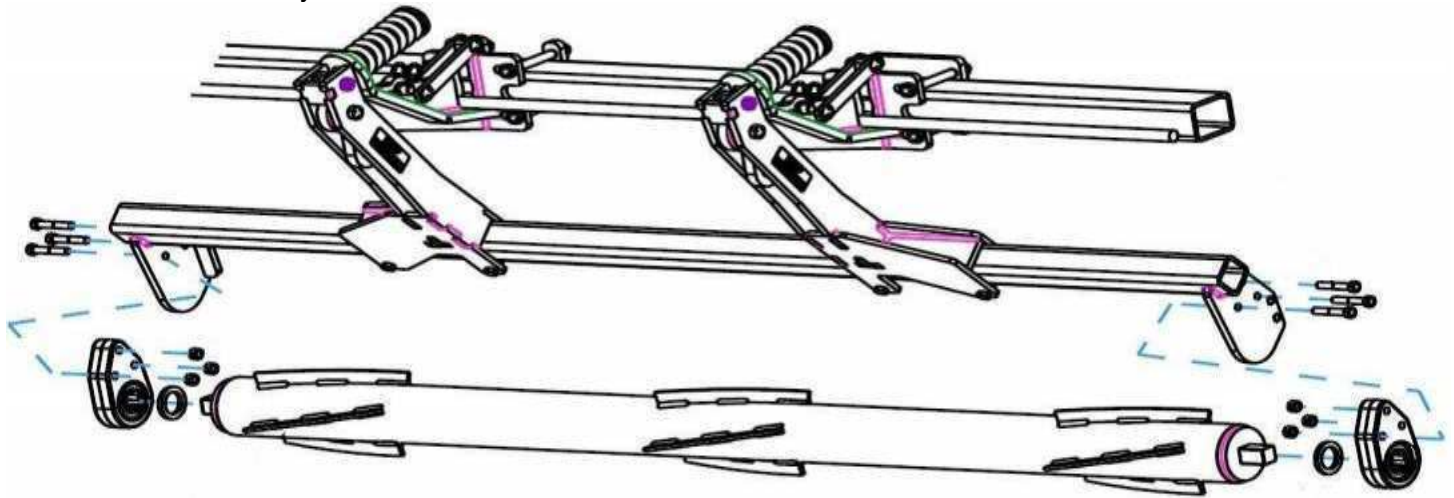

THE SIDE OF THE BEARING ASSEMBLY WHERE THE BEARING IS PROTRUDING MUST BE INSTALLED TOWARD THE ROLLER!


5000-026C ASSEMBLY INSTRUCTIONS

(JD 608C, 708C, 843, 893, & C8R)




Step 1: Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 3 & 4, 5 & 6, 6 & 7, and 7 & 8. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. On JD 893 corn heads, use the 5000-301 L Clamp Plate with the mounting brackets between rows 1 & 2 and 7 & 8. If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed.

Note: Do not fully tighten hardware until **Step 6** after all of the pivot arms & springs are installed.

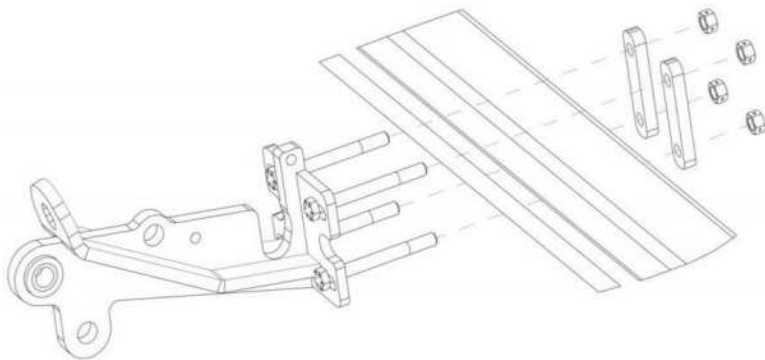


MOUNTING BRACKET ASSEMBLY INSTRUCTIONS (ROW 1-2 AND 7-8)
JD 893 (8 ROW) CORN HEAD (ONLY)

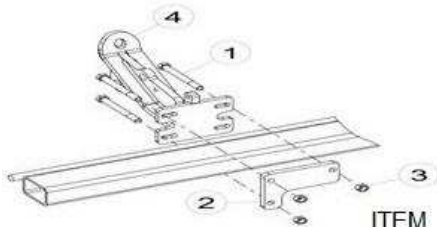


LEFT HAND
ROWS 1-2

ITEM	PART #	DESCRIPTION
1	2502-352	5/8 - 11 X 6 HHCS GR 8 ZP
2	5000-301	"L" MOUNT PLATE JD 90 SERIES
3	2520-459	5/8 - 11 HEX LOCK NUT ZP
4	5000-202	MOUNT BRACKET W.A., SINGLE

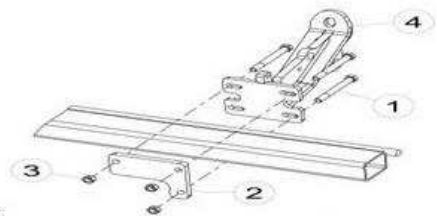


RIGHT HAND
ROWS 7-8

Arrows indicate 5000-202 mount bracket locations, mounts will go on front side of frame, straps on back side of frame.

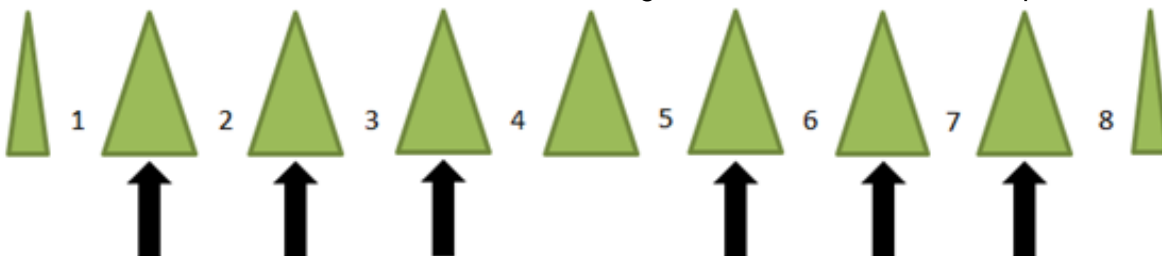


5000-026C ASSEMBLY INSTRUCTIONS

Step 2: Attach the 5000-309 support straps using $\frac{1}{2}$ " x 2" carriage bolts & $\frac{1}{2}$ " flange lock nuts, tighten.

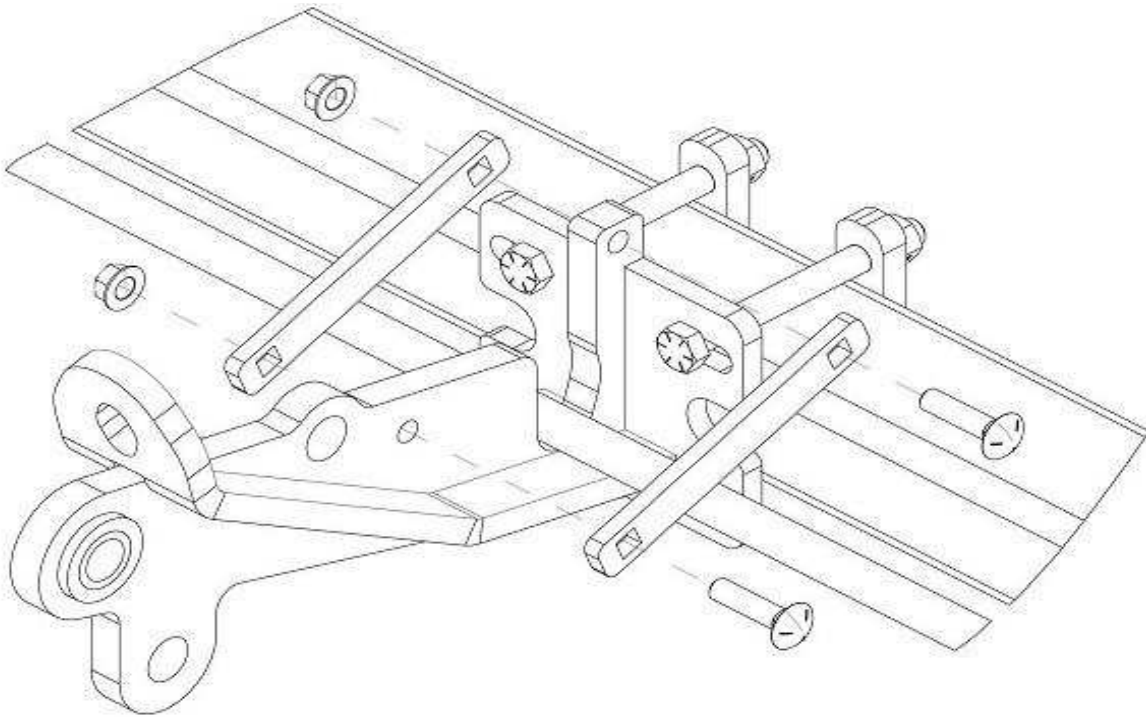


Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

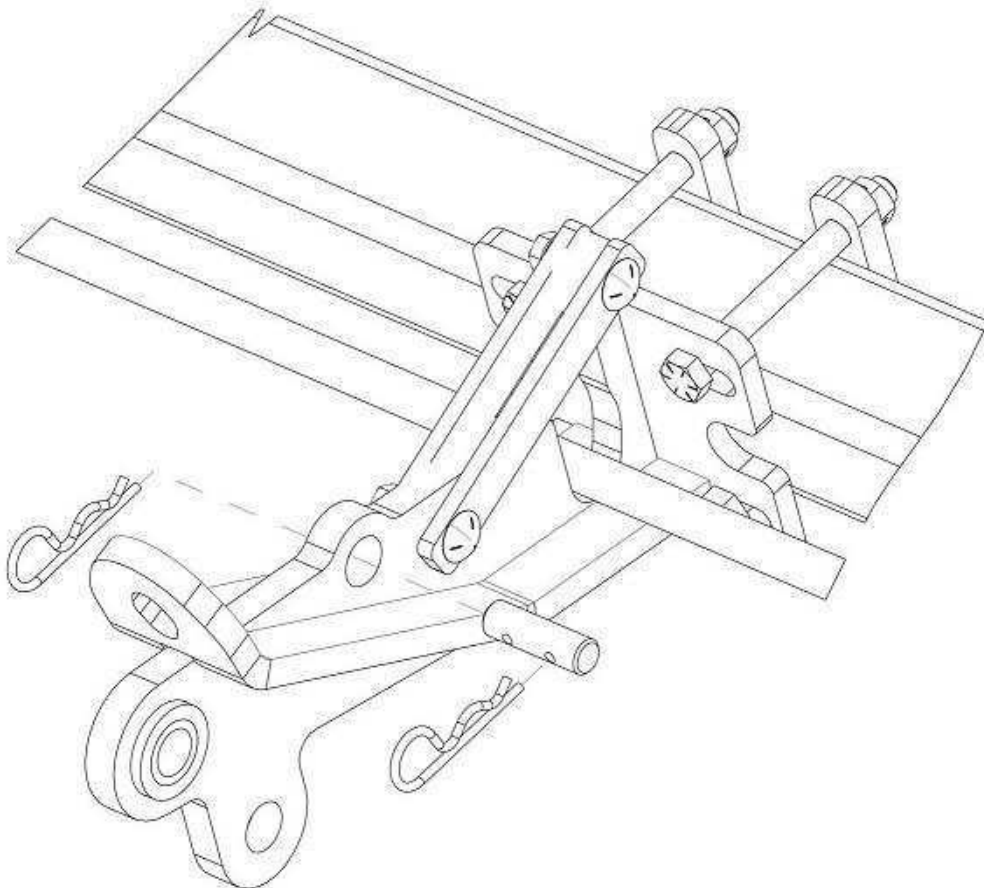

5000-026C ASSEMBLY INSTRUCTIONS


Step 4: Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

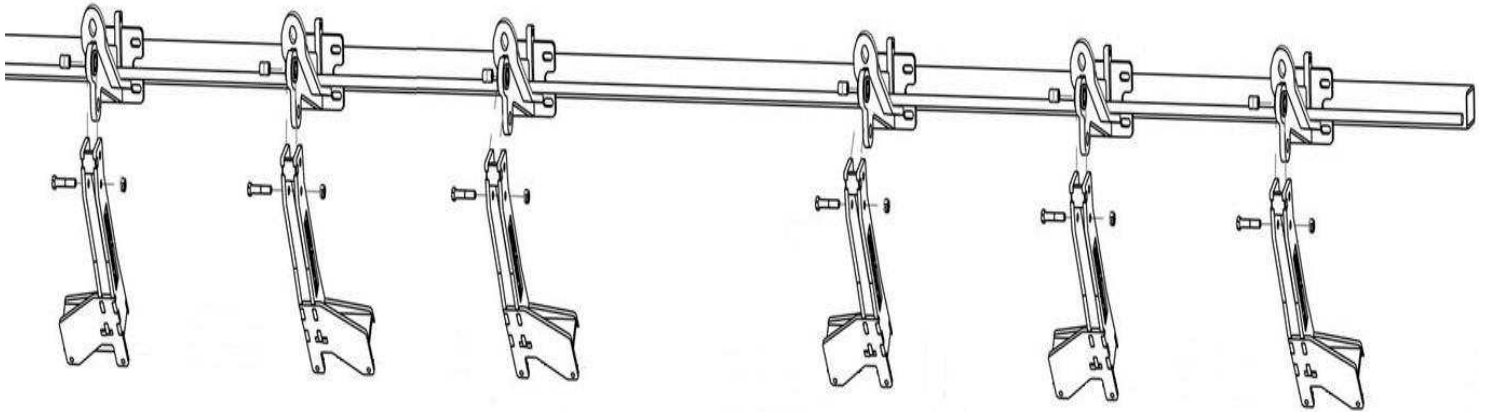

Step 5: Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and 1/2" jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and 3/4" lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

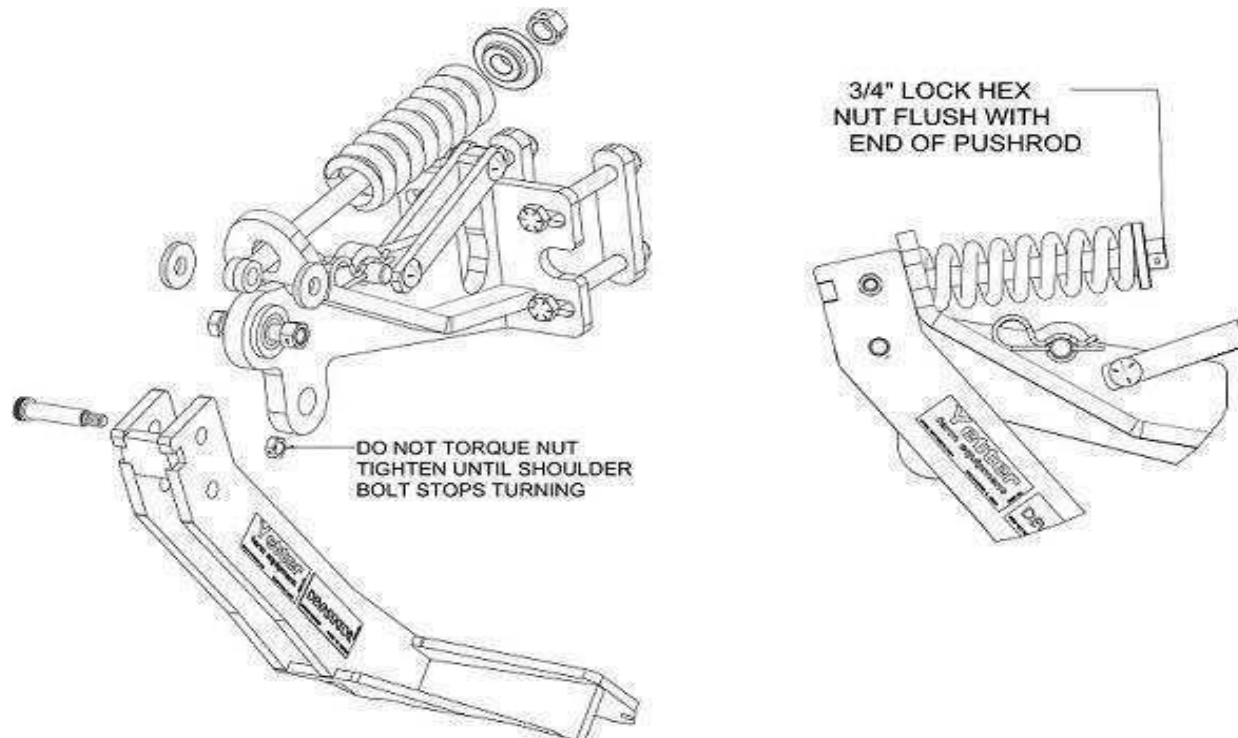

NOTE: Tightening the nut on the spring bushing more will result in added down pressure. However, DO NOT tighten the nut on the spring bushing down so far that spring compression limits pivot arm travel. This will cause the spring to break, especially if spring is compressed all off-season.

5000-026C ASSEMBLY INSTRUCTIONS

Step 6: Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8" lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.


Row 1 & 2



Row 2 & 3



Row 3 & 4

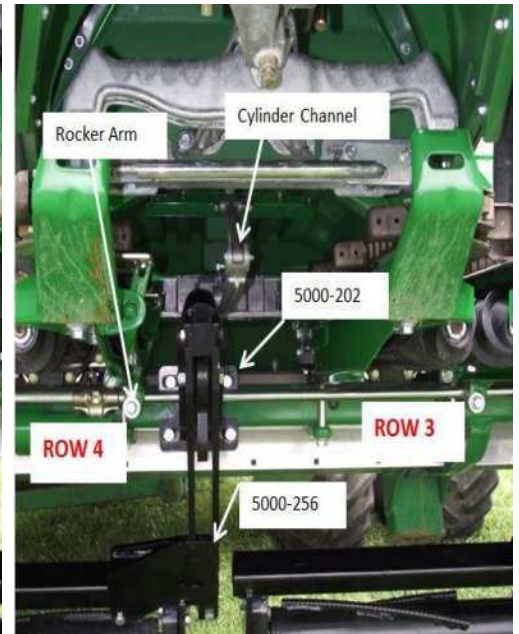

Row 5 & 6



Row 6 & 7




Row 7 & 8




5000-026C ASSEMBLY INSTRUCTIONS

Step 7: Install the Roller Arm Mount Tube inside the clamp channel of the pivot arms using the 5000-138 bolt bag. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

NOTE: Install the 2 & 3 row Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.

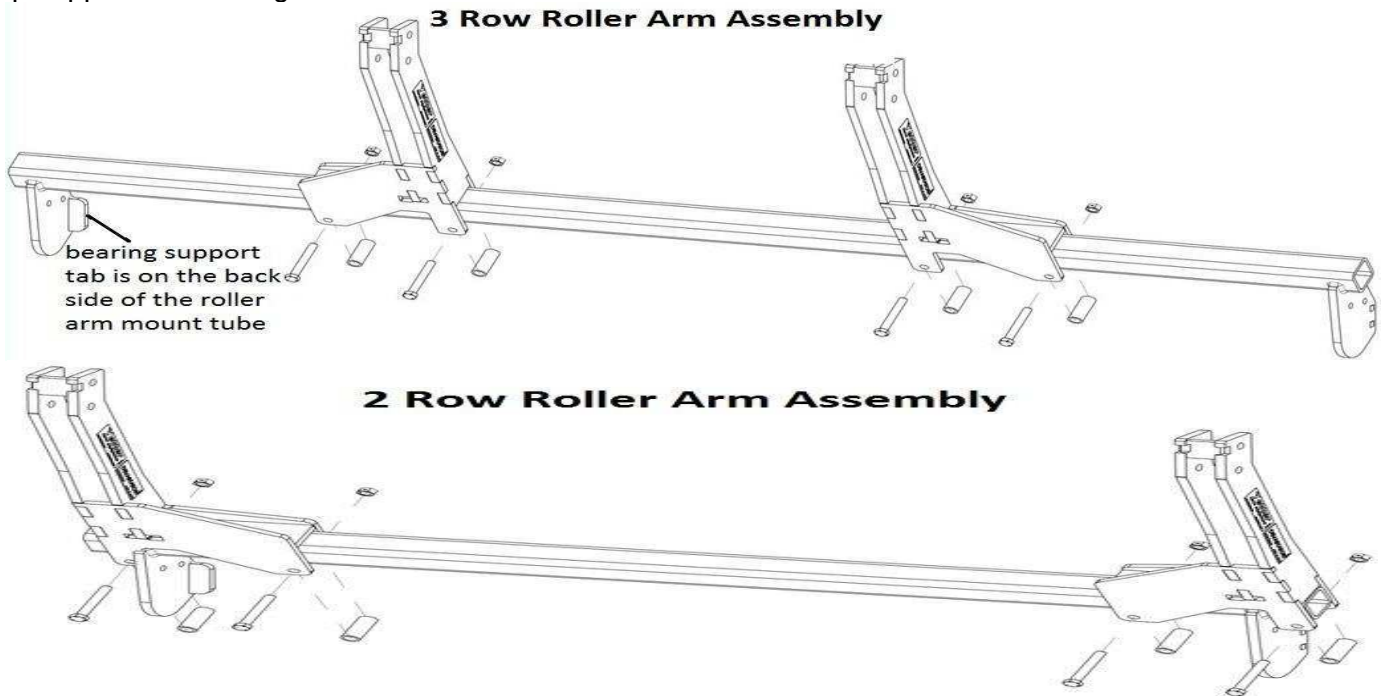


Step 8: Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the $\frac{1}{2}$ " X $2\frac{1}{2}$ " bolts and tighten the $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly centered under each row.

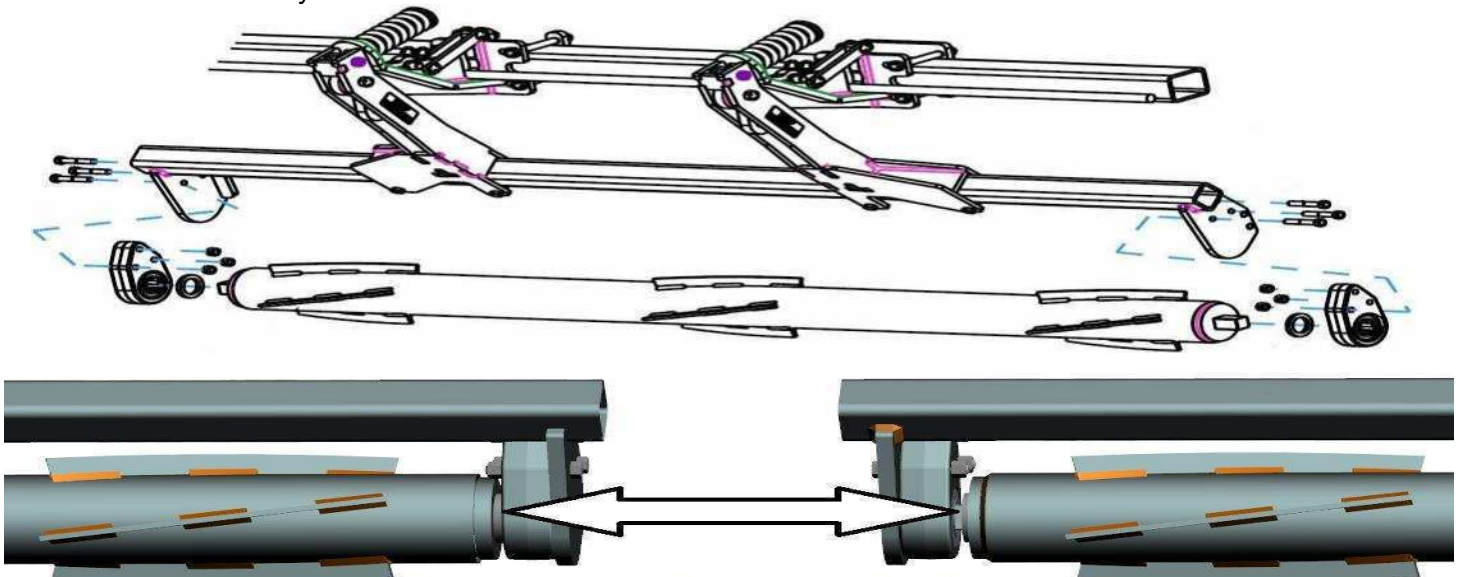

THE SIDE OF THE BEARING ASSEMBLY WHERE THE BEARING IS PROTRUDING MUST BE INSTALLED TOWARD THE ROLLER!


5000-027C ASSEMBLY INSTRUCTIONS

(JD 612C, 712C, 1243, 1293, & C12R)

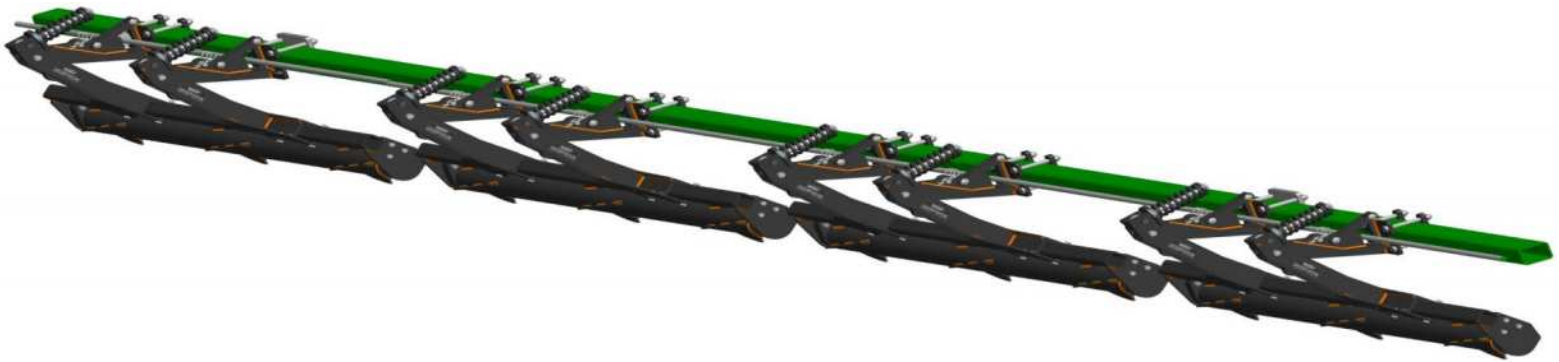


Step 1: Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 4 & 5, 5 & 6, 7 & 8, 8 & 9, 10 & 11, and 11 & 12. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. On JD 1293 corn heads, use the 5000-301 L Clamp Plate with the mounting brackets between rows 2 & 3 and 10 & 11. If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed.


Note: Do not fully tighten hardware until **Step 6** after all of the pivot arms & springs are installed.

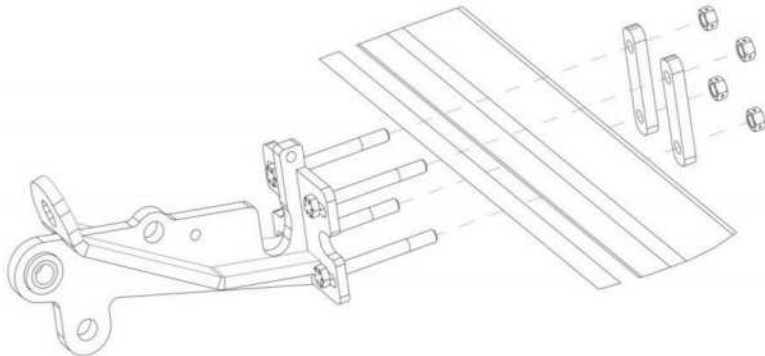

MOUNTING BRACKET ASSEMBLY INSTRUCTIONS (ROW 2-3 AND 10-11)
JD 1293 (12 ROW) CORN HEAD (ONLY)

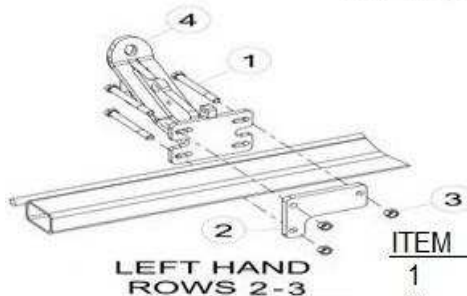


LEFT HAND
ROWS 2-3

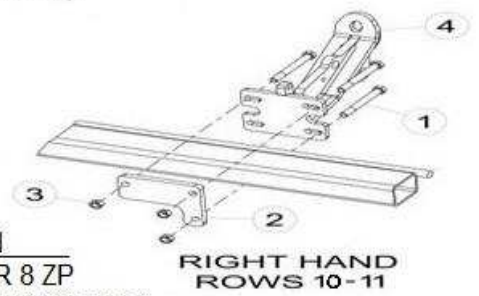

RIGHT HAND
ROWS 10-11


ITEM	PART #	DESCRIPTION
1	2502-352	5/8 - 11 X 6 HHCS GR 8 ZP
2	5000-301	"L" MOUNT PLATE JD 90 SERIES
3	2520-459	5/8 - 11 HEX LOCK NUT ZP
4	5000-202	MOUNT BRACKET W.A., SINGLE

Arrows indicate 5000-202 mount bracket locations, mounts will go on front side of frame, straps on back side of frame.

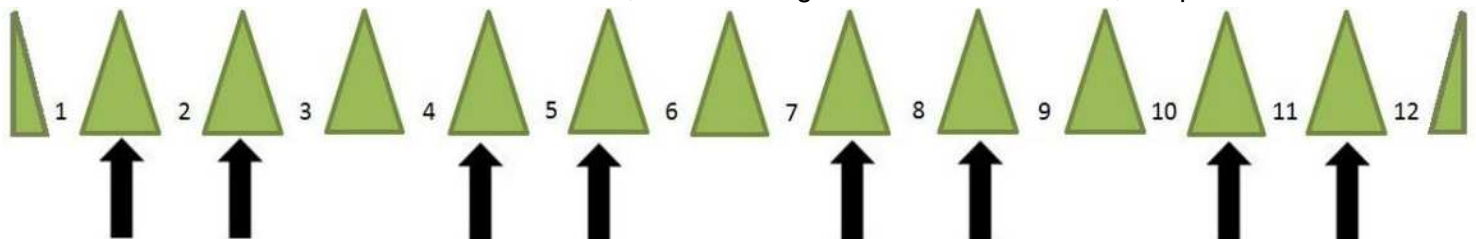


5000-027C ASSEMBLY INSTRUCTIONS

Step 2: Attach the 5000-309 support straps using $\frac{1}{2}$ " x 2" carriage bolts & $\frac{1}{2}$ " flange lock nuts, tighten.

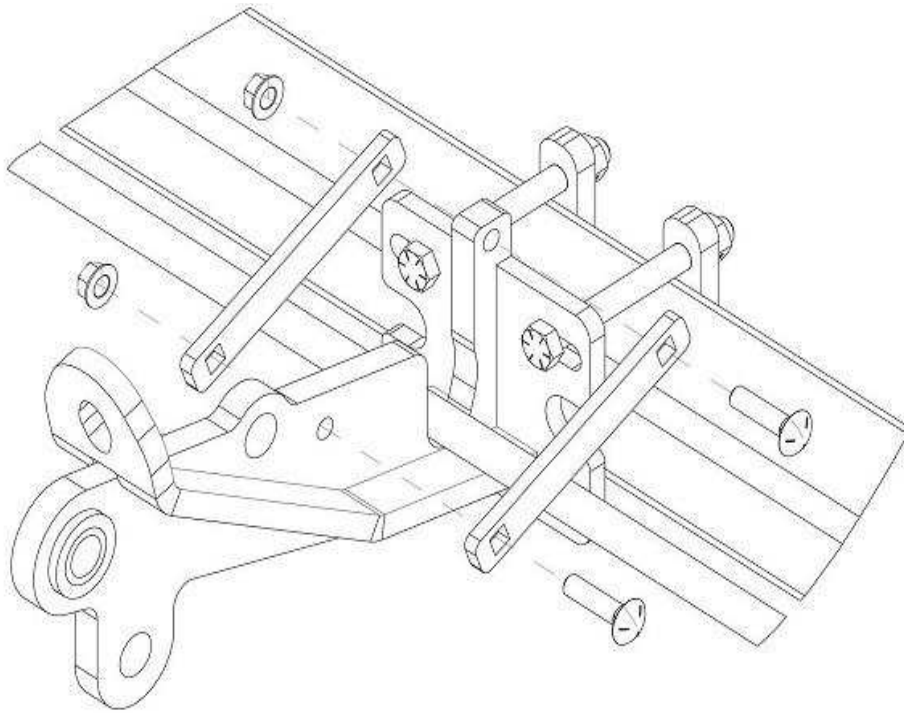


Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

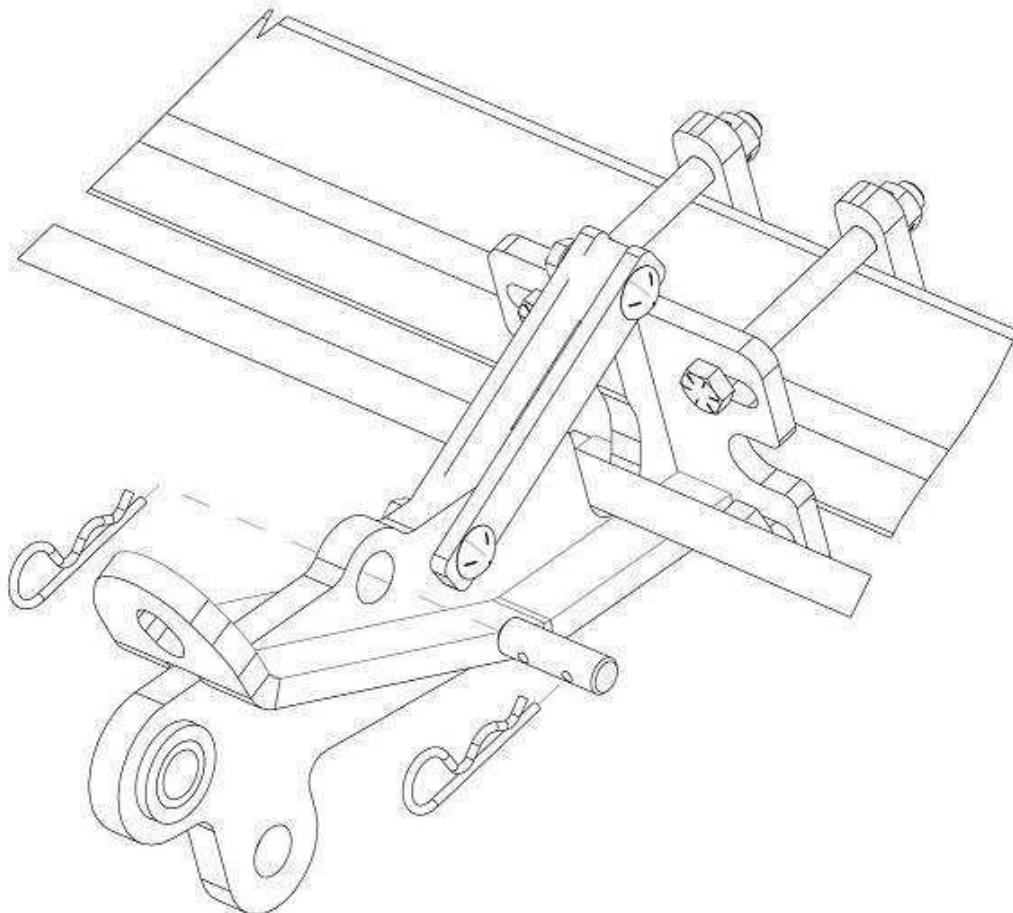

5000-027C ASSEMBLY INSTRUCTIONS


Step 4: Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

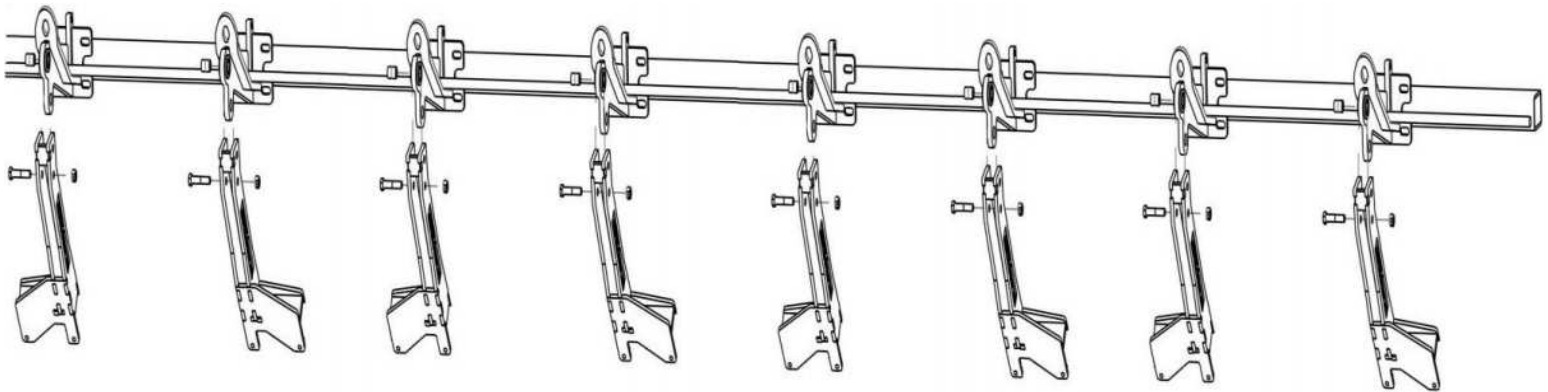

Step 5: Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and 1/2" jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and 3/4" lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

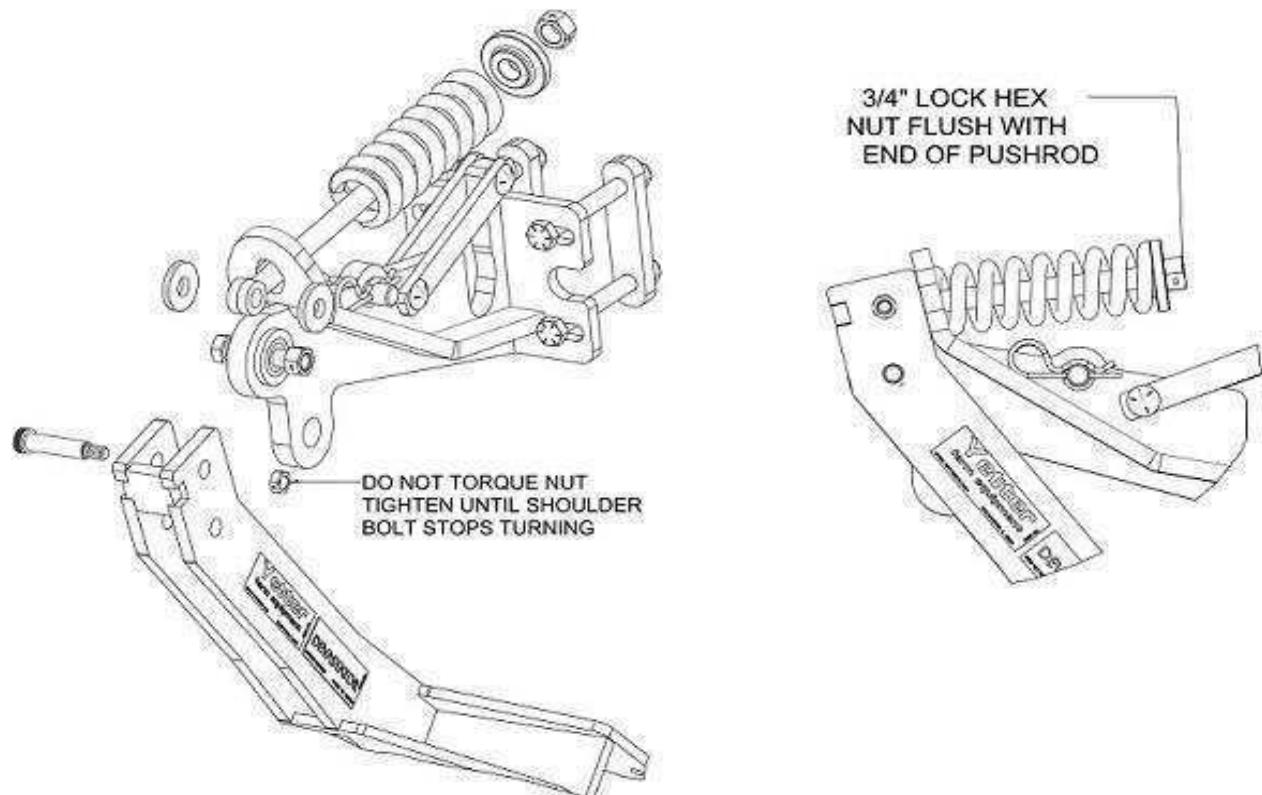


NOTE: Tightening the nut on the spring bushing more will result in added down pressure. However, DO NOT tighten the nut on the spring bushing down so far that spring compression limits pivot arm travel. This will cause the spring to break, especially if spring is compression all off-season.


5000-027C ASSEMBLY INSTRUCTIONS

Step 6: Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.


Row 1 & 2

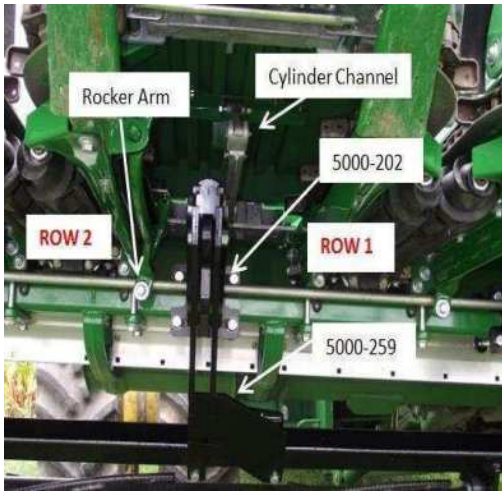


Row 2 & 3

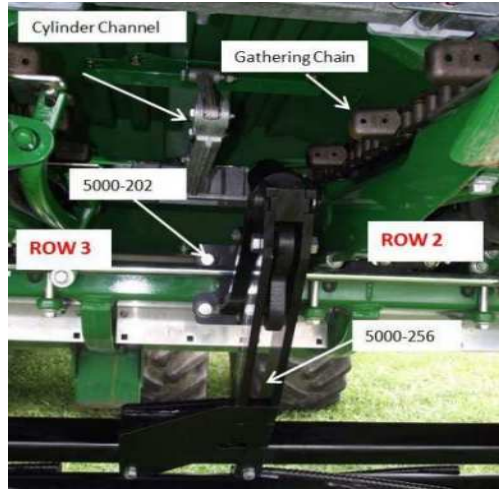


Row 4 & 5

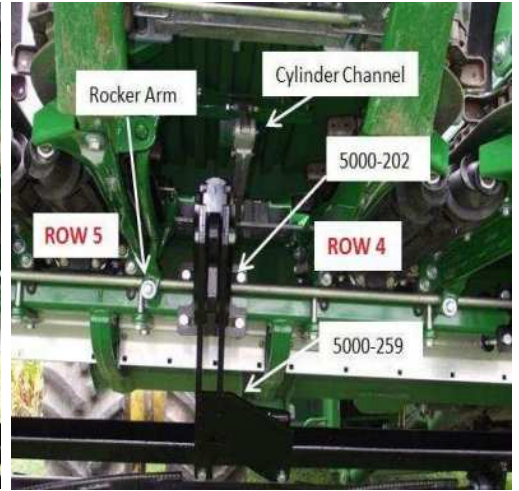


Row 5 & 6

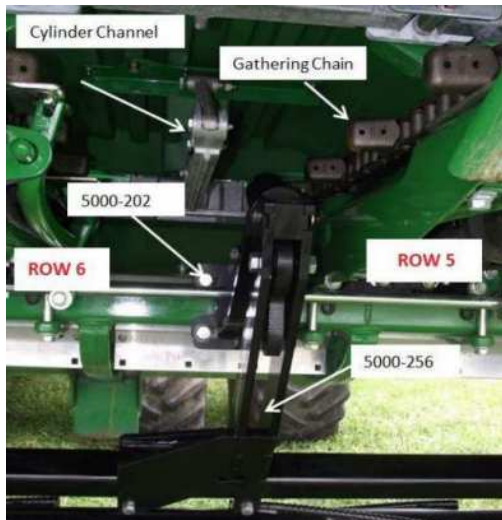


Row 7 & 8

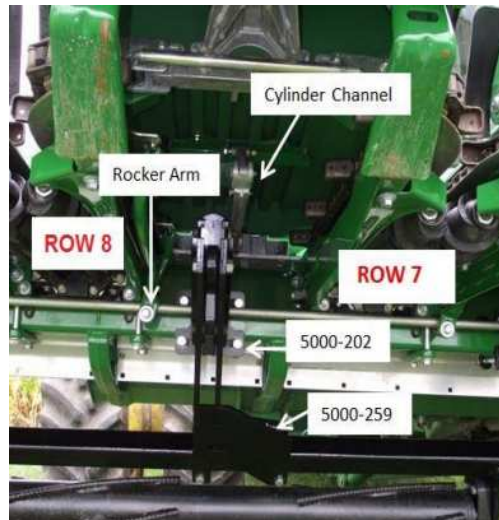


Row 8 & 9

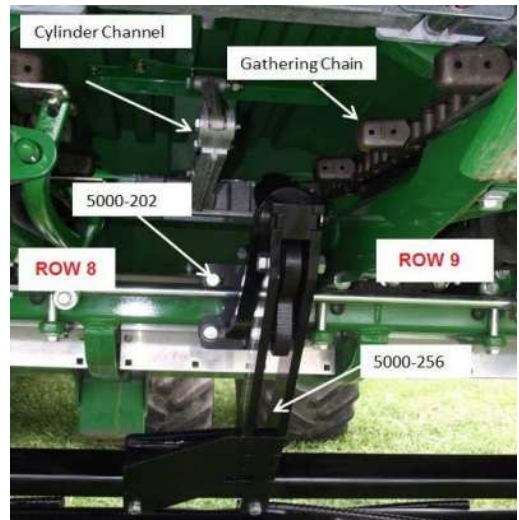

Row 10 & 11

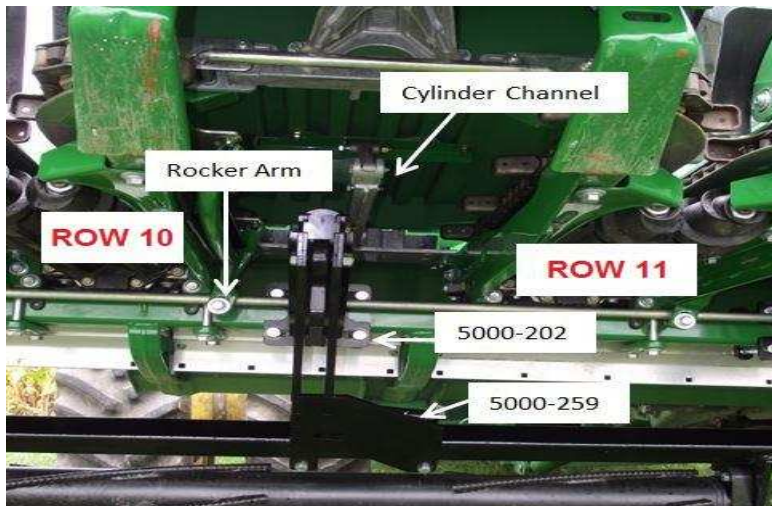

Row 11 & 12

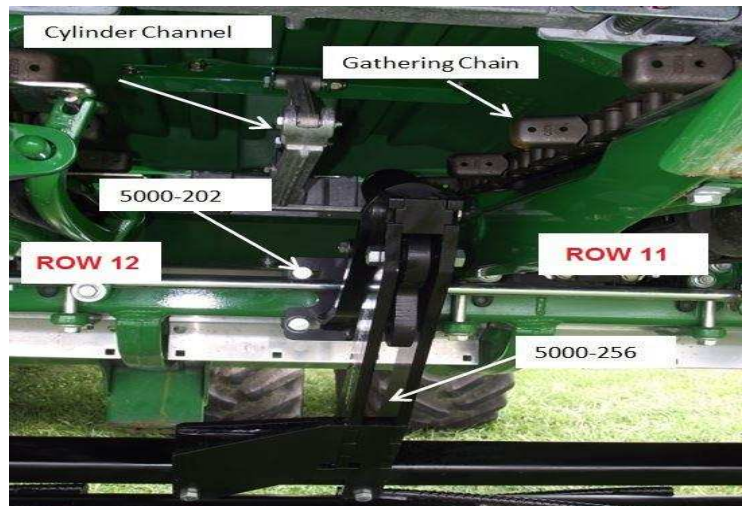



5000-027C ASSEMBLY INSTRUCTIONS

Step 7: Install the Roller Arm Mount Tube inside the clamp channel of the pivot arms using the 5000-138 bolt bag. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

NOTE: Install the Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.




Step 8: Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the $\frac{1}{2}$ " X $2\frac{1}{2}$ " bolts and tighten the $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly under the row.

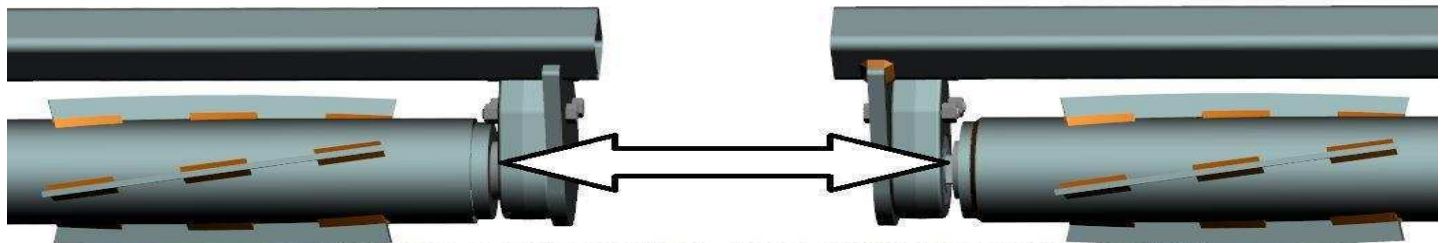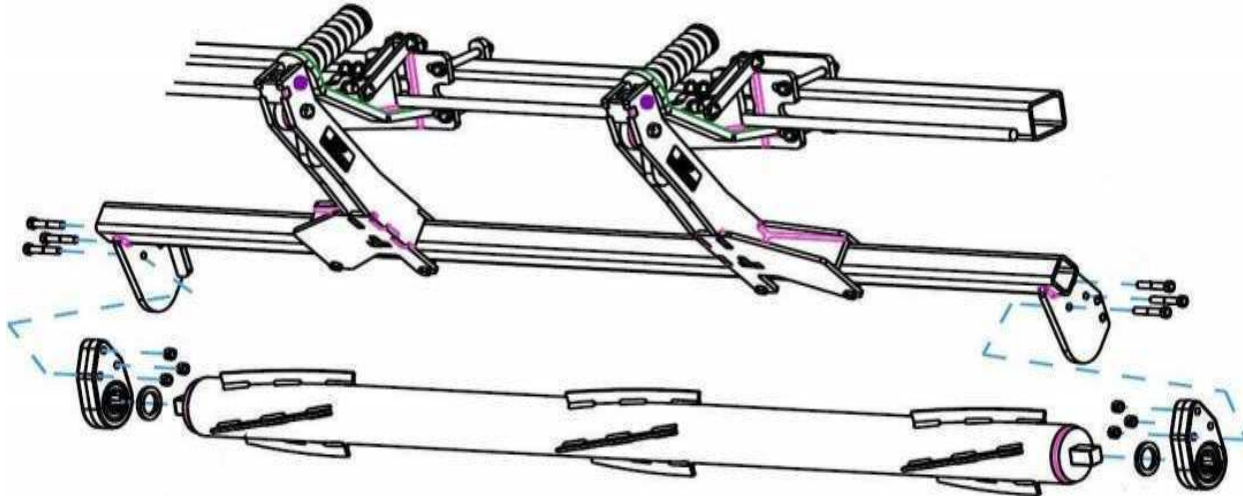

THE SIDE OF THE BEARING ASSEMBLY WHERE THE BEARING IS PROTRUDING MUST BE INSTALLED TOWARD THE ROLLER!


5000-028C ASSEMBLY INSTRUCTIONS

(JD 616C, 716C, C16F, & C16R)

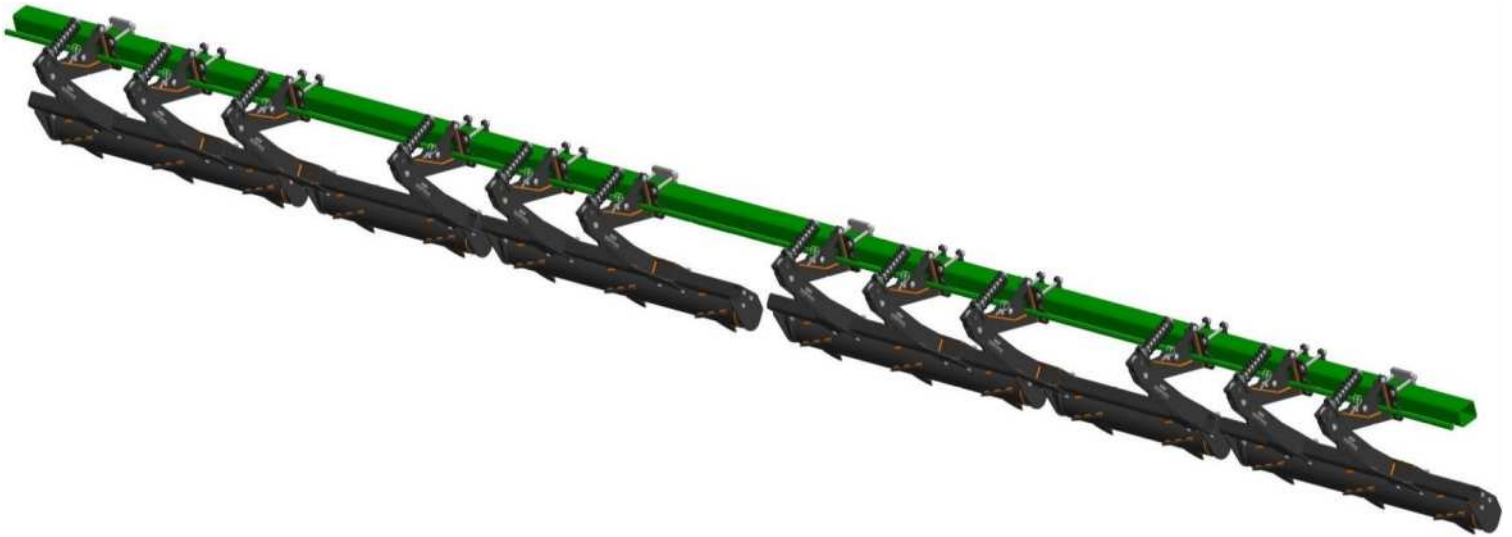


Step 1: Attach the 5000-202 mount brackets to the frame using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Mounting Brackets will be located under the snouts between rows 1 & 2, 2 & 3, 4 & 5, 5 & 6, 7 & 8, 8 & 9, 10 & 11, and 11 & 12. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket. If corn head is equipped with protective shield (like pic with the arrow shows), you can either: remove each shield, cut a notch in each shield, or bend each shield upwards to gain clearance. The shields on a 90 series head will need removed.

Note: Do not fully tighten hardware until **Step 6** after all of the pivot arms & springs are installed.

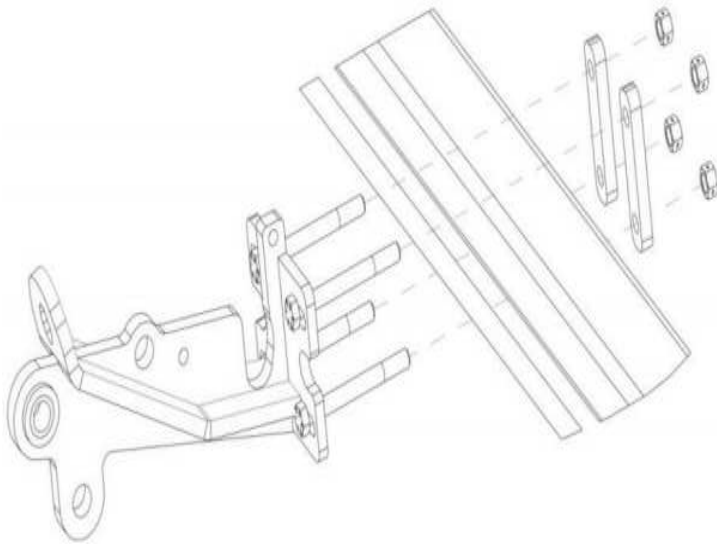


Arrows indicate 5000-202 mount bracket locations, mounts will go on front side of frame, straps on back side of frame.

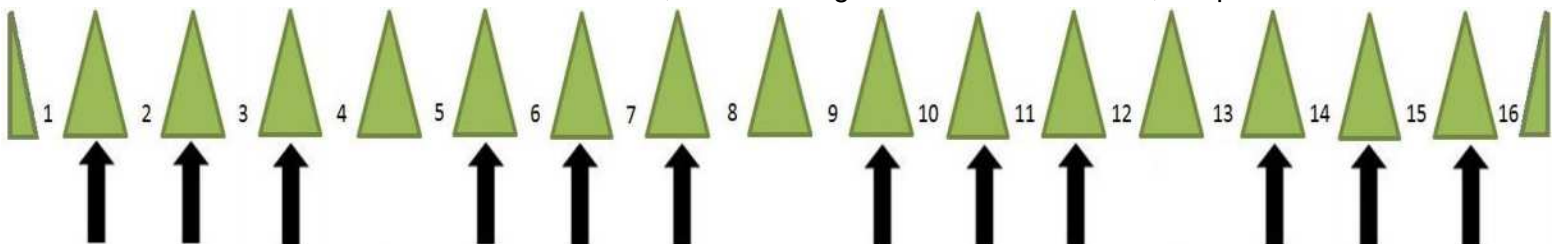


5000-028C ASSEMBLY INSTRUCTIONS

Step 2: Attach the 5000-309 support straps using $\frac{1}{2}$ " x 2" carriage bolts & $\frac{1}{2}$ " flange lock nuts, tighten.

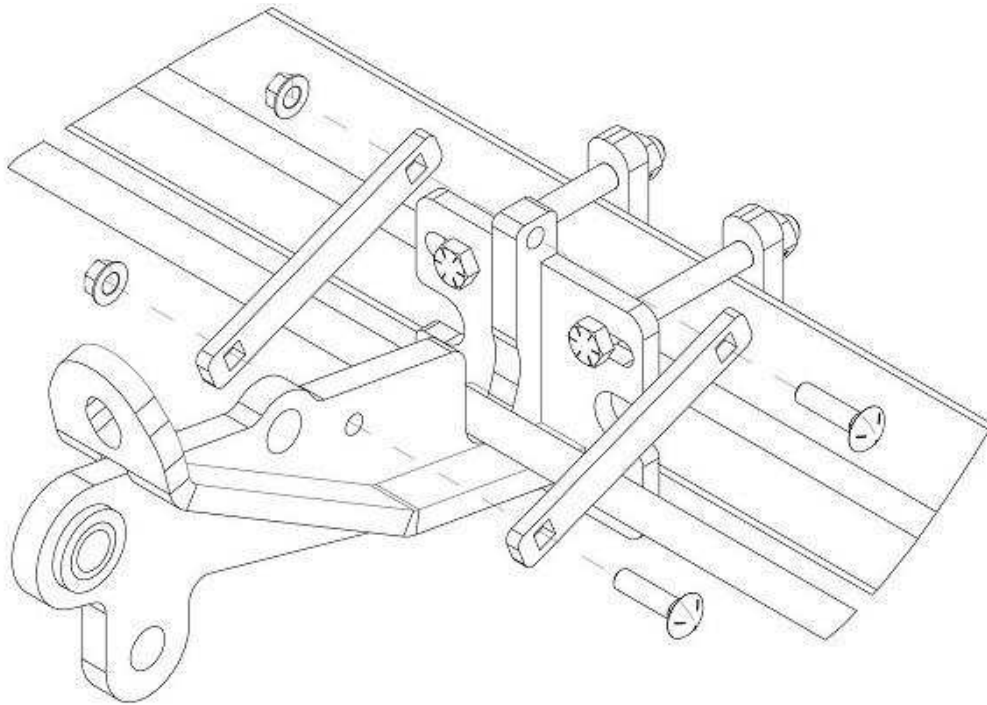


Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

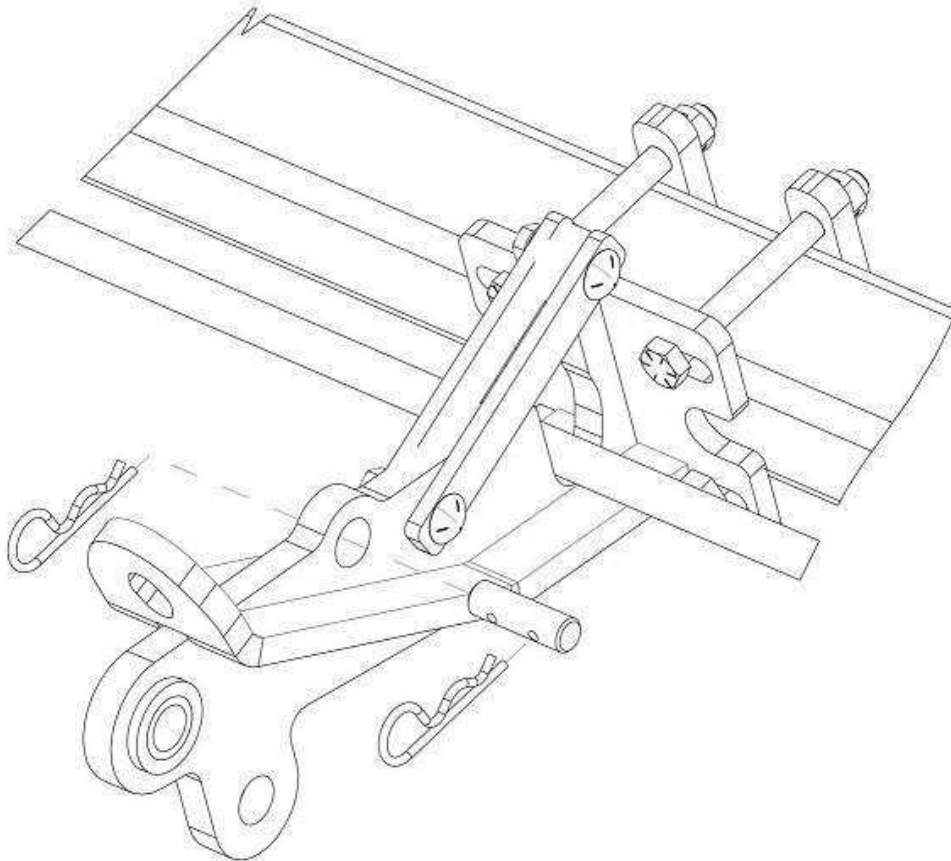

5000-028C ASSEMBLY INSTRUCTIONS


Step 4: Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

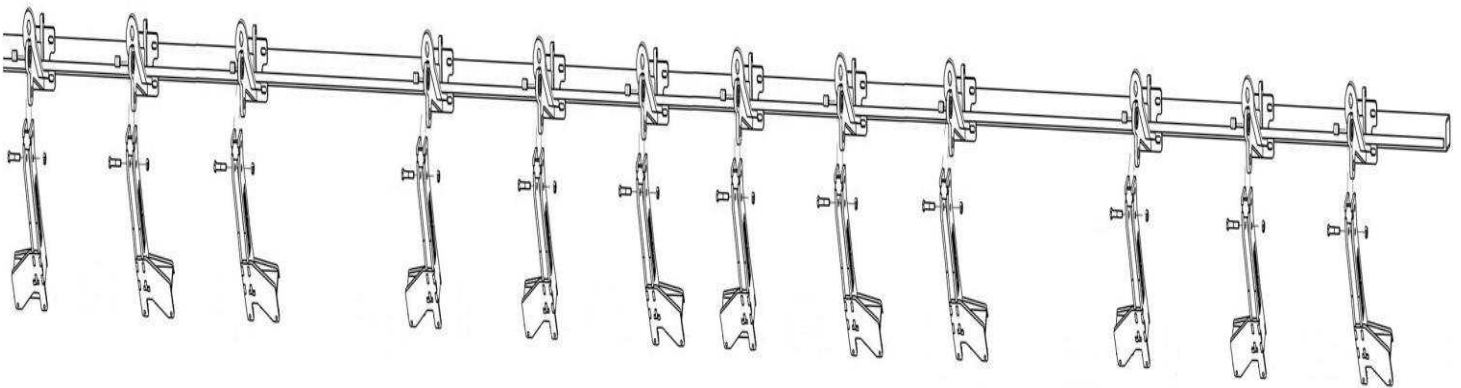

Step 5: Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and 1/2" jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.

Now install the compression spring, spring bushing, and 3/4" lock hex nuts. Tighten the hardware from **Step 5** to the specification in the diagram below.

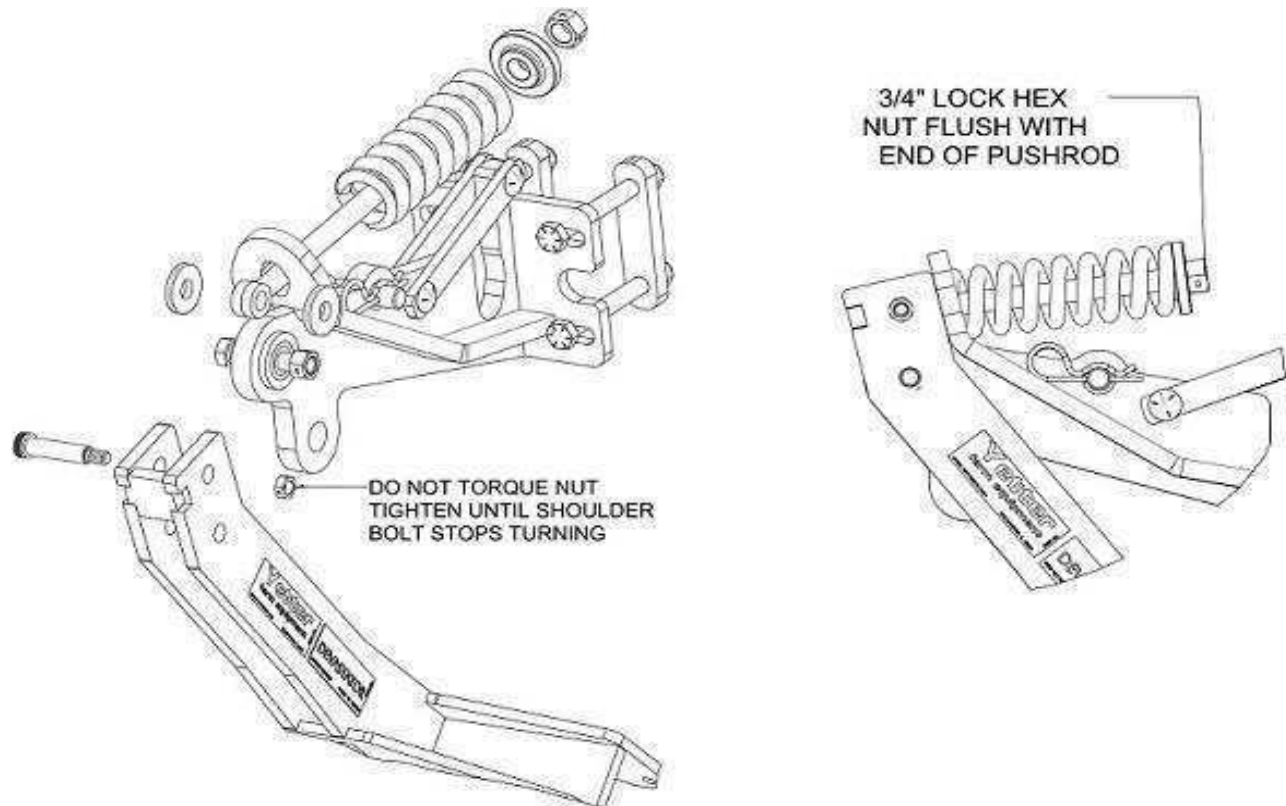


NOTE: Tightening the nut on the spring bushing more will result in added down pressure. However, DO NOT tighten the nut on the spring bushing down so far that spring compression limits pivot arm travel. This will cause the spring to break, especially if spring is compression all off-season.

5000-028C ASSEMBLY INSTRUCTIONS

Step 6: Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.


Row 1 & 2

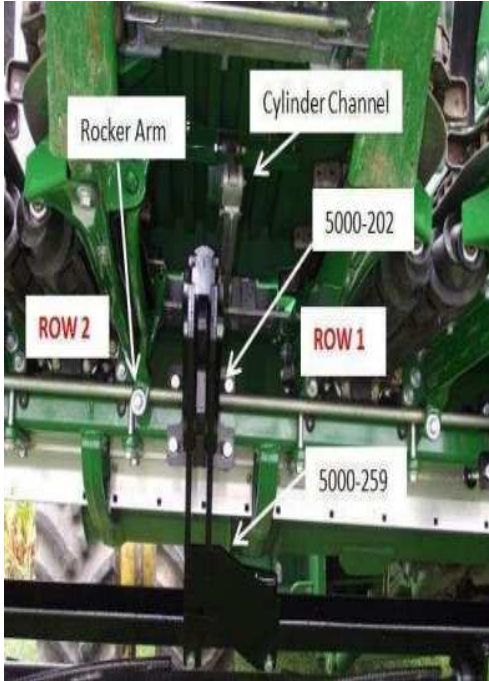

Row 2 & 3



Row 3 & 4

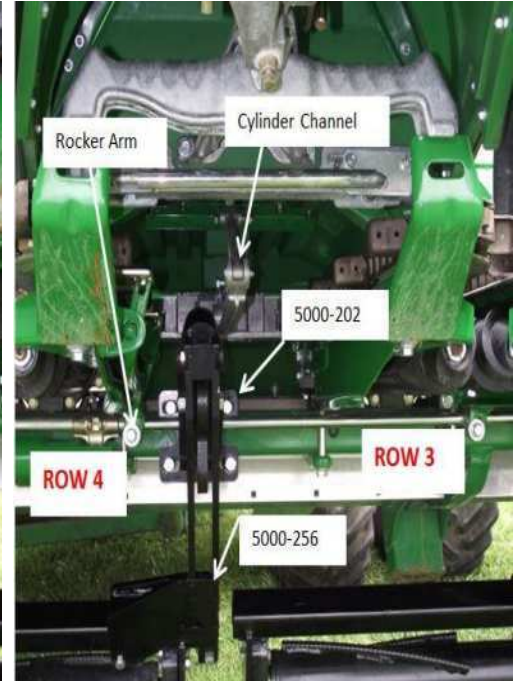

Row 5 & 6



Row 6 & 7




Row 7 & 8



5000-028C ASSEMBLY INSTRUCTIONS

Step 6: Secure the mounting bracket installed in **Step 1** at this time by tightening the 5/8 X 6" bolts & 5/8 lock nuts. Make sure the compression spring clears the cylinder channel as well as the rocker arm of the deck plate adjustment. The offset pivot arm clamp should be under the snout, not directly under the row.


Row 9 & 10

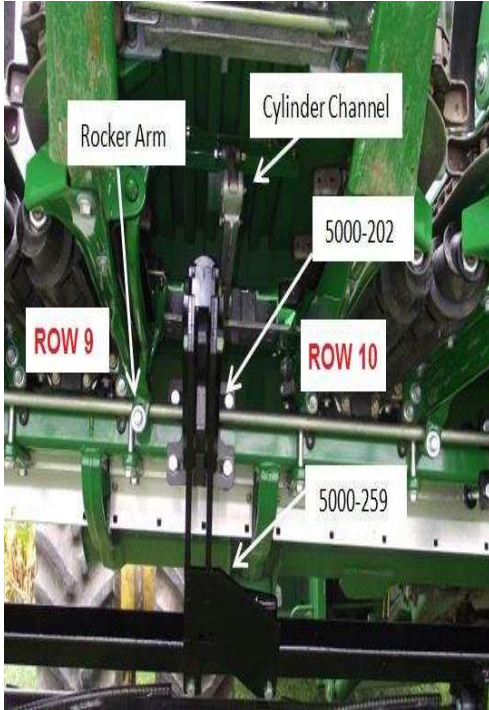

Row 10 & 11




Row 11 & 12

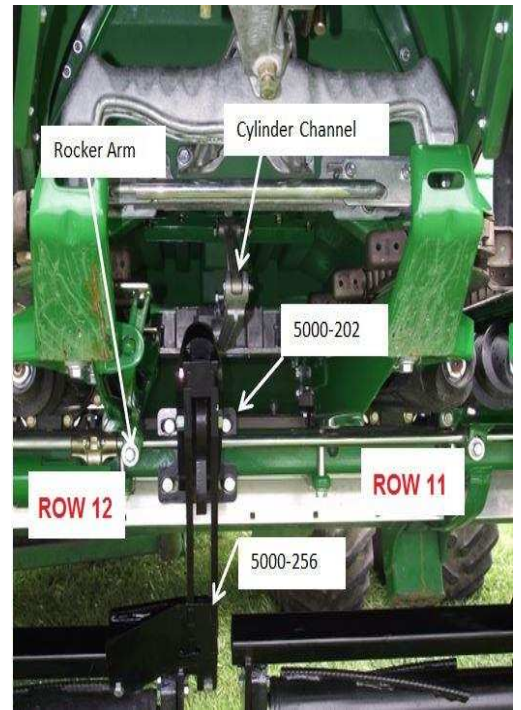


Row 13 & 14



Row 14 & 15

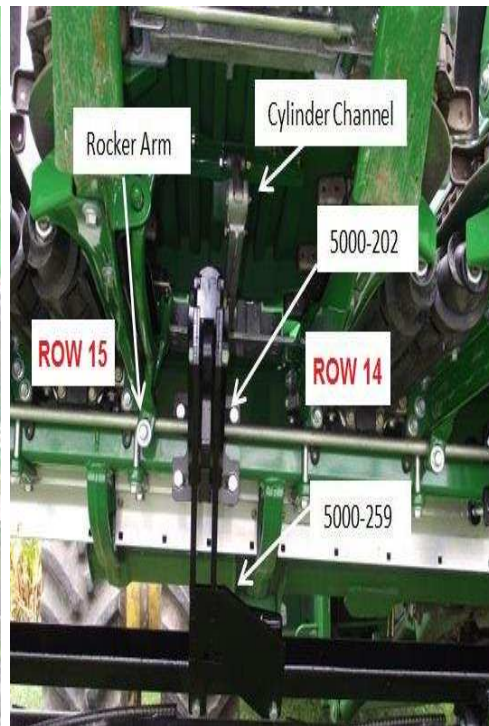


Row 15 & 16

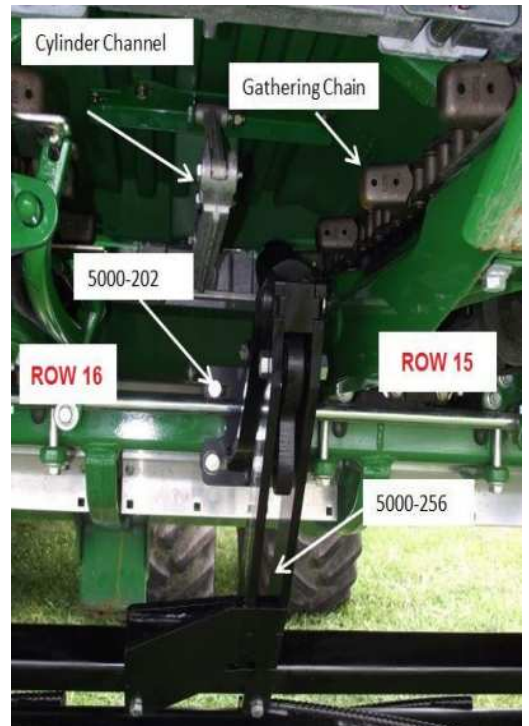


5000-028C ASSEMBLY INSTRUCTIONS

Step 7: Install the Roller Arm Mount Tube inside the clamp channel of the pivot arms using the 5000-138 bolt bag. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

NOTE: Install the 2 & 3 row Roller Arm Mount Tube on so that the bearing support tab is on the back side to help support the bearings.

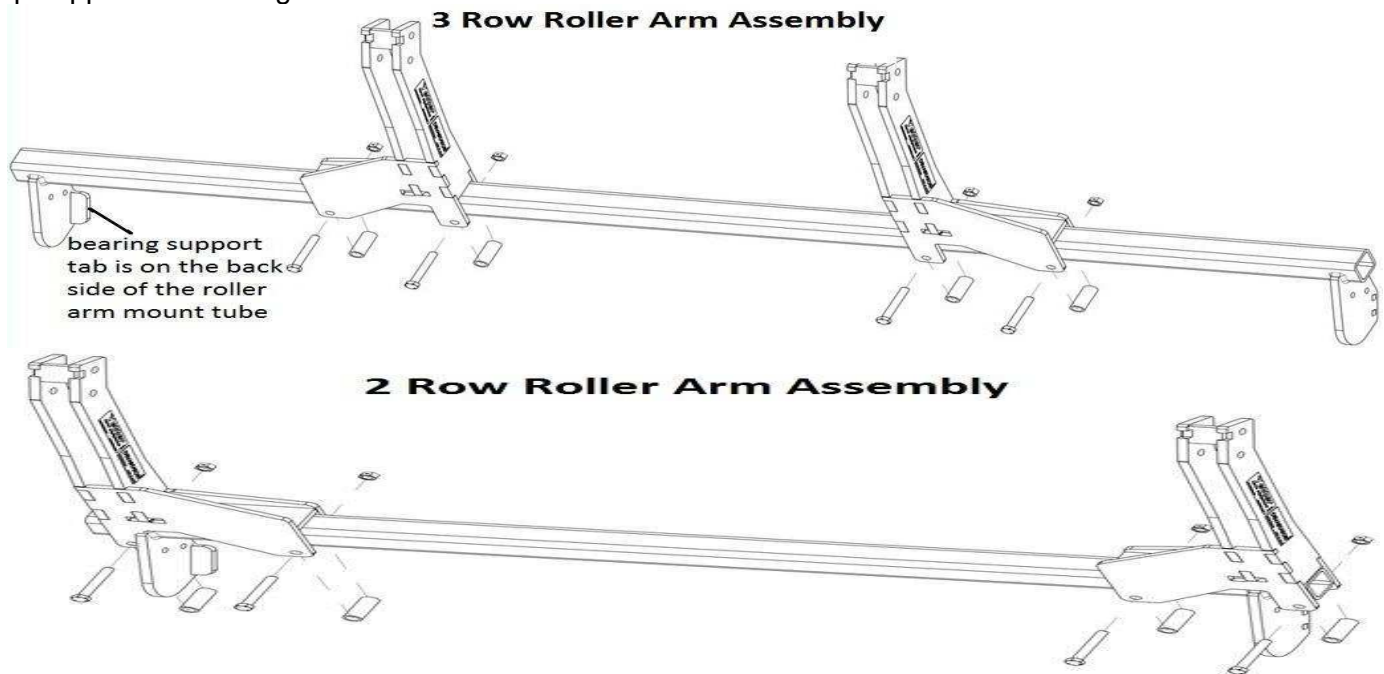


Step 8: Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the $\frac{1}{2}$ " X $2\frac{1}{2}$ " bolts and tighten the $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly under the row.

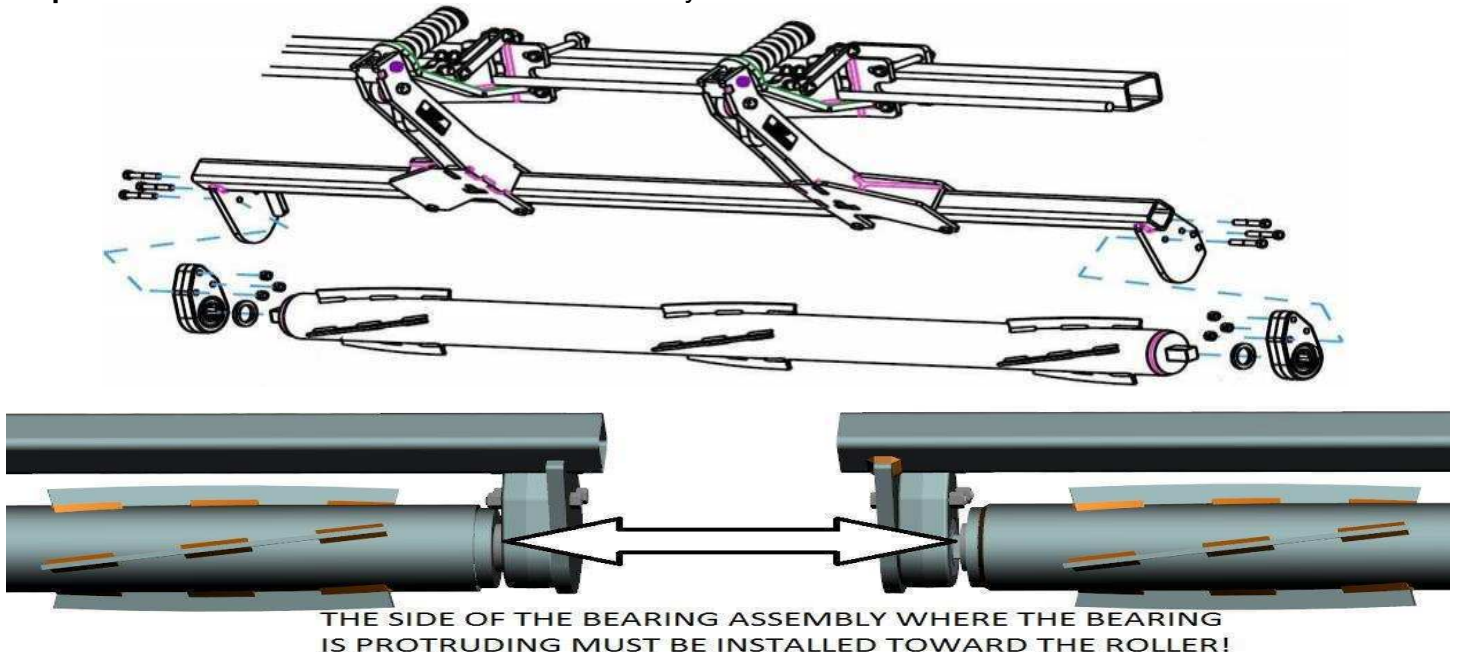

5000-034B ASSEMBLY INSTRUCTIONS


(JD 612FC, 712FC, & C12F)

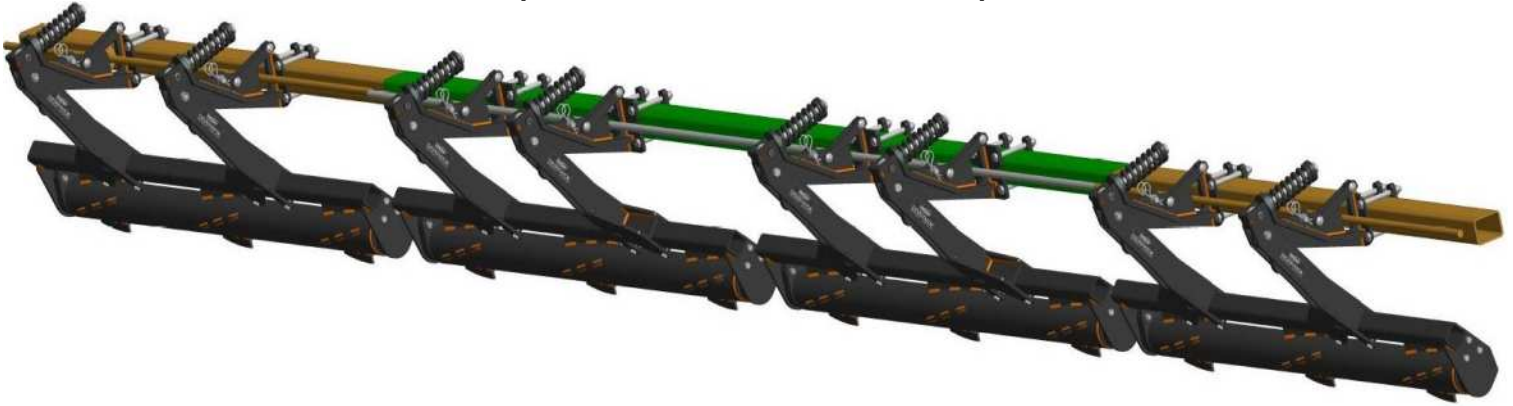


Step 1: Attach the 5000-202 mount brackets to the frame between rows 4 & 5, 5 & 6, 7 & 8, and 8 & 9 using the 5/8 x 6 bolts, mounting straps, & 5/8" lock hex nuts. Attach the 5000-263 mount brackets to the frame between rows 1 & 2, 2 & 3, 10 & 11, and 11 & 12. The 5000-263 mounts between rows 1 & 2 and 2 & 3 will use 5/8 X 6 bolts, mounting straps, & 5/8" lock nuts. The 5000-263 mounts between rows 10 & 11 and 11 & 12 will each use 3) 5/8 X 6 bolts & 1) 5/8 X 6 Carriage bolts (1 used on the top left of each mount on these rows), mounting straps, and 5/8" lock nuts. Slide the mount bracket up so the deck plate adjustment rod is located in the cut out of the mount bracket.

Note: Do not fully tighten hardware until **Step 6** after all of the pivot arms & springs are installed.


6 Center Rows

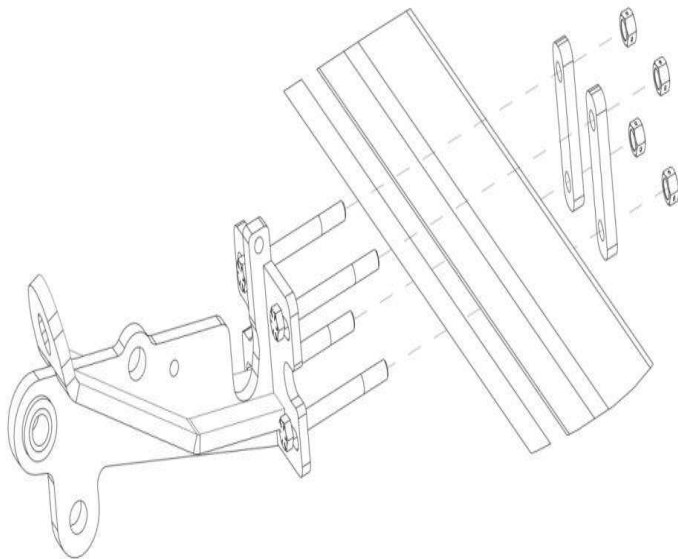

Outside 3 Rows

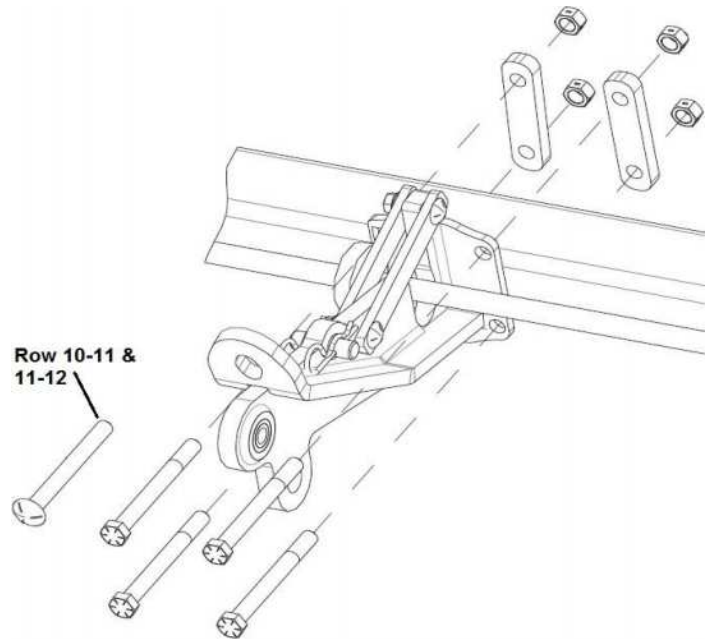


Arrows indicate 5000-202 mount bracket locations, mounts will go on front side of frame, straps on back side of frame.

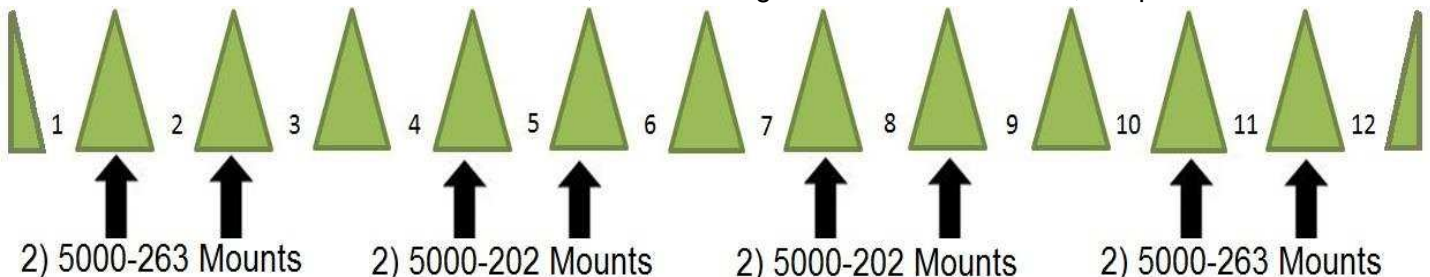


5000-034B ASSEMBLY INSTRUCTIONS

Step 2: Attach the 5000-309 support straps using $\frac{1}{2}$ " x 2" carriage bolts & $\frac{1}{2}$ " flange lock nuts, tighten.

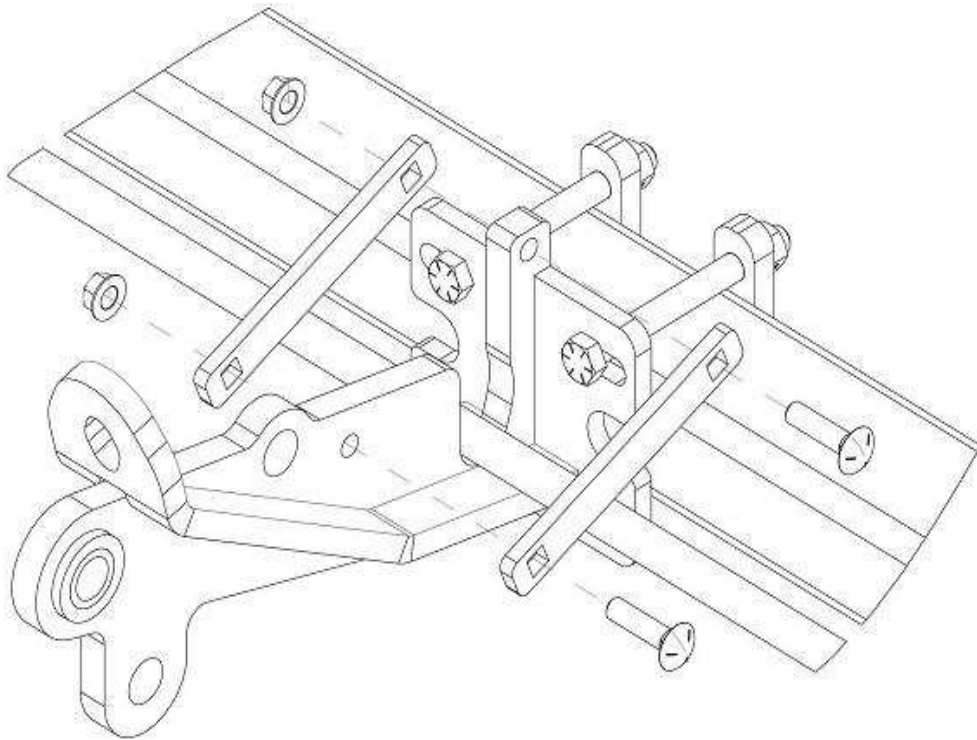


Step 3: Install 5000-323 lock-up pin in storage location on each mount bracket. Secure with hairpin clips.

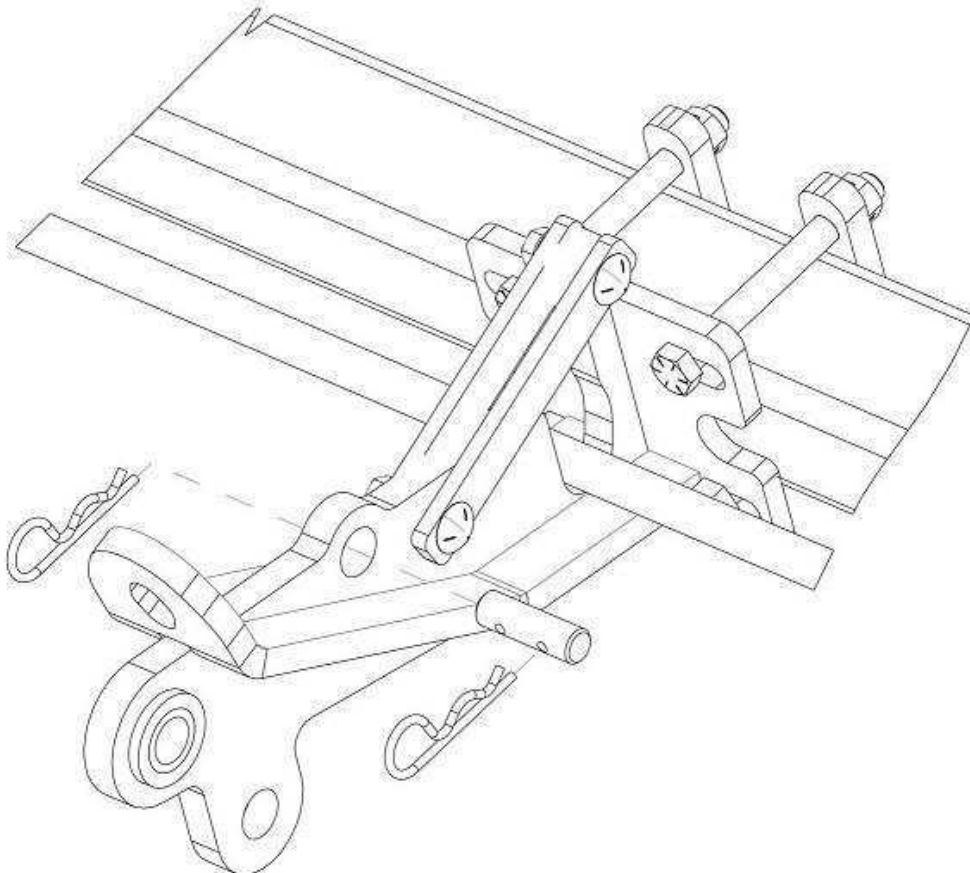

5000-034B ASSEMBLY INSTRUCTIONS


Step 4: Attach the pivot arms to the mount brackets using 5/8" X 3" bolts, pivot bushings, & 5/8" lock hex nuts. Use the model below to determine where the LH & RH pivot arms get installed. Tighten this hardware.

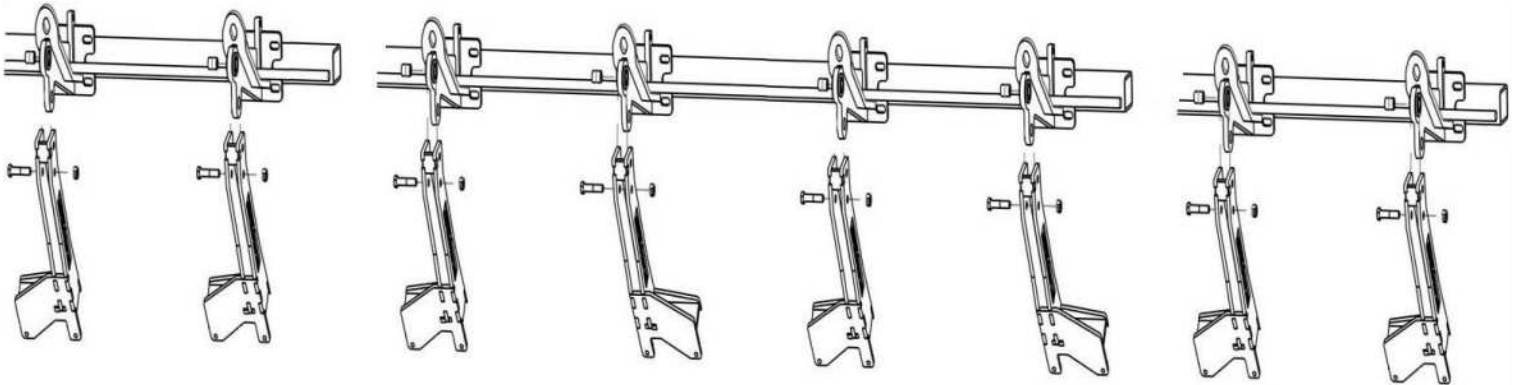

Step 5: Install the push rods into the mount brackets then attach to the pivot arms with the 5/8" shoulder bolts, washers, and 1/2" jam lock nuts.

Note: The washers are installed on each side of the "eye" of the push rod.


Now install the compression spring, spring bushing, and 3/4" lock hex nuts. The 5000-402 wedge will need installed between the compression spring and the mount bracket between rows 1 & 2 and 2 & 3 to keep the spring from contacting the gathering chains. Tighten the hardware from **Step 5** to the specification in the diagram below.

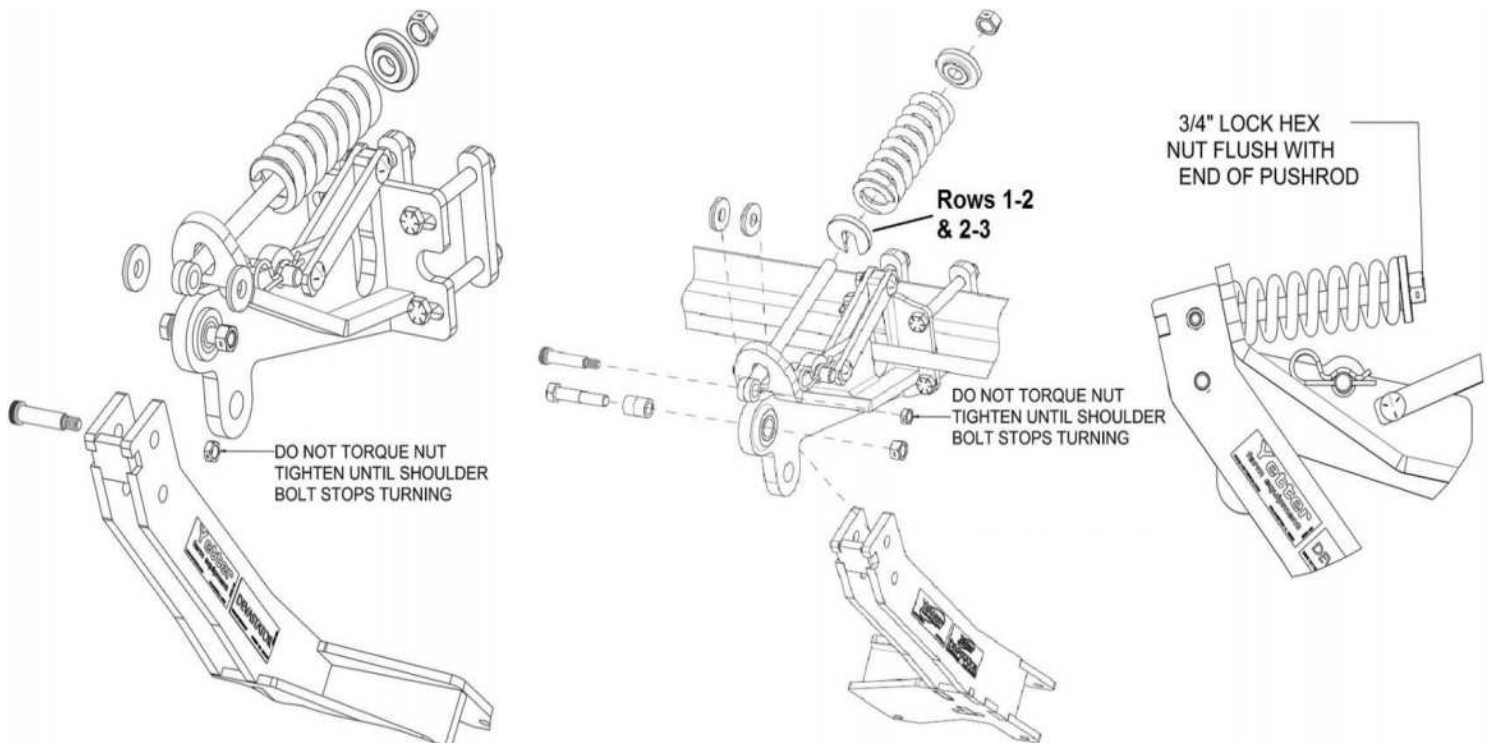


NOTE: Tightening the nut on the spring bushing more will result in added down pressure. However, DO NOT tighten the nut on the spring bushing down so far that spring compression limits pivot arm travel. This will cause the spring to break, especially if spring is compression all off-season.

5000-034B ASSEMBLY INSTRUCTIONS


Row 1 & 2 and 2 & 3

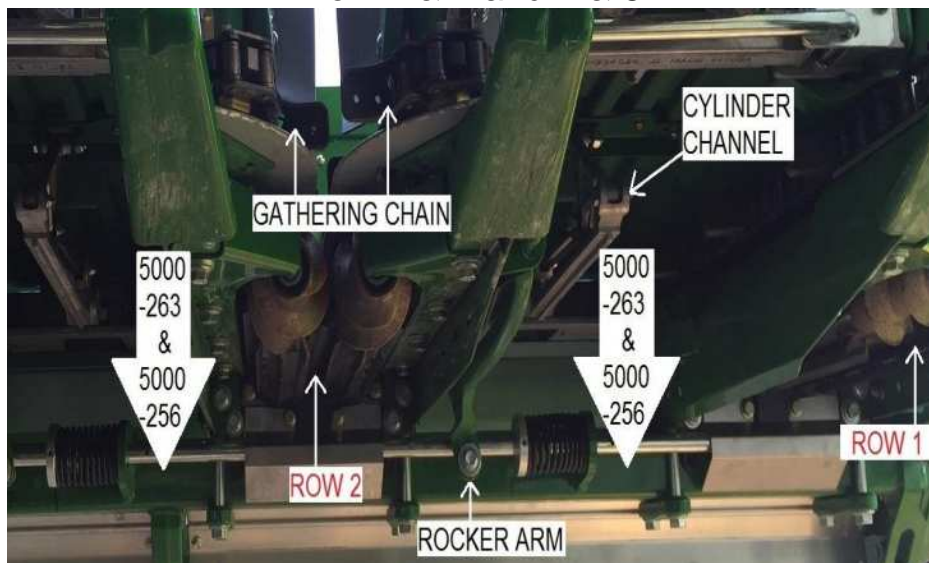


Row 4 & 5

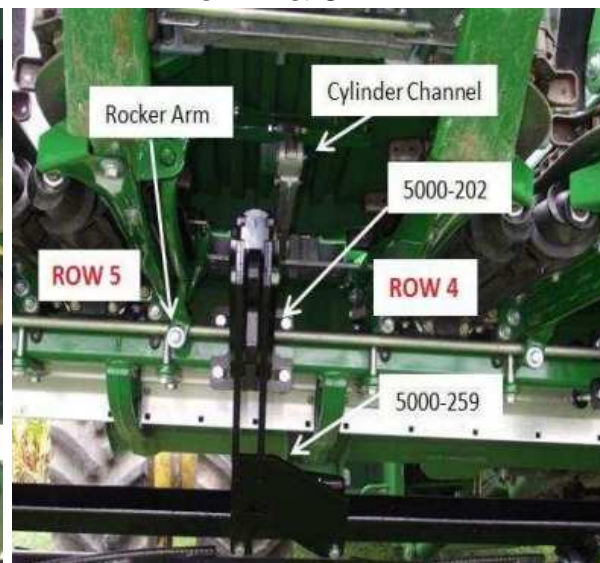

Row 5 & 6

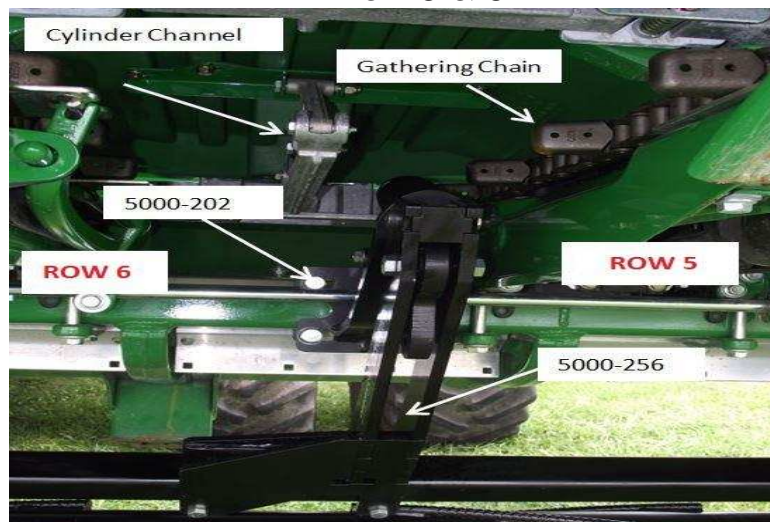


Row 7 & 8

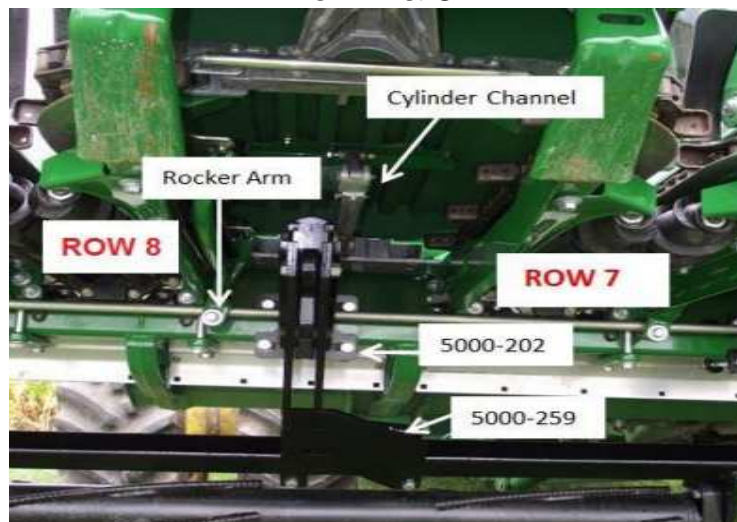

Row 8 & 9




Row 10 & 11 and 11 & 12


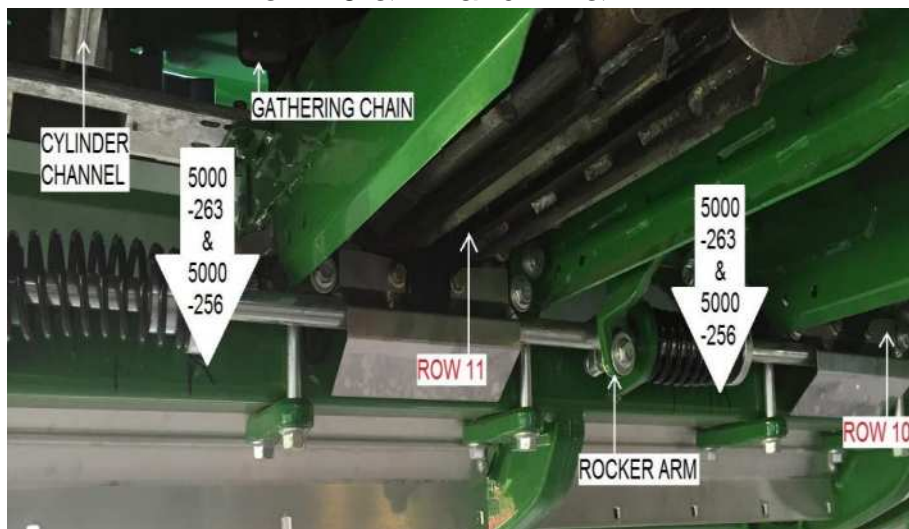


5000-034B ASSEMBLY INSTRUCTIONS

Step 7: Install the Roller Arm Mount Tube inside the clamp channel of the pivot arms using the 5000-138 bolt bag. Do not tighten this hardware until after the rollers have been installed in **Step 8**.

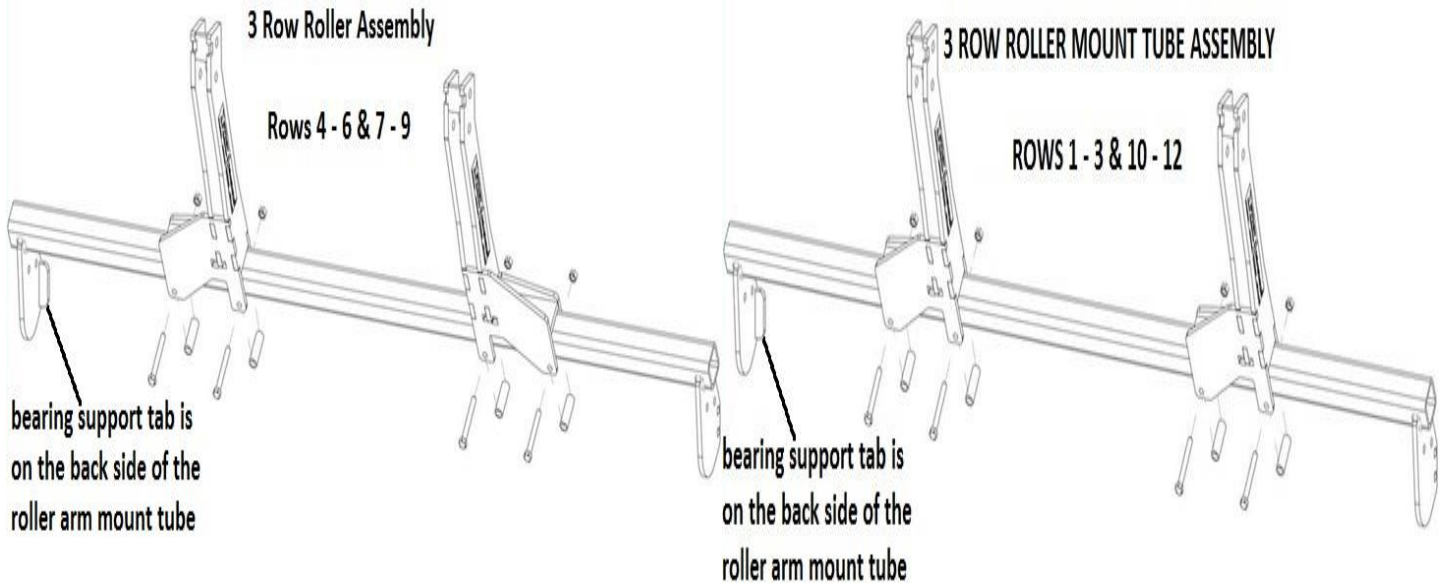

Step 8: Insert the shim washer over the shaft on each end of the roller. Install the bearing over the shaft on each end of the roller so that the side of the casting that has the bearing protruding past the housing surface is towards the roller barrel & shim washer. Lift each roller into place, traction bar in front of the rebar, so that the bolt holes on the cast line up with the mounting tabs on the roller arm mount tube. Install the $\frac{1}{2}$ " X $2\frac{1}{2}$ " bolts and tighten the $\frac{1}{2}$ " lock nuts. Once the roller & bearing hardware is fastened, spin the roller to ensure the bearing was installed correctly. If the roller was installed incorrectly, the roller will not spin or will have drag. Slide the roller mount tube to gain clearance on each end of the corn head & then tighten the hardware from **Step 7**. The traction bars DO NOT have to be directly under the row.

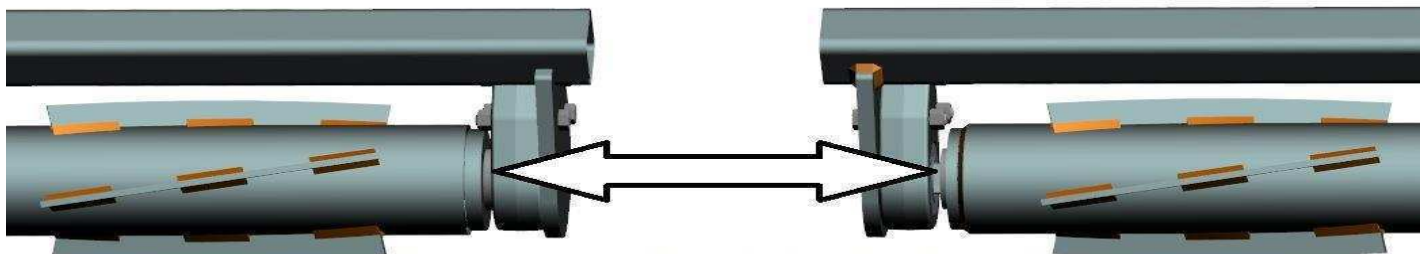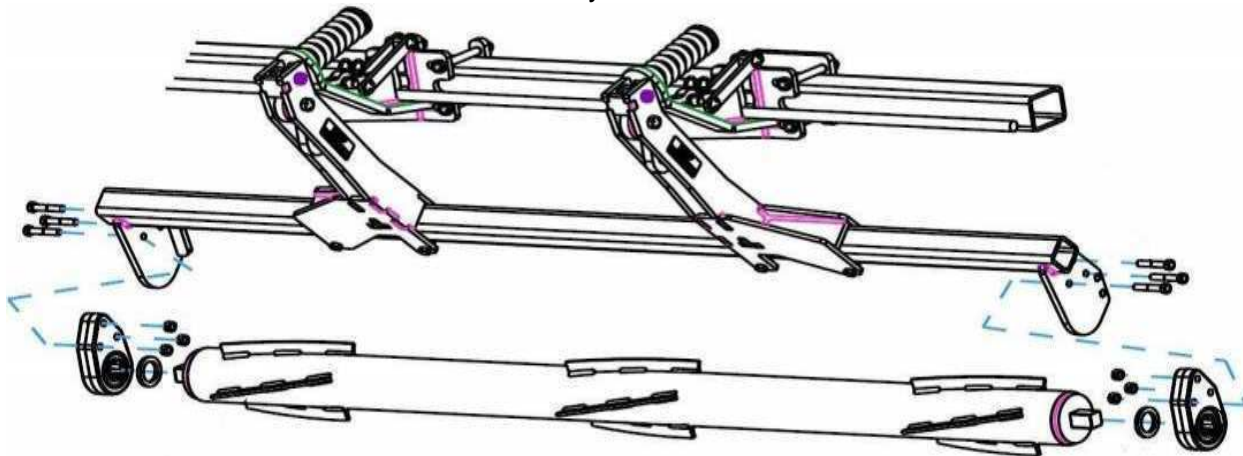

THE SIDE OF THE BEARING ASSEMBLY WHERE THE BEARING IS PROTRUDING MUST BE INSTALLED TOWARD THE ROLLER!

OPERATION

CORN HEAD ANGLE SHOULD BE BETWEEN 23 – 25° FOR OPTIMUM DEVASTATOR PERFORMANCE.

USE THE 5000-455 TO CHECK CORN HEAD ANGLE:

- Put the combine on a level surface. Lower the Corn head to your normal working head height.
- Place the magnetic protractor on the stripper plate to get the angle. Adjust the feeder house as needed, fore or aft, to achieve 23 – 25 degrees.



BEARING REPLACEMENT/MAINTENANCE

Put the bearing housing in a vice, use a pry bar to turn the bearing in the housing parallel with the slots, remove the old bearing, apply anti-seize lubricant to the interior of the bearing housing, insert the new bearing in the slots, & use a pry bar to move back to position. Wobble the bearing around to help work the lubricant into the outer race of the bearing.


NOTE: BEARINGS SHOULD BE LUBRICATED WITH ANTI-SEIZE AT BEGINNING OF EVERY SEASON, WEEKLY DURING SEASON



STORAGE

When storing the corn head for the offseason, it is OK for the 5000 Stalk Devastators to hold some weight of the corn head whether stored on the ground or on a trailer. Removing compression springs may help extend the service life.

LOCKING UP THE 5000 SERIES STALK DEVASTATOR

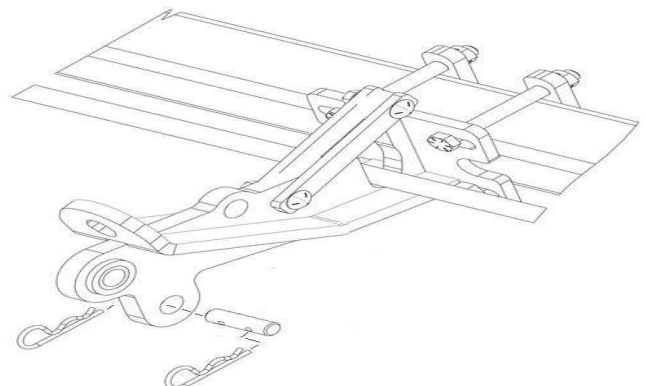


5000-025C 6 ROW PART IDENTIFICATION




ITEM	PART #	DESCRIPTION	QTY
1	2502-325	5/8 – 11 X 3 HHCS GR 5 ZP	4
2	2502-352	5/8 – 11 X 6 HHCS GR 8 ZP	16
3	2502-353	1/2 – 13 X 2 1/2 HHCS GR 8	12
4	2502-365	1/2 – 13 X 3 3/4 HHCS GR 5	8
5	2505-345	1/2 – 13 X 2 CARRIAGE BOLT GR 5 ZP	8
6	2510-121	5/8 DIAMETER SHOULDER BOLT, 2 1/4 SHOULDER, 1/2 – 13	4
7	2520-357	1/2 - 13 LOCK HEX NUT, GR A, ZP	20
8	2520-361	1/2 - 13 FLANGE WHIZ LOCK HEX NUT, GR 5, ZP	8
9	2520-364	1/2 -13 JAM LOCK HEX NUT	4
10	2520-459	5/8 – 11 LOCK HEX NUT, GR B, ZP	20
11	2520-515	3/4 - 10 LOCK HEX NUT, GR A, ZP	4
12	2526-449	5/8 FLAT WASHER, 1/4 THICK, ZP	8
13	2550-709	1/2 WIRE 2 1/2 OD X 1 1/2 ID X 7 1/4 COMPRESSION SPRING	4
14	2570-126	3/4 X 10 EYEBOLT, ZP	4
15	2570-465	7 GAUGE HAIRPIN COTTER ZP	8
16	2975-302	2975 SPRING BUSHING “PAINTED”	4
17	5000-202	MOUNT BRACKET W.A., SINGLE	4
	2528-369	1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE	4
18	5000-256	OVER BEARING ARM 19” LH	2
19	5000-259	OVER BEARING ARM 19” RH	2
20	5000-272	3R30 ROLLER W.A.	2
21	5000-275A	3R30 ROLLER MOUNT W.A.	2
22	5000-309	SUPPORT STRAP	8
23	5000-318	PIVOT BUSHING	4
24	5000-319	MOUNT STRAP 3”	8
25	5000-322	SHIM WASHER ZP	4
26	5000-323	LOCK UP PIN ZP	4
27	5000-355	1 1/4 DISC HARROW BEARING, W209PPB5, HD ASSEMBLY	4
	2550-059	DEVASTATOR BEARING ONLY (NO CAST HOUSING)	4
28	5000-378	SPACER BUSHING	8

5000-025C 6 ROW PART IDENTIFICATION

SEE PREVIOUS PAGE FOR PART NUMBER REFERENCE

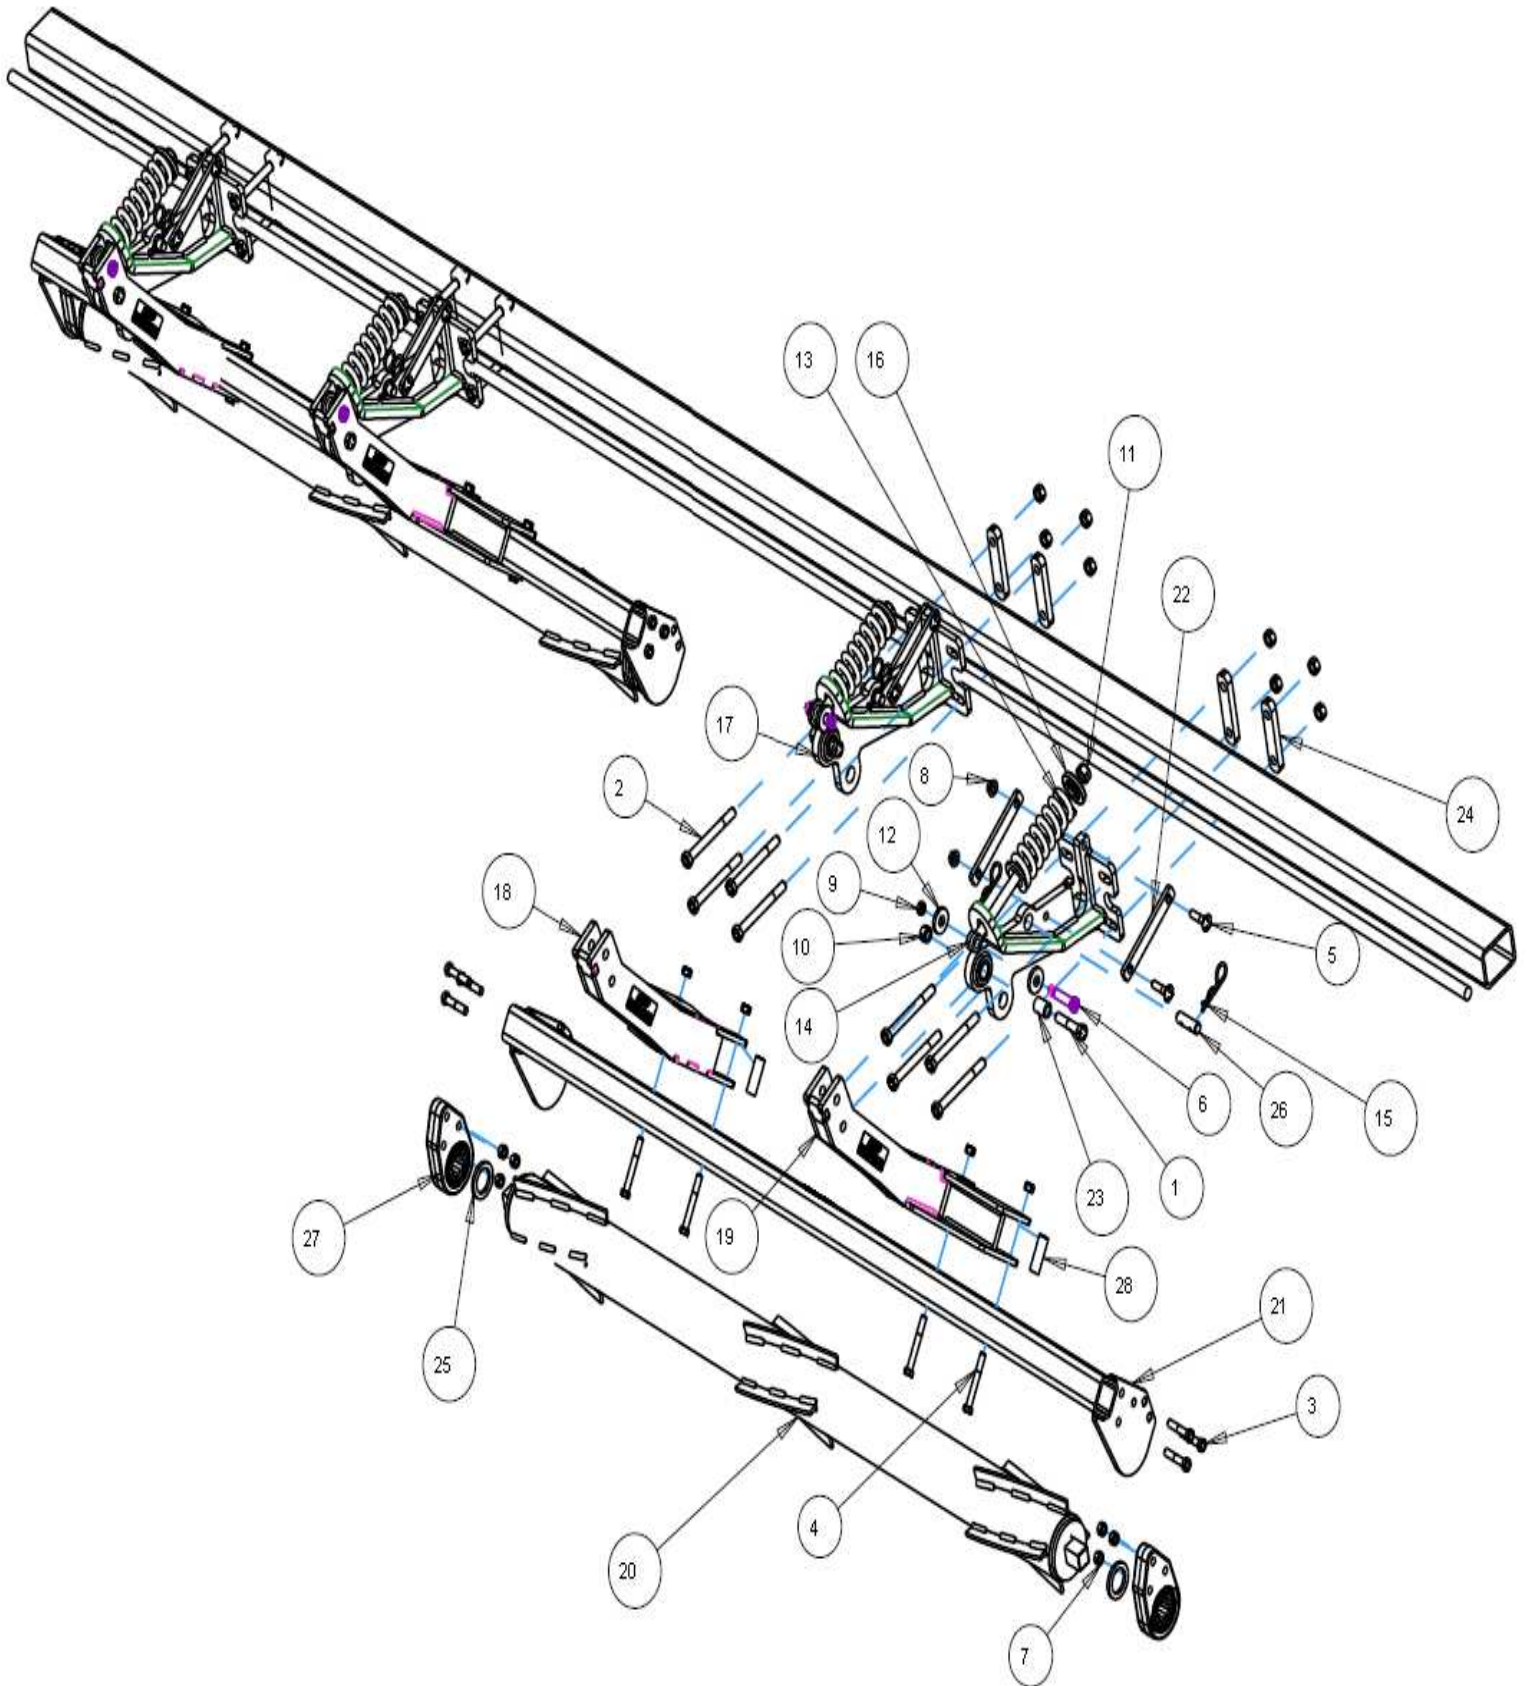


5000-026C 8 ROW PART IDENTIFICATION

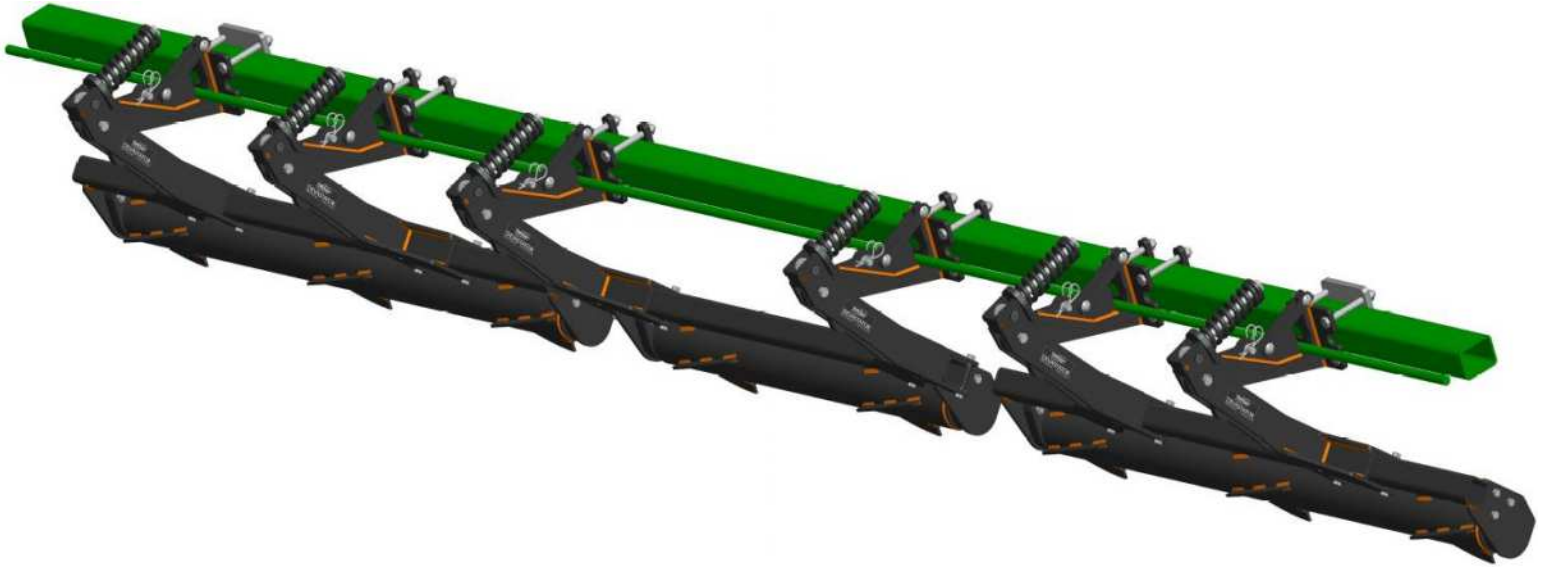


ITEM	PART #	DESCRIPTION	QTY
1	2502-325	5/8 – 11 X 3 HHCS GR 5 ZP	6
2	2502-352	5/8 – 11 X 6 HHCS GR 8 ZP	24
3	2502-353	½ – 13 X 2 ½ HHCS GR 8	18
4	2502-365	½ – 13 X 3 ¾ HHCS GR 5	12
5	2505-345	½ – 13 X 2 CARRIAGE BOLT GR 5 ZP	12
6	2510-121	5/8 DIAMETER SHOULDER BOLT, 2 ¼ SHOULDER, ½ – 13	6
7	2520-357	½ - 13 LOCK HEX NUT, GR A, ZP	30
8	2520-361	½ - 13 FLANGE WHIZ LOCK HEX NUT, GR 5, ZP	12
9	2520-364	½ -13 JAM LOCK HEX NUT	6
10	2520-459	5/8 – 11 LOCK HEX NUT, GR B, ZP	30
11	2520-515	¾ - 10 LOCK HEX NUT, GR A, ZP	6
12	2526-449	5/8 FLAT WASHER, ¼ THICK, ZP	12
13	2550-709	½ WIRE 2 ½ OD X 1 ½ ID X 7 ¼ COMPRESSION SPRING	6
14	2570-126	¾ X 10 EYEBOLT, ZP	6
15	2570-465	7 GAUGE HAIRPIN COTTER ZP	12
16	2975-302	2975 SPRING BUSHING “PAINTED”	6
17	5000-202	MOUNT BRACKET W.A., SINGLE	6
	2528-369	1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE	6
18	5000-203B	ROLLER W.A. 48”	1
19	5000-255	ROLLER MOUNT W.A.	1
20	5000-256	OVER BEARING ARM 19” LH	3
21	5000-259	OVER BEARING ARM 19” RH	3
22	5000-272	3R30 ROLLER W.A.	2
23	5000-275A	3R30 ROLLER MOUNT	2
24	5000-301	“L” MOUNT PLATE FOR 90 SERIES ONLY	2
25	5000-309	SUPPORT STRAP	12
26	5000-318	PIVOT BUSHING	6
27	5000-319	MOUNT STRAP 3”	12
28	5000-322	SHIM WASHER ZP	6
29	5000-323	LOCK UP PIN ZP	6
30	5000-355	1 ¼ DISC HARROW BEARING, W209PPB5, HD ASSEMBLY	6
	2550-059	DEVASTATOR BEARING ONLY (NO CAST HOUSING)	6
31	5000-378	SPACER BUSHING	12

5000-026C 8 ROW PART IDENTIFICATION

SEE PREVIOUS PAGE FOR PART NUMBER REFERENCE

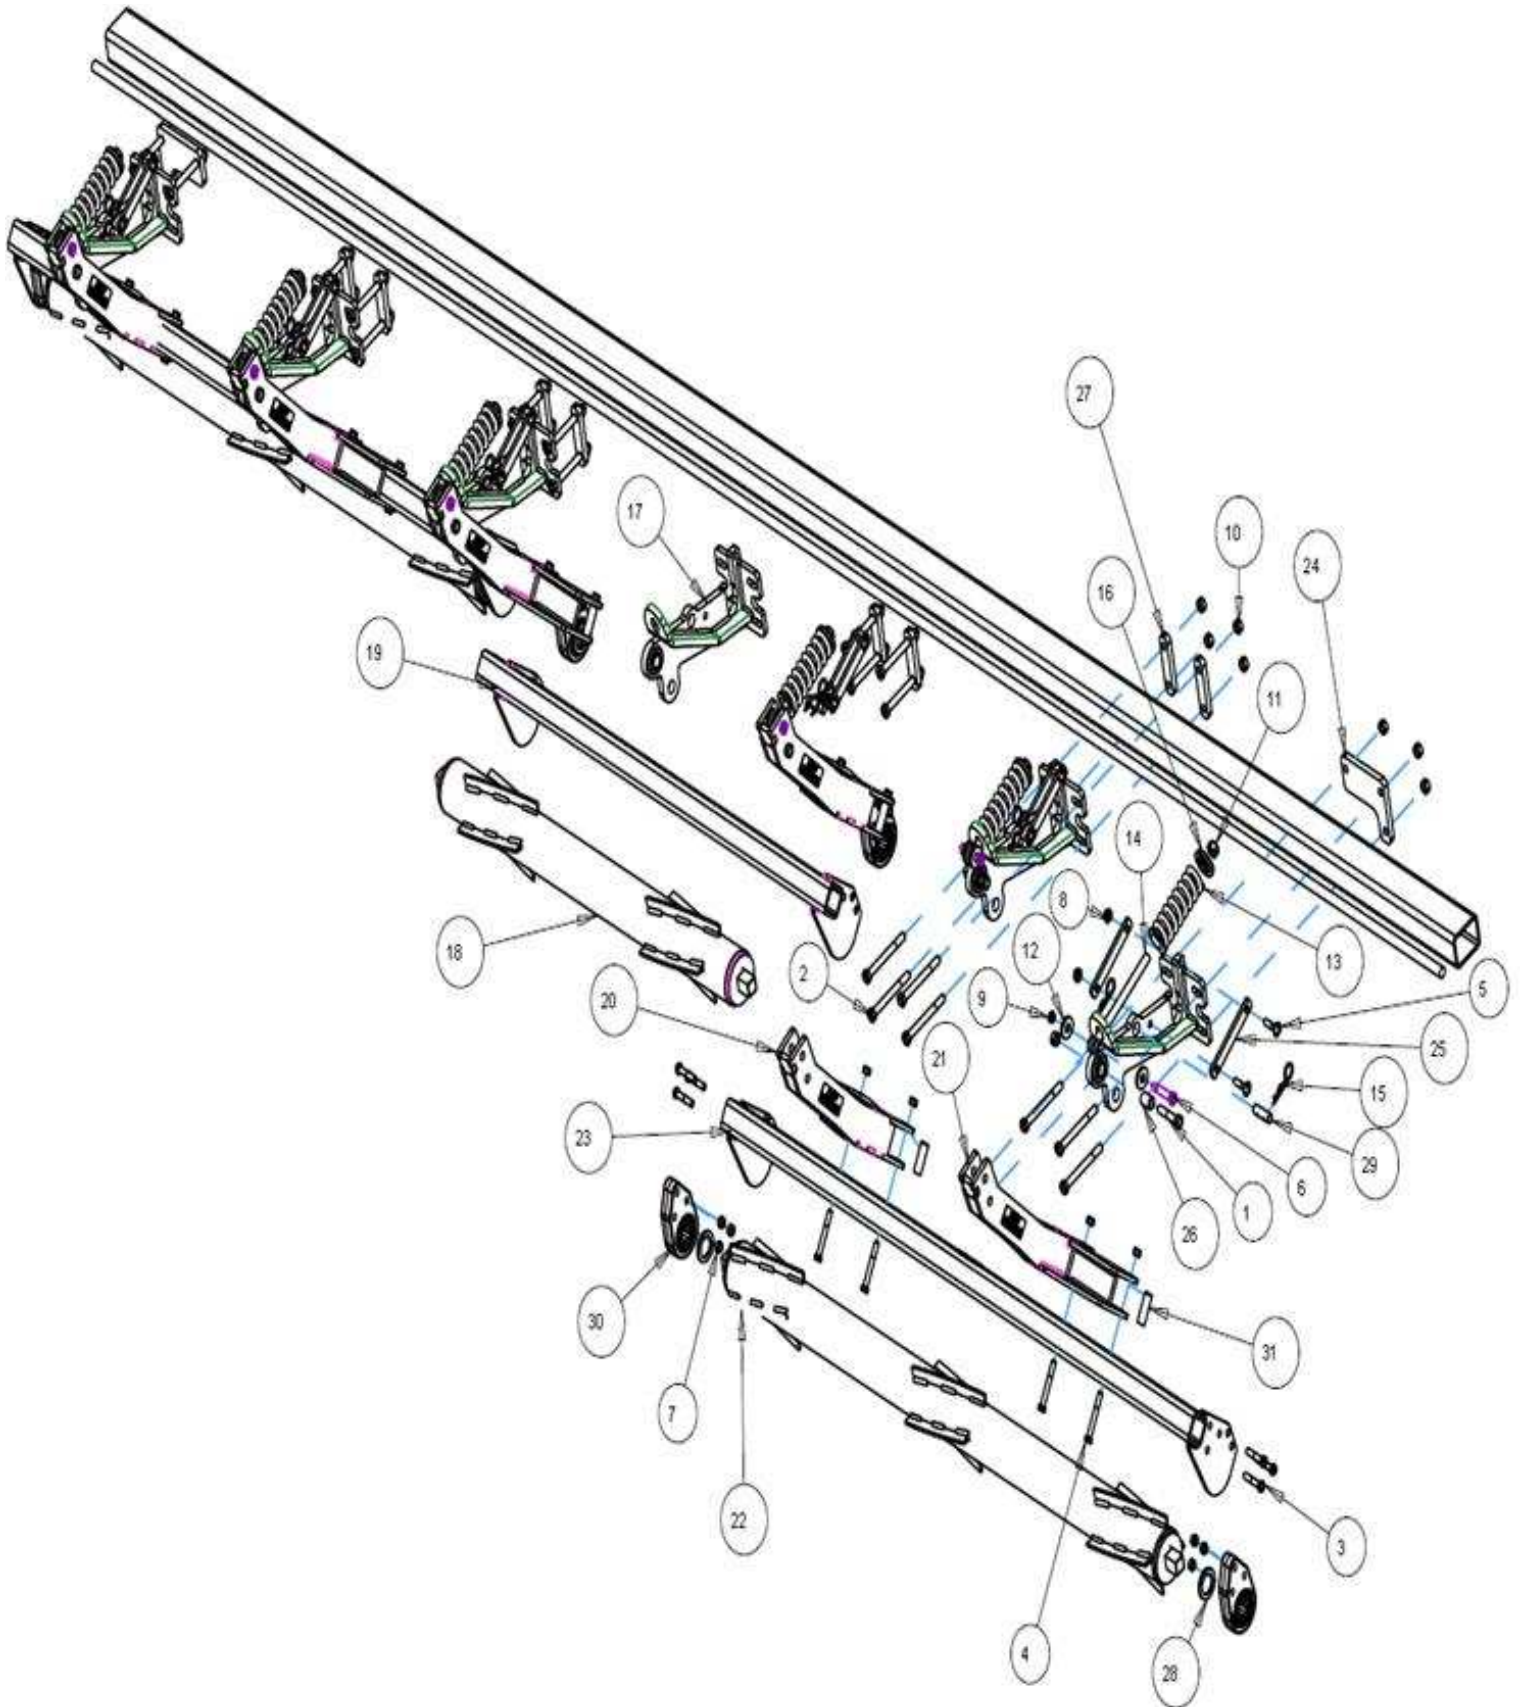


5000-027C 12 ROW PART IDENTIFICATION

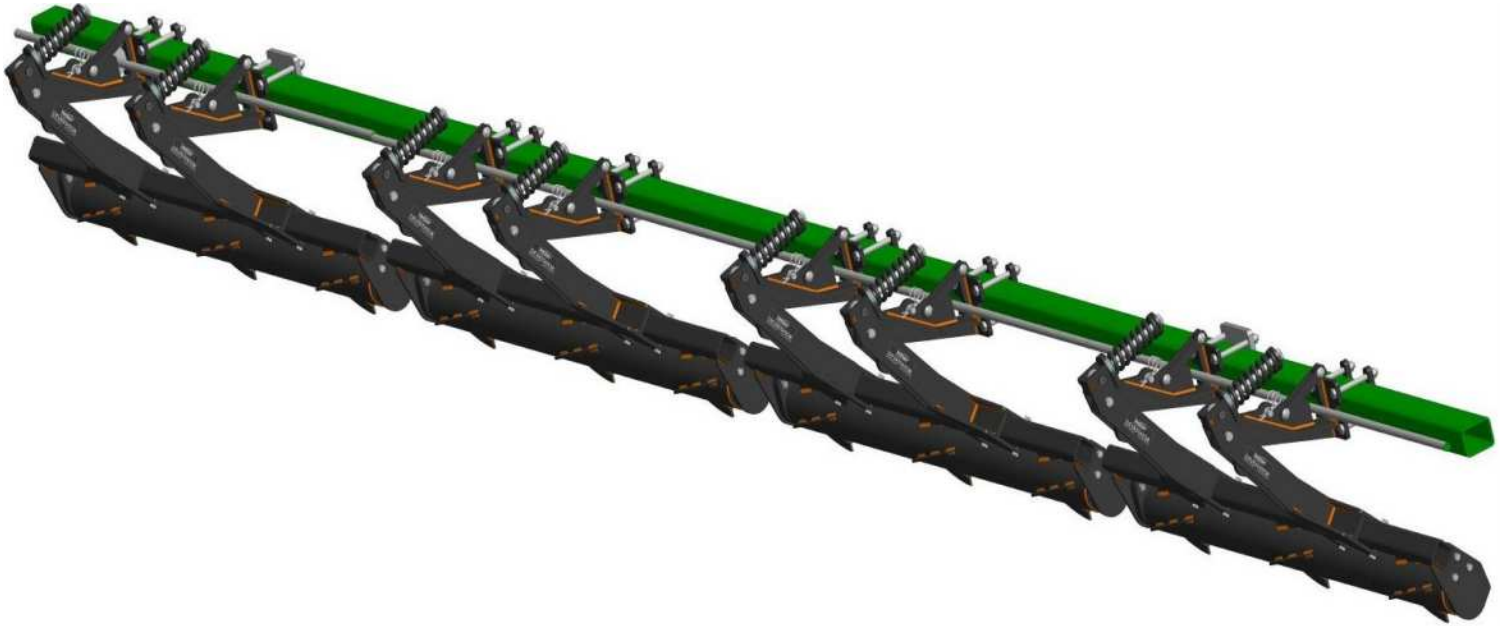

ITEM	PART #	DESCRIPTION	QTY
1	2502-325	5/8 – 11 X 3 HHCS GR 5 ZP	8
2	2502-352	5/8 – 11 X 6 HHCS GR 8 ZP	32
3	2502-353	1/2 – 13 X 2 1/2 HHCS GR 8	24
4	2502-365	1/2 – 13 X 3 3/4 HHCS GR 5	16
5	2505-345	1/2 – 13 X 2 CARRIAGE BOLT GR 5 ZP	16
6	2510-121	5/8 DIAMETER SHOULDER BOLT, 2 1/4 SHOULDER, 1/2 – 13	8
7	2520-357	1/2 - 13 LOCK HEX NUT, GR A, ZP	40
8	2520-361	1/2 - 13 FLANGE WHIZ LOCK HEX NUT, GR 5, ZP	16
9	2520-364	1/2 -13 JAM LOCK HEX NUT	8
10	2520-459	5/8 – 11 LOCK HEX NUT, GR B, ZP	40
11	2520-515	3/4 - 10 LOCK HEX NUT, GR A, ZP	8
12	2526-449	5/8 FLAT WASHER, 1/4 THICK, ZP	16
13	2550-709	1/2 WIRE 2 1/2 OD X 1 1/2 ID X 7 1/4 COMPRESSION SPRING	8
14	2570-126	3/4 X 10 EYEBOLT, ZP	8
15	2570-465	7 GAUGE HAIRPIN COTTER ZP	16
16	2975-302	2975 SPRING BUSHING "PAINTED"	8
17	5000-202	MOUNT BRACKET W.A., SINGLE	8
	2528-369	1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE	8
18	5000-256	OVER BEARING ARM 19" LH	4
19	5000-259	OVER BEARING ARM 19" RH	4
20	5000-272	3R30 ROLLER W.A.	4
21	5000-275A	3R30 ROLLER MOUNT	4
22	5000-301	"L" MOUNT PLATE FOR 90 SERIES ONLY	2
23	5000-309	SUPPORT STRAP	16
24	5000-318	PIVOT BUSHING	8
25	5000-319	MOUNT STRAP 3"	16
26	5000-322	SHIM WASHER ZP	8
27	5000-323	LOCK UP PIN ZP	8
28	5000-355	1 1/4 DISC HARROW BEARING, W209PPB5, HD ASSEMBLY	8
	2550-059	DEVASTATOR BEARING ONLY (NO CAST HOUSING)	8
29	5000-378	SPACER BUSHING	16

5000-027C 12 ROW PART IDENTIFICATION

SEE PREVIOUS PAGE FOR PART NUMBER REFERENCE

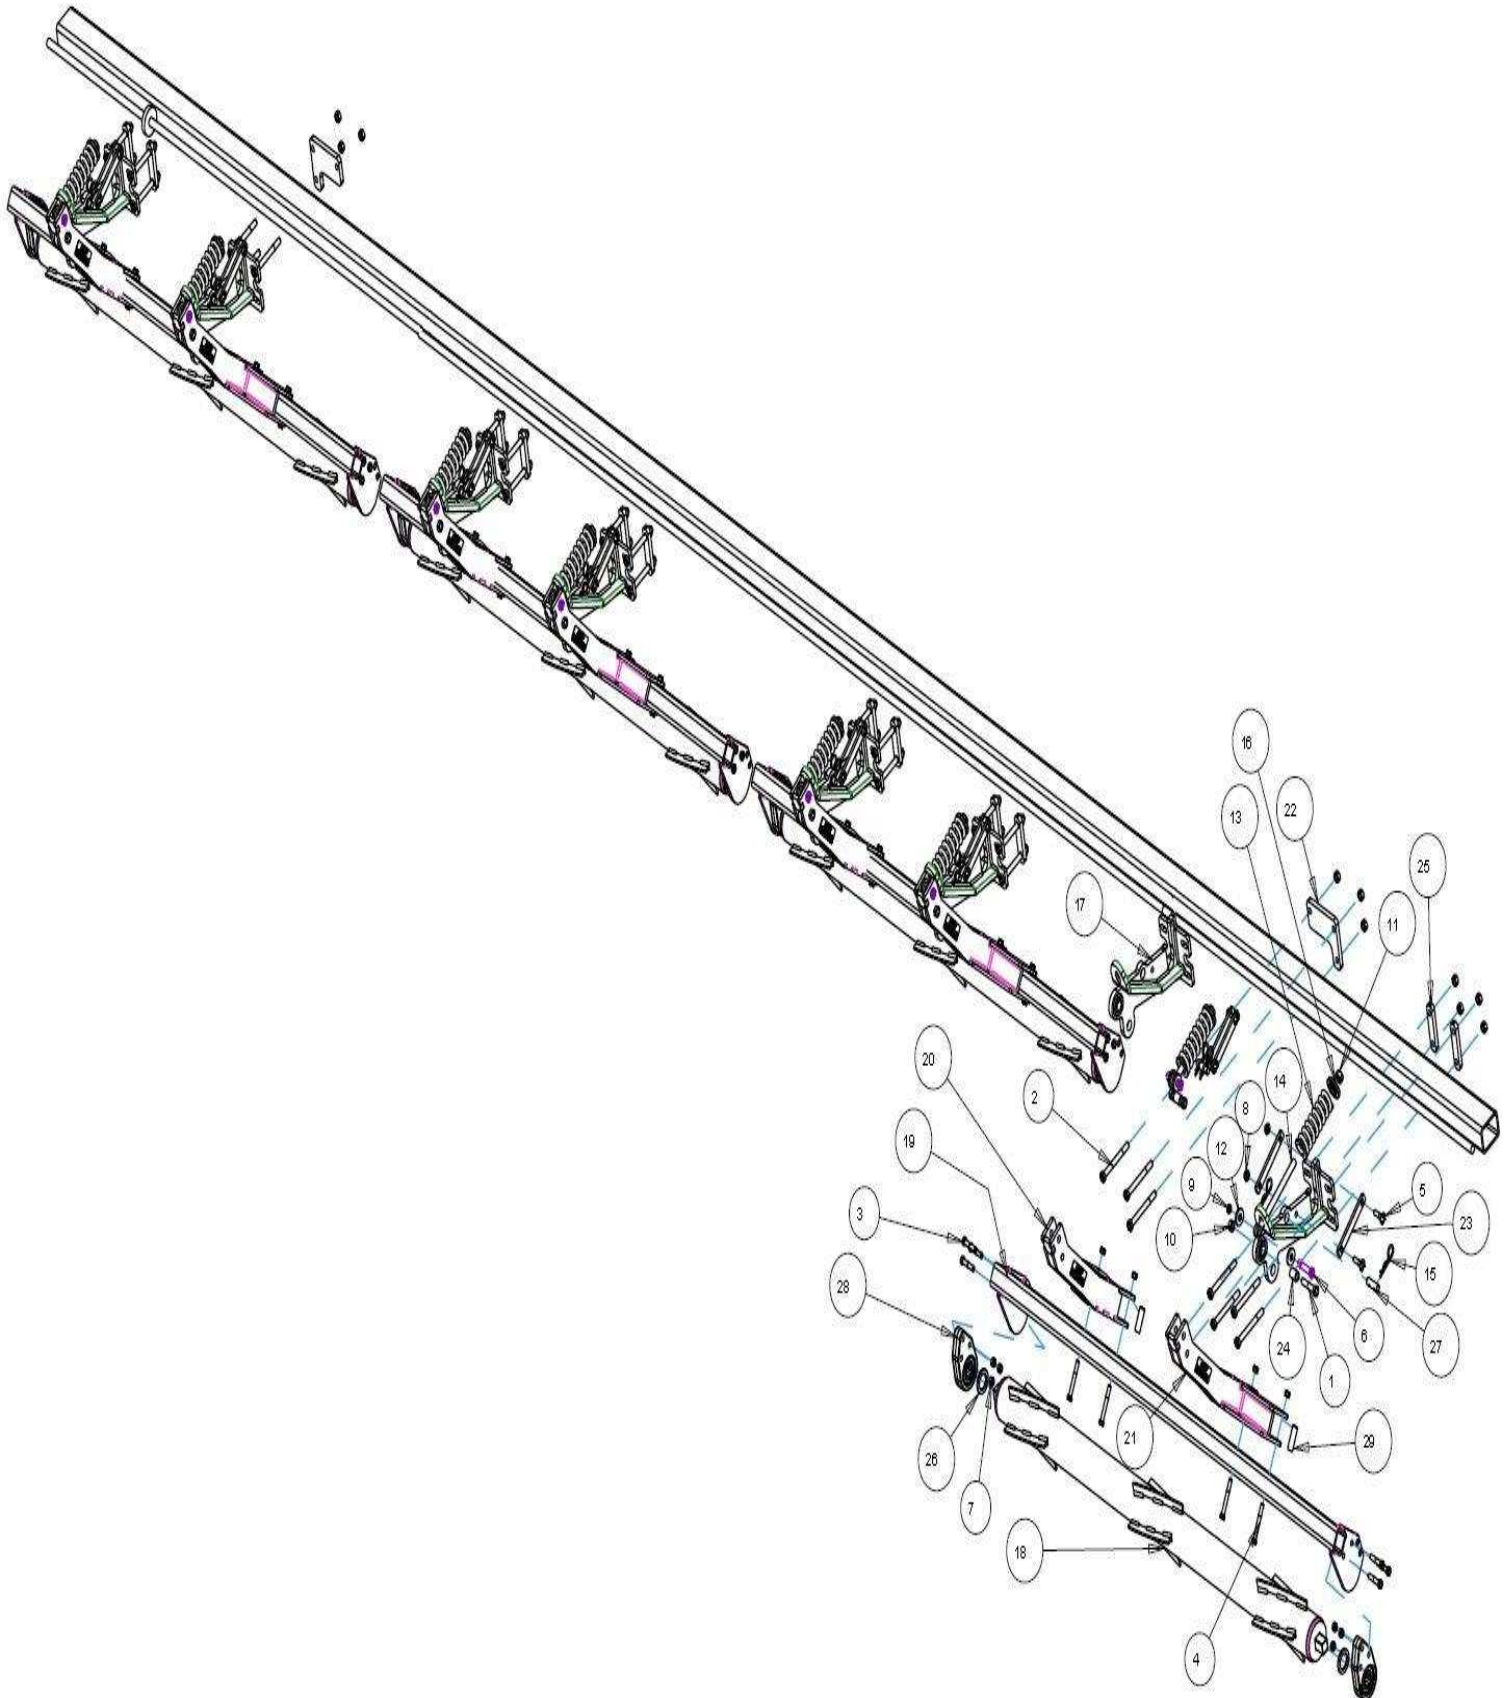


5000-028C 16 ROW PART IDENTIFICATION




ITEM	PART #	DESCRIPTION	QTY
1	2502-325	5/8 – 11 X 3 HHCS GR 5 ZP	12
2	2502-352	5/8 – 11 X 6 HHCS GR 5 ZP	48
3	2502-353	½ – 13 X 2-½ HHCS GR 8	36
4	2502-365	½ – 13 X 3-¾ HHCS GR 5	24
5	2505-345	½ – 13 X 2 CARRIAGE BOLT GR 5 ZP	24
6	2510-121	5/8 DIAMETER SHOULDER BOLT, 2-1/4 SHOULDER, ½ – 13	12
7	2520-357	½ - 13 LOCK HEX NUT, GR A, ZP	60
8	2520-361	½ - 13 FLANGE WHIZ LOCK HEX NUT, GR 5, ZP	24
9	2520-364	½ -13 JAM LOCK HEX NUT	12
10	2520-459	5/8 – 11 LOCK HEX NUT, GR B, ZP	60
11	2520-515	¾ - 10 LOCK HEX NUT, GR A, ZP	12
12	2526-449	5/8 FLAT WASHER, ¼ THICK, ZP	24
13	2550-709	½ WIRE 2-1/2 OD X 1-1/2 ID X 7-1/4 COMPRESSION SPRING	12
14	2570-126	¾ X 10 EYEBOLT, ZP	12
15	2570-465	7 GAUGE HAIRPIN COTTER ZP	24
16	2975-302	2975 SPRING BUSHING “PAINTED”	12
17	5000-202	MOUNT BRACKET W.A., SINGLE	12
	2528-369	1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE	12
18	5000-203A	ROLLER W.A. 48”	2
19	5000-255	ROLLER MOUNT W.A.	2
20	5000-256	OVER BEARING ARM 19” LH	6
21	5000-259	OVER BEARING ARM 19” RH	6
22	5000-272	3R30 ROLLER W.A.	4
23	5000-275A	3R30 ROLLER MOUNT	4
24	5000-309	SUPPORT STRAP	24
25	5000-318	PIVOT BUSHING	12
26	5000-319	MOUNT STRAP 3”	24
27	5000-322	SHIM WASHER ZP	12
28	5000-323	LOCK UP PIN ZP	12
29	5000-355	1 ¼ DISC HARROW BEARING, W209PPB5, HD ASSEMBLY	12
	2550-059	DEVASTATOR BEARING ONLY (NO CAST HOUSING)	12
30	5000-378	SPACER BUSHING	24

5000-028C 16 ROW PART IDENTIFICATION

SEE PREVIOUS PAGE FOR PART NUMBER REFERENCE

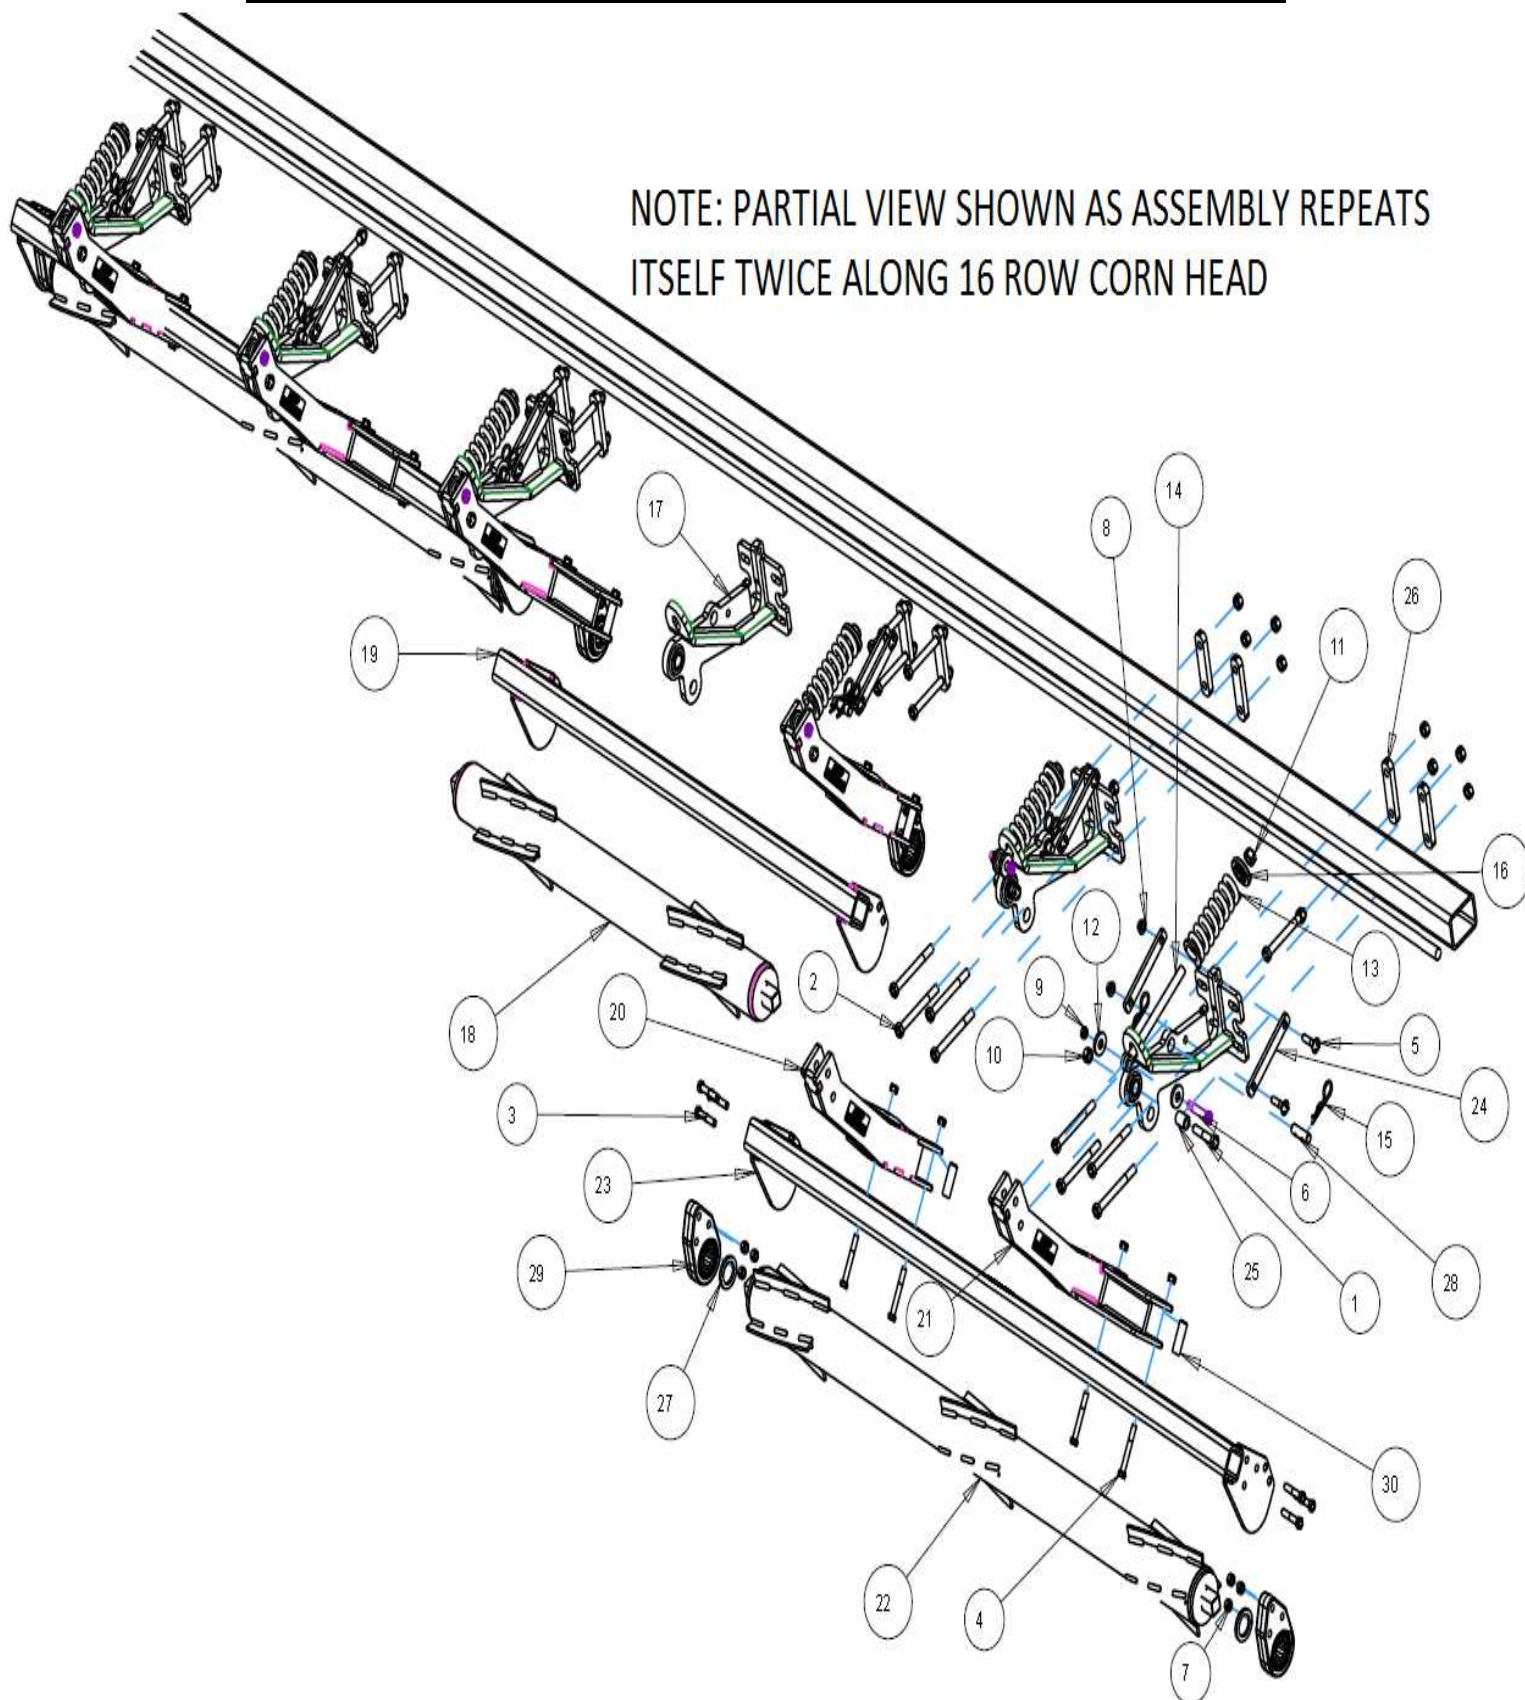


5000-034B 12 ROW FOLDING PART IDENTIFICATION

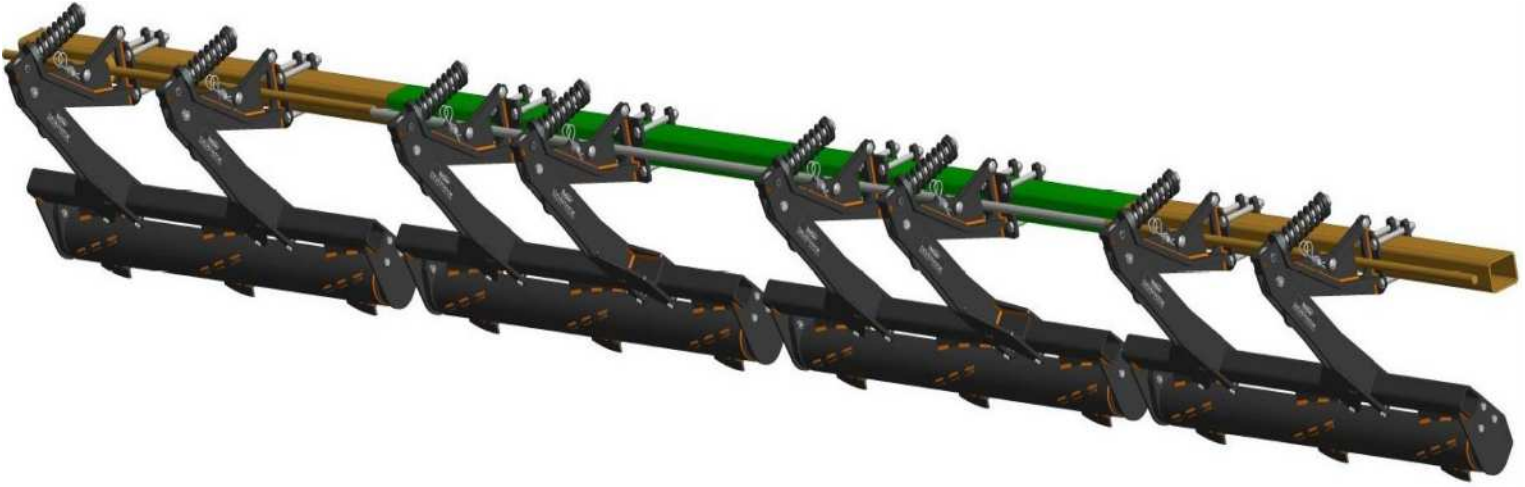

ITEM	PART #	DESCRIPTION	QTY
1	2502-325	5/8 – 11 X 3 HHCS GR 5 ZP	8
2	2502-352	5/8 – 11 X 6 HHCS GR 8 ZP	32
3	2502-353	½ – 13 X 2 ½ HHCS GR 8	24
4	2502-365	½ – 13 X 3 ¾ HHCS GR 5	16
5	2505-345	½ – 13 X 2 CARRIAGE BOLT GR 5 ZP	16
6	2505-414	5/8 – 11 X 6 CARRIAGE BOLT, GR 5, ZP (USED ON ROWS 10/11 & 11/12)	2
7	2510-121	5/8 DIAMETER SHOULDER BOLT, 2 ¼ SHOULDER, ½ – 13	8
8	2520-357	½ - 13 LOCK HEX NUT, GR A, ZP	40
9	2520-361	½ - 13 FLANGE WHIZ LOCK HEX NUT, GR 5, ZP	16
10	2520-364	½ -13 JAM LOCK HEX NUT	8
11	2520-459	5/8 – 11 LOCK HEX NUT, GR B, ZP	40
12	2520-515	¾ - 10 LOCK HEX NUT, GR A, ZP	8
13	2526-449	5/8 FLAT WASHER, ¼ THICK, ZP	16
14	2550-709	½ WIRE 2 ½ OD X 1 ½ ID X 7 ¼ COMPRESSION SPRING	8
15	2570-126	¾ X 10 EYEBOLT, ZP	8
16	2570-465	7 GAUGE HAIRPIN COTTER ZP	16
17	2975-302	2975 SPRING BUSHING “PAINTED”	8
18	5000-202	MOUNT BRACKET W.A., SINGLE USED BETWEEN ROWS 4&5, 5&6, 7&8, 8&9	4
	2528-369	1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE	4
19	5000-256	OVER BEARING ARM 19” LH	6
20	5000-259	OVER BEARING ARM 19” RH	2
21	5000-263	MOUNT BRACKET W.A. USED BETWEEN ROWS 1&2, 2&3, 10&11, 11&12	4
	2528-369	1.380 OD X 1.00 ID X 1.25 L BEARING SLEEVE	4
22	5000-272	3R30 ROLLER W.A.	4
23	5000-275A	3R30 ROLLER MOUNT	4
24	5000-309	SUPPORT STRAP	16
25	5000-318	PIVOT BUSHING	8
26	5000-319	MOUNT STRAP 3”	16
27	5000-322	SHIM WASHER ZP	8
28	5000-323	LOCK UP PIN ZP	8
29	5000-355	1 ¼ DISC HARROW BEARING, W209PPB5, HD ASSEMBLY	8
	2550-059	DEVASTATOR BEARING ONLY (NO CAST HOUSING)	8
30	5000-378	SPACER BUSHING	16
31	5000-402	WEDGE	2

5000-034B 12 ROW FOLDING PART IDENTIFICATION

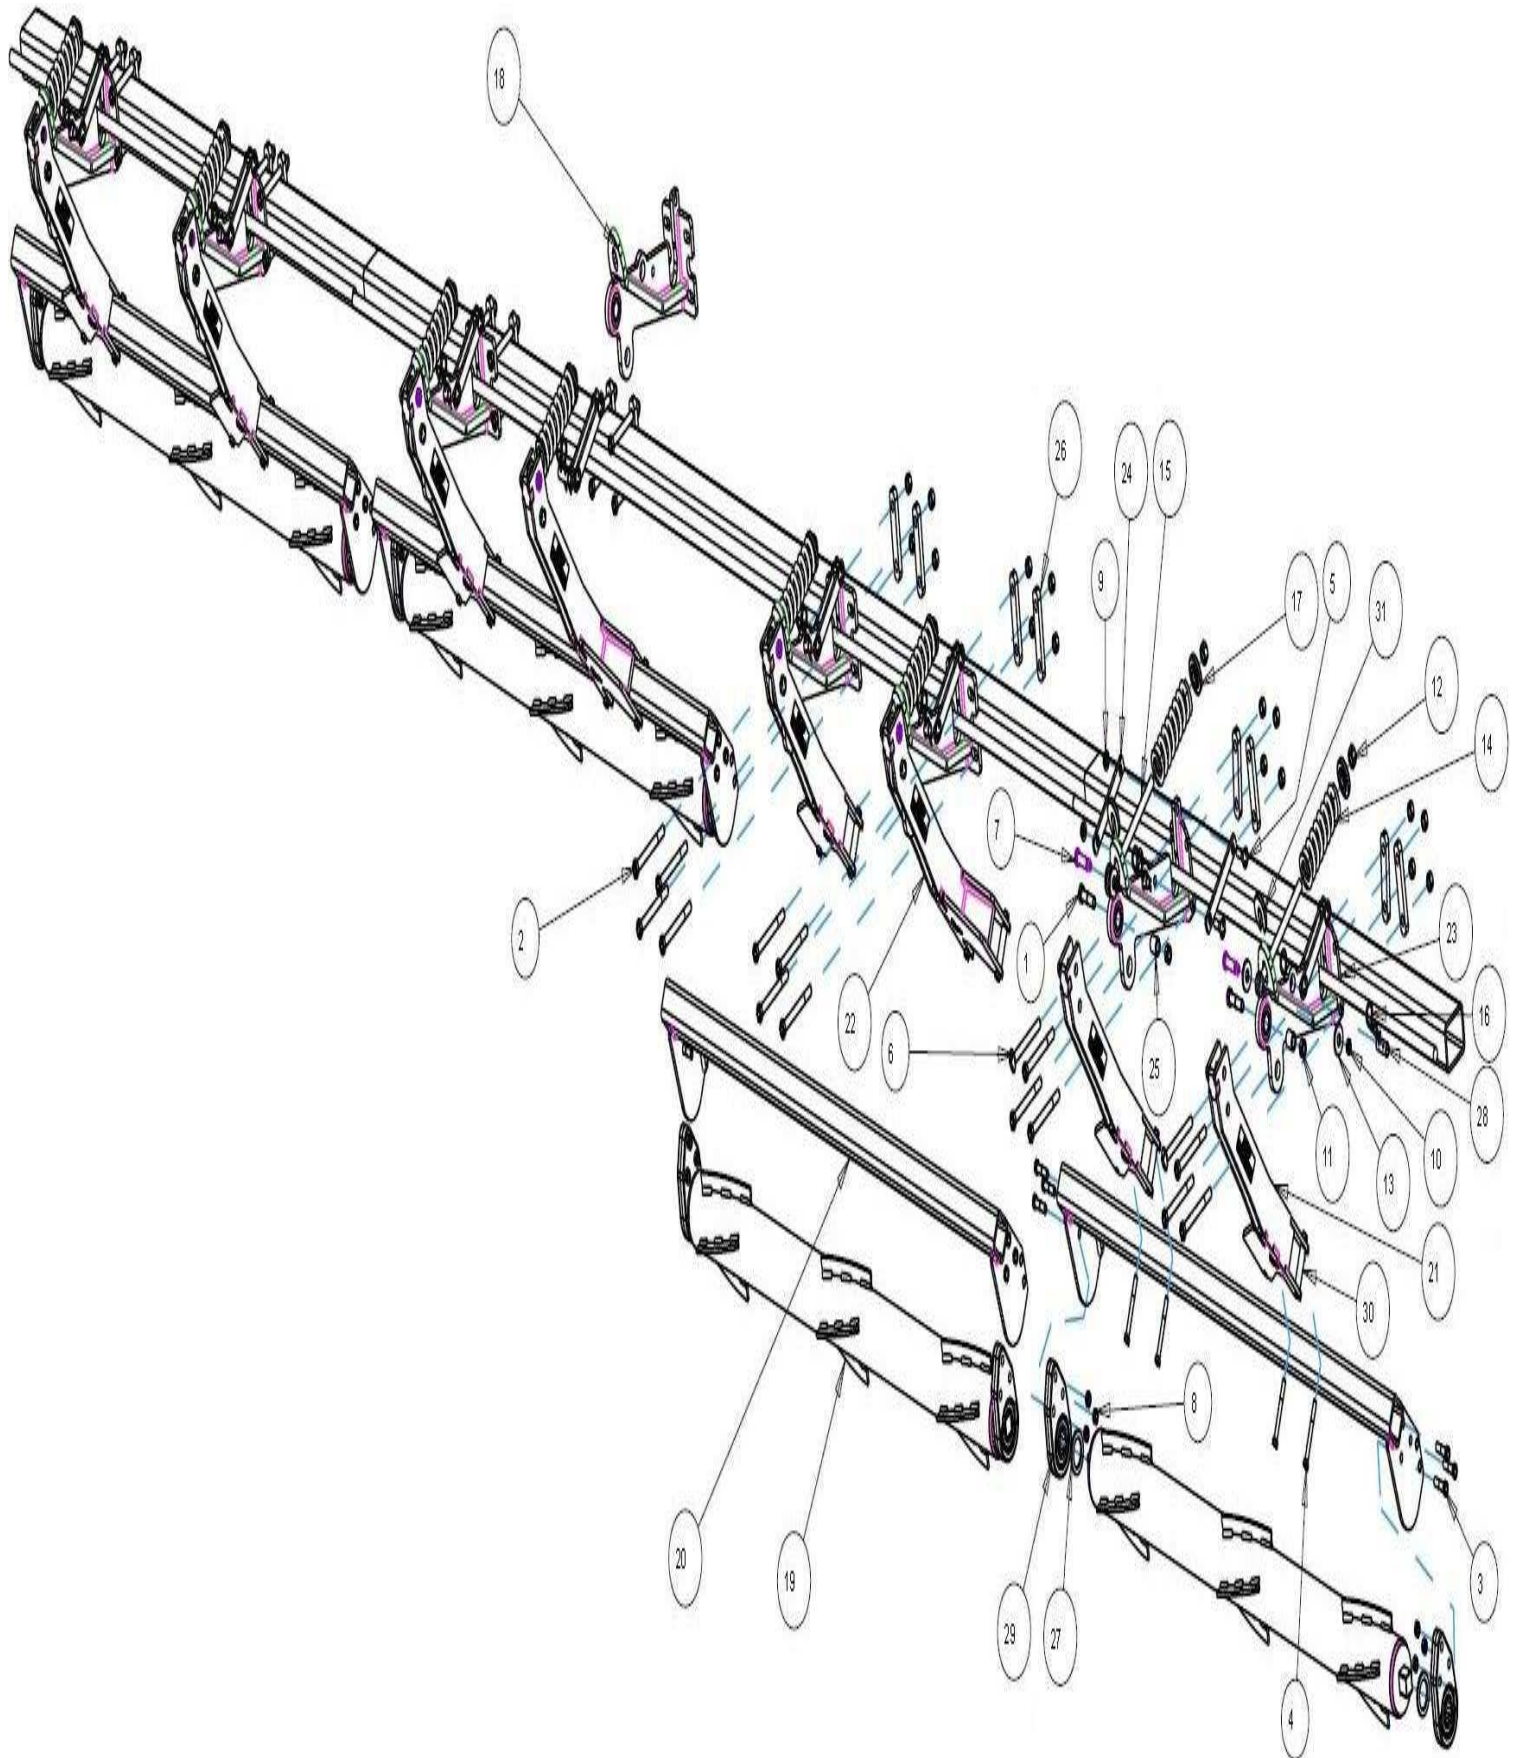





TROUBLESHOOTING

ISSUE	CAUSE	CORRECTIVE ACTION
Residue Plugging	<ol style="list-style-type: none"> 1. Incorrect Head Angle 2. Roller Mount Tube incorrectly installed 3. Pivot arm orientation incorrect 4. Bearing installed incorrectly 5. Intermeshing snapping rolls 6. Too much Spring Tension 	<ol style="list-style-type: none"> 1. Adjust head angle to 23 – 25 degrees (see page 37) 2. Make sure the Bearing Support Tab is on the backside of the Roller Arm Mount Tube 3. Reposition the pivot arm so that it offsets under the snout & not under the row 4. Make sure the side of the bearing that protrudes outside of the cast housing is facing toward the roller (each roller should spin freely by hand) 5. Order the 5000-080 Set Back Kit (order 2 per roller) 6. Back the nut off of the push rod until the nut is flush
Stalk aren't "devastated"	<ol style="list-style-type: none"> 1. Insufficient spring down pressure 2. Operating corn head too high 	<ol style="list-style-type: none"> 1. Tighten push rod nut on spring bushing more 2. Lower corn head until the rollers engage
Corn Head won't fit on head cart	<ol style="list-style-type: none"> 1. Devastators bottom out 2. Roller won't clear cart tire 3. Storage stands don't rest in the saddles on the cart 	<ol style="list-style-type: none"> 1. Adjust top rail & saddles higher on cart 2. Order 5000-082 Lift Kit (raises roller 2") 3. Order 5000-081 Head Extensions (JD 600 & 700 series only)

NOTES



A Tradition of Solutions since 1930

Yetter Farm Equipment Co

PO BOX 358 109 S. McDonough

Colchester, IL 62326-0358

Phone: 309-776-4111

Toll Free: 800-447-5777

Email: info@yetterco.com

For updated models and manuals visit the Yetter website:

www.yetterco.com

© Yetter Farm Equipment Co. All Rights Reserved

2565-785_Rev_F – 6/2021