

## SERVICE INFORMATION

Date: 10/7/25

To: Service Manager / Customer


Service Information # 2940-198 pivot repair kit

Product: 2940 Air Adjust parallel link row cleaners

Model #'s: 2940-001, 002, 003, 004, 005, 006

Step 1: Remove the upper parallel link bolt and bushing. Grind paint off surface to be welded. Use the

bushing to locate the pivot repair tab in position

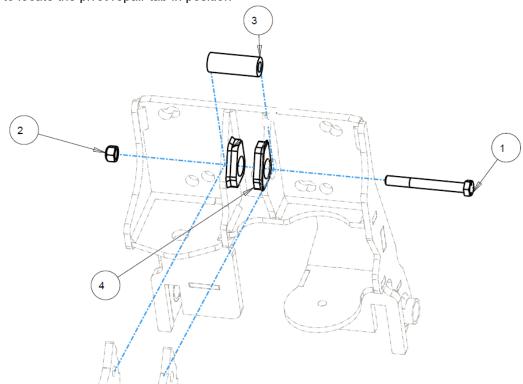

Step 2: Weld in pivot repair tabs. Paint after surface has cooled.

Step 3: Put in new pivot bushing and reassemble parallel arm.

If you have any questions or comments concerning this bulletin please contact Yetter @ 1-800-447-5777 ask to speak to the service department or e-mail: info@yetterco.com

> YETTER MANUFACTURING COMPANY INC. P.O. BOX 358 COLCHESTER, IL 62326 800-447-5777

FAX: 309-776-3222 WEBSITE: WWW.YETTERCO.COM E-MAIL: INFO@YETTERCO.COM