

6200-108 - HD TWISTED LINK DRAG CHAIN KIT

DET	QTY	PART NO.	DESCRIPTION
1	2	2502-237	3/8-16 X 1" HHCS GR.5 ZP
2	2	6200-338	MOUNTING BRACKET
3	2	2526-253	3/8 SAE FLAT WASHER
4	2	2520-255	3/8-16 LOCK HEX NUT
5	2	6200-339	5/16 SPLIT CONNECTING LINK
6	1	6200-340	19 LINK TWISTED CHAIN


YETTER MANUFACTURING CO.

FOUNDED 1930

Colchester, IL 62326-0358 Toll free: 800/447-5777


309/776-3222 (Fax)

Website: www.yetterco.com
E-mail: info@yetterco.com

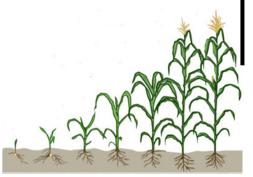

GERMINATE UNIFORMITY ™

INSTALLATION / ASSEMBLY INSTRUCTIONS

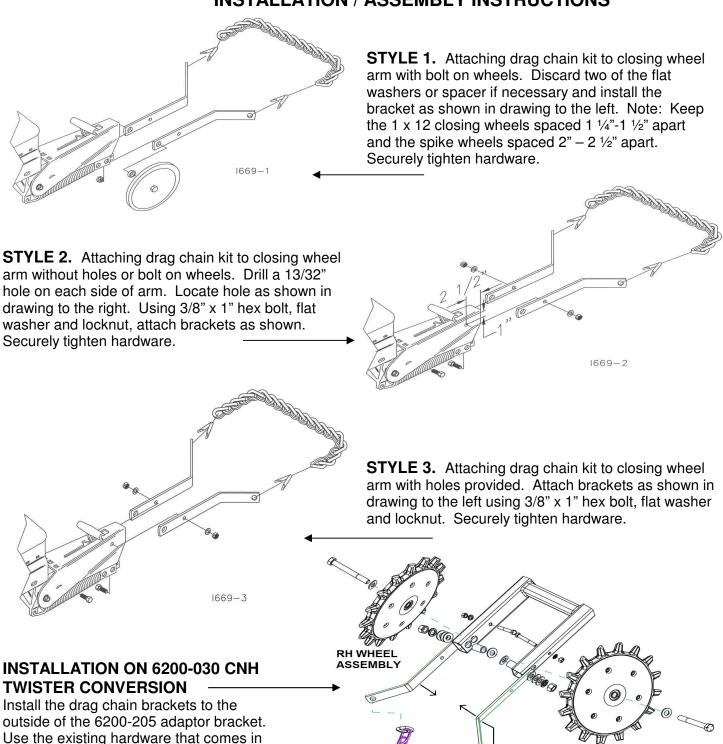

Adjustments: Position brackets to carry front of chain about 3"-4" above soil. Securely tighten hardware. For best soil leveling, keep front end of the chain as low as possible while maintaining clearance above the soil for the bracket ends. Use drag chains when planting in minimum till or in no-till where at least some of the soil surface is dry.

LH WHEEL

ASSEMBLY

BRACKETS MAY NEED BENT INWARD TO COMPENSATE THE WIDTH. THE CHAIN SHOULD ONLY MOVE SOIL. NOT RESIDUE

NOTE: As with any type of furrow closing devise it is advisable to do in field checks and make adjustments as necessary. There is no substitute for visual inspection to verify that the seed is being properly placed. Careful attention is required when using herbicide and/or insecticide, consult your chemical provider for compatibility.

the 6200-030 kit.

6200-108 DRAG CHAIN APPLICATION CHART

		40 MM BEARING BOLT ON WHEEL	WATER PUMP BEARING W/ HOLES IN ARM	WATER PUMP BEARING W/O HOLES IN ARM	HOLES IN	
MAKE	MODEL					WHERE TO ATTACH 6200-108 DRAG CHAIN
YETTER	6000-002	X				MOUNT TO WHEEL BOLT
JOHN DEERE	7000/ME 7200/ME II		X		Х	MOUNT TO HOLES IN ARM MOUNT TO HOLES IN ARM
	1700/ME II PLUS	Х				MOUNT TO WHEEL BOLT
KINZE	PRE-1993			X		DRILL HOLES
	1993- PRESENT	X				MOUNT TO WHEEL BOLT
WHITE	5100		X			MOUNT TO HOLES IN ARM
	6100	X				MOUNT TO WHEEL BOLT
	8000	X				MOUNT TO WHEEL BOLT
GREAT PLAINS	ALL	Х				MOUNT TO WHEEL BOLT
LANDOLL/DEUT Z-ALLIS	ALL	N/A	N/A	N/A	N/A	N/A
MONOSEM	NG PLUS	X				MOUNT TO WHEEL BOLT
SHOUP	CW 7050		X			MOUNT TO HOLES IN ARM
	CW 3000		X			MOUNT TO HOLES IN ARM
CASE/ NEW HOLLAND	ALL	N/A	N/A	N/A	N/A	N/A
HARVEST INTN'L	LASER PRO 1	Х	N/A	N/A	N/A	MOUNT TO WHEEL BOLT

TROUBLE SHOOTING

PROBLEM

Drag chain not doing much

SOLUTION

Chain bracket needs to be 3" – 4" above soil so more of chain contacts soil

Install Residue Manager

Drag chain gets caught on spike wheel or chain bracket

Install a deflector or guard. Weld a "U" shaped bar of round rod to the top rear corner of the 6200-338 mounting bracket.





A Tradition of Solutions since 1930

Yetter Farm Equipment Co

PO BOX 358 109 S. McDonough

Colchester, IL 62326-0358

Phone: 309-776-4111

Toll Free: 800-447-5777

Email: info@yetterco.com

For updated models and manuals visit the Yetter website:

www.yetterco.com

© Yetter Farm Equipment Co. All Rights Reserved